

Arboricultural Consultancy for Aviva

Note: This report is intended for use between the client, Environmental Services and any parties detailed within the report. It is based on the understanding at the time of visiting the property that Engineers are satisfied that damage is attributable to clay shrinkage subsidence exacerbated by vegetation.

1. Case Details

Insured	Miss Nava Orstein	Address	112 Mount View Road, London, N4 4JX		
Client	Subsidence Management Services	Contact	Cyril Nazareth	Claim No.	IFS-AVI-SUB-20-0089882
ES Ref	SA-247597	Consultant	Kirk Thompson	Contact No.	0330 380 1036
Report Date	16/06/2021				

Scope of Report: To survey the property and determine significant vegetation contributing to subsidence damage, make recommendation for remedial action and assess initial mitigation and recovery prospects. The survey does not make an assessment for decay or hazard evaluation.

2. Property and Damage Description

The insured structure is a 3 storey end-terrace house with a full basement. It has been extended with a single-storey extension to the rear. The property occupies a site that slopes gently downhill from front to rear.

We are advised that damage is noted throughout the insured dwelling where cracking indicates downwards moveemnt.

3. Technical Reports

In preparing our report we have had the benefit of the following technical investigations:

Soil Analysis	☒	Foundation Detail	☒	Root Analysis	☒
Borehole Log	☒	Monitoring	☒		

4. Action Plan

Mitigation	
Insured involved?	Yes
Local Authority involved?	Yes
Other third party Mitigation involved?	Yes
Recovery	
Is there a potential recovery action?	Yes

Treeworks	
Local Authority	Haringey London Borough
TPO / Conservation Area / Planning Protection Searches	Insured: Conservation Area Adjacent & Adjoining properties: Conservation Area
Additional Comments	
Awaiting Further Instructions.	
A potential recovery action has been identified.	
Engineers should consider focusing investigations to strengthen factual evidence for disclosure to third party tree owners.	

Arboricultural Consultancy for Aviva

5. Technical Synopsis

This report is based on our understanding, at the time of visiting the property, that Subsidence Management Services are satisfied that damage is the result of clay shrinkage subsidence exacerbated by the indirect influence of vegetation.

The conditions necessary for clay shrinkage subsidence to occur have been established by site investigations / monitoring and roots have also been recovered below the property (TP/BH1, TP/BH2 & TP/BH3).

Samples of these roots were recovered from underside of foundations and throughout the borehole, these roots were identified (using anatomical analysis) as having emanated from the genera Leguminosae spp, Sambucus spp. Prunus spp. Platanus spp. and a broadleaved species, too juvenile for positive identification.

Given the above, vegetation is deemed to retain the capacity to be causal to the current movement / damage.

We have therefore been instructed to advise on the causal vegetation and to deliver management proposals which will provide on-going and long-term stability allowing repairs to be undertaken.

In assessing the potential drying influence of the vegetation on site, we have considered, in addition to the above, species profile, normally accepted influencing distance and the position of vegetation relative to the observed damage.

Our survey of the site identified the London Plane (T2), False Acacia (T5), Elder (T7) and Cherry (T8), given their position relative to the damage it is our opinion that the roots identified will emanate from this vegetation.

The size and proximity of the above vegetation is consistent with the location of damage; accordingly, we have identified their collective / cohesive influence as the primary cause of the subsidence damage.

Given the above and considering the advised mechanism of movement, in order to mitigate the current damage thereby allowing soils beneath the property to recover to a position such that an effective engineering repair solution can be implemented, we recommend a program of vegetation management as detailed by this report.

Please refer to Section 6 for management prescriptions.

The recommendations contained within this report are prescribed to give the most reliable arboricultural solution likely to restore long-term stability.

Consequently, complete removal of the London Plane (T2), False Acacia (T5), Elder (T7) and Cherry (T8) will offer the arboricultural solution most likely to restore long-term stability.

We recommend the efficacy of the management recommendations be qualified by means of further monitoring to confirm stability.

Please note that the footing of the insured property fall within the anticipated rooting distance of additional vegetation which we believe presents a foreseeable risk of future damage and accordingly we have made recommendations in respect of this.

The extent / impact of vegetation management required to restore and maintain long-term stability at this property is acknowledged. However, we consider the impact on the wider public amenity from the proposed tree works is mitigated by the presence of further trees and the scope for replacement planting.

Whilst replacement planting is considered appropriate, due consideration must be given to the ultimate size of the replacement and future management requirements. Species selection should be appropriate for the chosen site and ultimate tree height should not exceed 75% of the available distance to built structures.

Is vegetation likely to be a contributory factor in the current damage?	Yes
Is vegetation management likely to contribute to the future stability of the property?	Yes
Is replacement planting considered appropriate?	See above
Would DNA profiling be of assistance in this case?	No

Arboricultural Consultancy for Aviva

6.0 Recommendations

6.1 Current Claim Requirements

These recommendations may be subject to review following additional site investigations.

Tree No.	Species	Age Cat	Approx. Height (m)	Distance to Building (m) *	Ownership	Action	Requirement
T2	Plane (London)	1	11	4.8	B - Local Authority	Remove	Remove close to ground level; do not treat stump due to translocation risk. Where such a risk exists, we advise that any emergent regrowth is removed annually.
T5	False Acacia	1	9	3.5	A - Third Party	Remove	Remove close to ground level and treat stump to inhibit regrowth.
T7	Elder	1	3.2	4.2	C - Insured	Remove	Remove close to ground level and treat stump to inhibit regrowth.
T8	Cherry	1	7.4	6	C - Insured	Remove	Remove close to ground level; do not treat stump due to translocation risk. Where such a risk exists, we advise that any emergent regrowth is removed annually. 4m from single storey extension
Age Cat: 1 = Younger than property; 2 = Similar age to the property; 3 = Significantly older than property							

* Estimated

Arboricultural Consultancy for Aviva

6.2 Future Risk Recommendations


These recommendations may be subject to review following additional site investigations.

Tree No.	Species	Age Cat	Approx. Height (m)	Distance to Building (m) *	Ownership	Action	Requirement
C1	Ivy	1	3.5	5.3	E - Boundary Veg (ownership to be confirmed)	No action	No works.
H1	Mixed species hedge	1	2	1.3	C - Insured	Action to avoid future risk	Maintain at broadly current dimensions by way of regular pruning. Hedge comprises Honeysuckle, Ivy and Privet
H2	Mixed species hedge	1	1.6	4.4	C - Insured	Action to avoid future risk	Maintain at broadly current dimensions by way of regular pruning. Hedge includes Ivy, Pyracantha, Sycamore, Ash and Cherry
SG1	Mixed species shrubs	1	2	2	C - Insured	No action	No works. Lonicera, Privet, Holly, Hydrangea and Fuchsia
SG2	Mixed species shrubs	1	3	3.5	A - Third Party	No action	No works. Including Rose, Pyracantha, Holly and Jasmine
T1	Plane (London)	1	12.5	7.6	B - Local Authority	Action to avoid future risk	Re-pollard back to points of previous reduction and repeat in accordance with BRE IP7/06 i.e. 3-year (max) regime.
T10	Willow	1	12	15	A - Third Party	Action to avoid future risk	Maintain at broadly current dimensions by way of regular pruning. Distance recorded to extension, 20m from rear elevation.
T3	Plane (London)	1	15	11.5	B - Local Authority	Action to avoid future risk	Re-pollard back to points of previous reduction and repeat in accordance with BRE IP7/06 i.e. 3-year (max) regime.
T4	Birch	1	9.5	7	A - Third Party	Action to avoid future risk	Maintain at broadly current dimensions by way of regular pruning.
T6	Juniper	1	1.5	1.5	C - Insured	Action to avoid future risk	Maintain at broadly current dimensions by way of regular pruning.
T9	Loquat	1	4.2	10	C - Insured	No action	No works.
Age Cat: 1 = Younger than property; 2 = Similar age to the property; 3 = Significantly older than property							

* Estimated

Third party property addresses should be treated as indicative only, should precise detail be required then Environmental Services can undertake Land Registry Searches

7. Site Plan

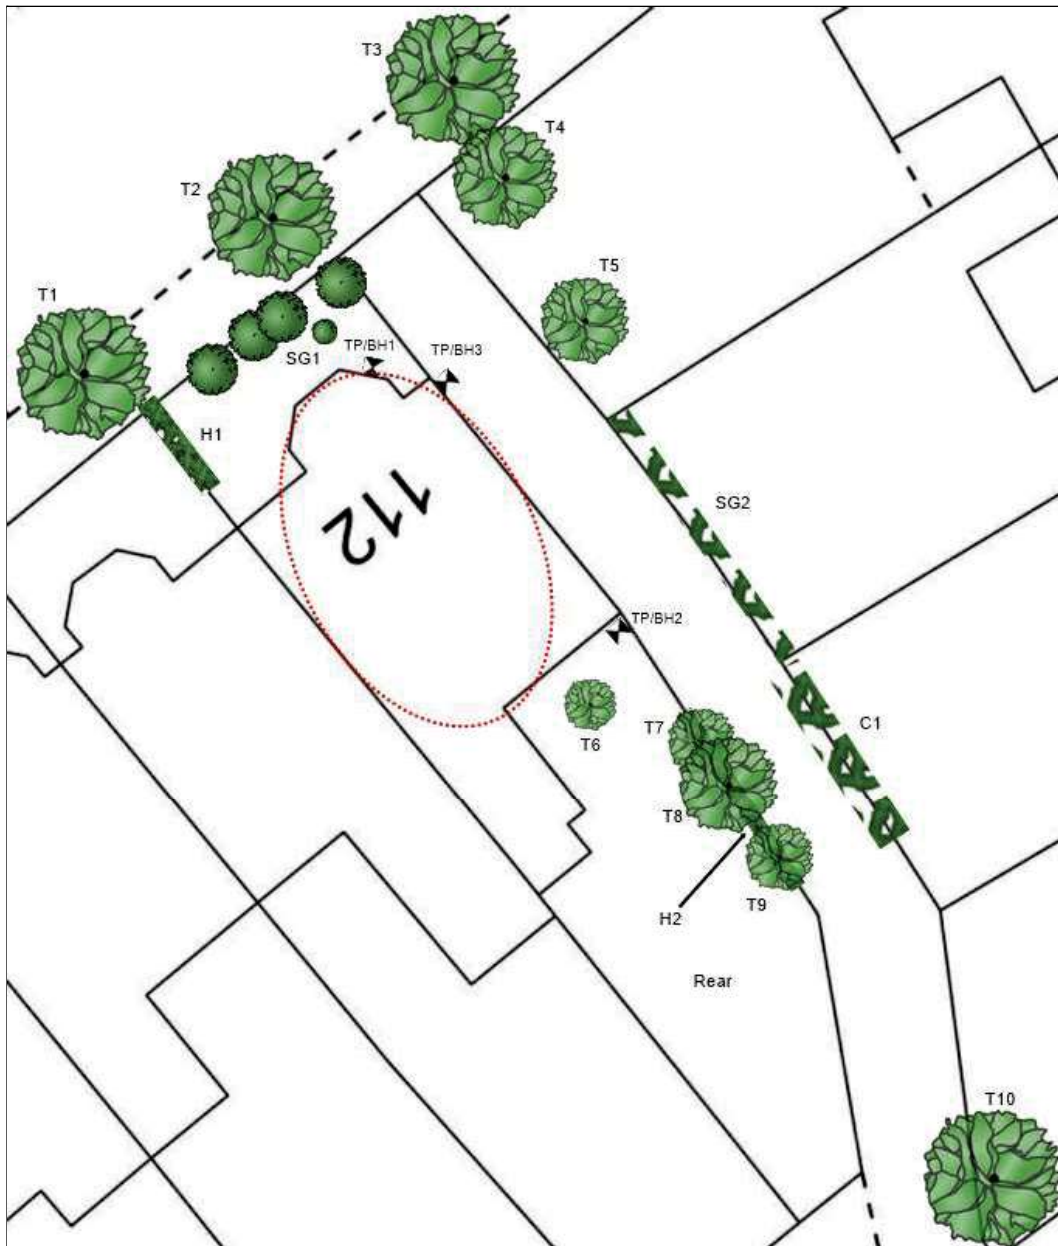

Please note that this plan is not to scale. OS Licence No. 100043218

Arboricultural Consultancy for Aviva

8. Photographs



H1 - Mixed species hedge



SG2 - Mixed species shrubs



T7 - Elder



T8 - Cherry



T9 - Loquat



H2 - Mixed species hedge

Arboricultural Consultancy for Aviva



T10 - Willow



SG1 - Mixed species shrubs



T1 - Plane (London)



T2 - Plane (London)



T3 - Plane (London)



T4 - Birch

Arboricultural Consultancy for Aviva



T5 - False Acacia



T6 - Juniper



C1 - Ivy



T9 - Other

Arboricultural Consultancy for Aviva

Date: 16/06/2021

Property: 112 Mount View Road, London, N4 4JX

9. Tree Works Reserve - Does not include recommendations for future risk.

Insured Property Tree Works	£1420.00
Third Party Tree Works	£720.00
Provisional Sum	£0.00

- The above prices are based on works being performed as separate operations.
- The above is a reserve estimate only.
- Ownerships are assumed to be correct and as per Section 6.
- A fixed charge is made for Tree Preservation Order/Conservation Area searches unless charged by the Local Authority in which case it is cost plus 25%.
- Should tree works be prevented due to statutory protection then we will automatically proceed to seek consent for the works and Appeal to the Secretary of State if appropriate.
- All prices will be subject to V.A.T., which will be charged at the rate applying when the invoice is raised.
- Trees are removed as near as possible to ground level, stump and associated roots are not removed or included in the price.
- Where chemical application is made to stumps it cannot always be guaranteed that this will prevent future regrowth. Should this occur we would be pleased to provide advice to the insured on the best course of action available to them at that time. Where there is a risk to other trees of the same species due to root fusion, chemical control may not be appropriate.

10. Limitations

This report is an appraisal of vegetation influence on the property and is made on the understanding that that engineers suspect or have confirmed that vegetation is contributing to clay shrinkage subsidence, which is impacting upon the building. Recommendations for remedial tree works and future management are made to meet the primary objective of assisting in the restoration of stability to the property. In achieving this, it should be appreciated that recommendations may in some cases be contrary to best Arboricultural practice for tree pruning/management and is a necessary compromise between competing objectives.

Following tree surgery we recommended that the building be monitored to establish the effectiveness of the works in restoring stability.

The influence of trees on soils and building is dynamic and vegetation in close proximity to vulnerable structure should be inspected annually.

The statutory tree protection status as notified by the Local Authority was correct at the time of reporting. It should be noted however that this may be subject to change and we therefore advise that further checks with the Local Authority MUST be carried out prior to implementation of any tree works. Failure to do so can result in fines in excess of £20,000.

Our flagging of a possible recovery action is based on a broad approach that assume all third parties with vegetation contributing to the current claim have the potential for a recovery action (including domestic third parties). This way opportunities do not "fall through the net"; it is understood that domestic third parties with no prior knowledge may be difficult to recover against but that decision will be fully determined by the client.

A legal Duty of Care requires that all works specified in this report should be performed by qualified, arboricultural contractors who have been competency tested to determine their suitability for such works in line with Health & Safety Executive Guidelines. Additionally all works should be carried out according to British Standard 3998:2010 "Tree Work. Recommendations".