

Room Ref.	Door Ref.	Internal Image	Description	Proposed Works/Notes
GROUND FLOOR – MEND FUNDED AREAS				
G6 EAST WING GALLERY	G6.Do2		Existing Doors: Single glazed timber framed painted double doors (2 x 5). Painted timber panelled head and architrave surround. Folding shutters and shutter boxes – lower half restricted by radiator position therefore cannot be opened fully. Existing Ironmongery: - Bespoke locking mechanism – bolt installed at base of leading leaf. - Note: Door not openable at time of inspection (may have been painted shut).	Internal Works: - Overhaul existing glazed doors, mechanisms and shutters, prepare and redecorate to match existing. - Remove overpainting from glazing. - Replace 1 no. broken pane with new glazing to match existing. - Remove applied film from upper RH pane where failing. - Provisional Item: Subject to confirmation of requirements, allow for the supply and installation of a new applied film to glazing in full for UV protection. Specification TBC. - Provisional item: Allow for replacing bottom rail to both leafs and scarfing in repair to side rails both sides back to sound timber (approx. 200mm), profile to match existing. - Overhaul existing ironmongery.

NOTE

1. This drawing is copyright.
2. All dimensions must be checked on site before proceeding.
3. Dimensions of new work are to be adjusted to suit the existing building where necessary. Do not assume that the existing structure or details are plumb, square or level.
4. The contractor must report any discrepancies to the architect before proceeding.

REVISIONS

A 10/23 G7.D01 OMITTED FROM THIS SCHEDULE

10 EUSTON PLACE
LEAMINGTON SPA
CV32 4LJ
T 01926 881311
F 01926 451766
E architects@mpuk.com

Rodney Melville + Partners

CHARTERED ARCHITECTS
HISTORIC BUILDING CONSULTANTS

www.rmpuk.com
Rodney Melville and Partners Limited

Project

Bruce Castle Museum
MEND Funded Project

Drawing

External Door Internal Repair Schedule

Scale	NA@A3	Job No	7440
Date	June 2023	Drwg No	250
Drawn	HB	Rev	A

Room Ref.	Door Ref.	Internal Image	Description	Proposed Works/Notes
G6 EAST WING GALLERY	G6.Do3		Existing Doors: Existing doors thought to be a later replacement. Double doors used as means of escape - TBC Single glazed timber framed painted double doors (2 x 5). Painted timber panelled head and architrave surround. Folding shutters and shutter boxes – face fixed conduit within RHS shutter box do not fully close back into reveals. Existing Ironmongery: - Locking mechanism (black finish). - Black bolt fixed top and bottom to leading leaf, chased into upper frame.	Internal Works: - Overhaul existing glazed doors, mechanisms and shutters, prepare and redecorate to match existing. - Remove face fixed conduit to RHS shutter box, make good redundant fixing positions and ensure shutters close satisfactorily. - Remove overpainting from glazing. - Provisional Item: Subject to confirmation of requirements, allow for the supply and installation of a new applied film to glazing in full for UV protection. Specification TBC. - Overhaul existing ironmongery. x

NOTE

1. This drawing is copyright.
2. All dimensions must be checked on site before proceeding.
3. Dimensions of new work are to be adjusted to suit the existing building where necessary. Do not assume that the existing structure or details are plumb, square or level.
4. The contractor must report any discrepancies to the architect before proceeding.

REVISIONS

A 10/23 G7.D01 OMITTED FROM THIS SCHEDULE

10 EUSTON PLACE
LEAMINGTON SPA
CV32 4LJ
T 01926 881311
F 01926 451766
E architects@mpuk.com

Rodney Melville + Partners

CHARTERED ARCHITECTS
HISTORIC BUILDING CONSULTANTS

www.rmpuk.com
Rodney Melville and Partners Limited

Project

Bruce Castle Museum
MEND Funded Project

Drawing

External Door Internal Repair Schedule

Scale	NA@A3	Job No	7440
Date	June 2023	Drwg No	250
Drawn	HB	Rev	A

Room Ref.	Door Ref.	Internal Image	Description	Proposed Works/Notes
G6 EAST WING GALLERY	G6.Do4		Existing Doors: Single glazed timber framed painted double doors (2 x 5). Painted timber panelled head and architrave surround. Folding shutters and shutter boxes – lower half restricted by radiator position therefore cannot be opened fully. Face fixed conduit within LHS. Existing Ironmongery: - Note: No locking mechanism installed. Doors not operational.	Internal Works: - Overhaul existing glazed doors, mechanisms and shutters, prepare and redecorate to match existing. - Remove face fixed conduit to LHS shutter box, make good redundant fixing positions and ensure shutters close satisfactorily. - Remove overpainting from glazing. - Rebed all glazing. - Provisional Item: Subject to confirmation of requirements, allow for the supply and installation of a new applied film to glazing in full for UV protection. Specification TBC. - Provisional Item: 2 no. modern glazing bars installed. Allow for replacing with new glazing bars profiled to match the existing elsewhere. - Provisional Item: Allow for replacing bottom rail and scarf in repairs to side rails back to sound timber (approx. 200mm), profile to match existing. - Supply and install new locking mechanism and flush bolts to match adjacent doors, to ensure doors are operational and can be secured closed.
G6 EAST WING GALLERY	G6.Do5		Existing Doors: Double doors not visible at time of inspection due to items stored in Room G6.	Internal Works: Include provision for the following items, TBC when access available: - <i>Overhaul existing glazed doors, mechanisms and shutters, prepare and redecorate to match existing.</i> - <i>Remove overpainting from glazing.</i> - <i>Subject to confirmation of requirements, allow for the supply and installation of a new applied film to glazing in full for UV protection. Specification TBC.</i> - <i>Overhaul existing ironmongery.</i>

NOTE

1. This drawing is copyright.
2. All dimensions must be checked on site before proceeding.
3. Dimensions of new work are to be adjusted to suit the existing building where necessary. Do not assume that the existing structure or details are plumb, square or level.
4. The contractor must report any discrepancies to the architect before proceeding.

REVISIONS

A 10/23 G7.D01 OMITTED FROM THIS SCHEDULE

10 EUSTON PLACE
LEAMINGTON SPA
CV32 4LJ
T 01926 881311
F 01926 451766
E architects@mpuk.com

Rodney Melville + Partners

CHARTERED ARCHITECTS
HISTORIC BUILDING CONSULTANTS

www.rmpuk.com
Rodney Melville and Partners Limited

Project

Bruce Castle Museum
MEND Funded Project

Drawing

External Door Internal Repair Schedule

Scale	NA@A3	Job No	7440
Date	June 2023	Drwg No	250
Drawn	HB	Rev	A

Room Ref.	Door Ref.	Internal Image	Description	Proposed Works/Notes
G7 EASTERN ENTRANCE HALL	G7.D01			REFER TO GROUND FLOOR DOOR SCHEDULE AND DRAWING NO: 7440-260 FOR WORKS TO THIS OPENING

NOTE

1. This drawing is copyright.
2. All dimensions must be checked on site before proceeding.
3. Dimensions of new work are to be adjusted to suit the existing building where necessary. Do not assume that the existing structure or details are plumb, square or level.
4. The contractor must report any discrepancies to the architect before proceeding.

REVISIONS

A 10/23 G7.D01 OMITTED FROM THIS SCHEDULE

10 EUSTON PLACE
LEAMINGTON SPA
CV32 4LJ
T 01926 881311
F 01926 451766
E architects@mpuk.com

Rodney Melville + Partners

CHARTERED ARCHITECTS
HISTORIC BUILDING CONSULTANTS

www.rmpuk.com
Rodney Melville and Partners Limited

Project

Bruce Castle Museum
MEND Funded Project

Drawing

External Door Internal Repair Schedule

Scale	NA@A3	Job No	7440
Date	June 2023	Drwg No	250
Drawn	HB	Rev	A