



## ASBESTOS DEMOLITION SURVEY



|                    |                                                              |
|--------------------|--------------------------------------------------------------|
| Client             | Haringey Council                                             |
| Site               | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date started       | 21 Jul 2014 to 31 Jul 2014                                   |
| Date completed     | 31 Jul 2014                                                  |
| Date report issued | 1 Sep 2014                                                   |
| Survey reference   | J050727                                                      |
| Lead surveyor      | John Chilvers                                                |
| Assistant surveyor | N/A                                                          |
| UPRN               | N/A                                                          |

Surveyor  
Signature

Authorised  
Signature

IB.D.3.0

## Contents

### INTRODUCTION

### EXECUTIVE SUMMARY & RISK REGISTER

Executive summary  
Asbestos Register  
Non accessible areas register

### ASBESTOS SURVEY OF CRANWOOD, 100 WOODSIDE AVENUE, MUSWELL HILL, LONDON

Site occurrence register detailing all elements of the building on a room by room basis  
Details of site inspection  
Assigned risk evaluations  
Recommendations

### DATA ANALYSIS SHEETS

Breakdown of risk analysis with actions and recommendations for each item  
Photograph of each item

### APPENDIX 1 - SURVEY TYPE AND METHOD

Details and scope of survey type undertaken  
Details of scoring algorithms and derivation of risk

#### LIMITATIONS

Limitations of the survey type undertaken

### APPENDIX 2 - BULK ANALYSIS CERTIFICATE

Results of bulk sample analysis

### APPENDIX 3 - PLANS

## INTRODUCTION

We, Tersus  
1st Floor Rainham House, Manor Way, Rainham, Essex  
RM13 8RH

Received instructions from Claire Barnes of:

Haringey Council  
Level 6  
River Park House  
High Road  
London

To undertake an asbestos demolition survey, (HSG264) and to compile a report on the location and condition of asbestos bearing materials at:

Cranwood  
100 Woodside Avenue  
Muswell Hill  
London  
N10 3JA

## EXECUTIVE SUMMARY

The scope of this Asbestos Demolition Survey (HSG264) has been defined as follows:

Demolition survey to entire site to include main care home and any outbuildings.

The purpose of this report is to enable compliance with CAR2012. The aim of this survey is to identify and describe all asbestos containing materials as far as reasonably practical within the scope of the asbestos demolition survey.

Information on the results of these inspections is detailed in this report, appendices and on annotated drawings. The report and asbestos register must be maintained as one document, as all sections record information on the surveyors opinions, findings and limitations. Plans of the premises have been drafted and annotated accordingly in the Appendix.

A summary of all identified or presumed asbestos can be found in the asbestos register later in this executive summary. Non accessible areas are noted on the no access register, any areas or items not accessed must be presumed to contain asbestos until such a time as full access and inspection can be undertaken.

### Survey / Building comments

All intrusive inspections were very limited as areas surveyed were occupied and had to be left in a good condition ready for immediate use following the survey, therefore only small inspection holes were able to be made to walls and ceilings. All bedrooms were occupied and fully furnished, consequently these could not be surveyed.

**EXECUTIVE SUMMARY - ASBESTOS REGISTER**

Below is a summary of all asbestos or presumed asbestos materials found during the demolition survey.

These asbestos materials have been listed by risk.

| Item Reference | Sample   | Building      | Floor         | Room        | Position        | Item desc         | Conclusion | Material Assessment                | Risk code        |                                                                                     |
|----------------|----------|---------------|---------------|-------------|-----------------|-------------------|------------|------------------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #110   | JC001191 | Main Building | Z-Sub Level 1 | Boiler Room | stairwell floor | insulation debris | Chrysotile | 10                                 | Risk code A      |  |
|                |          |               |               |             |                 |                   |            | High Material Risk                 |                  |                                                                                     |
| Comments       |          |               |               |             |                 | Next reinspection | Extent     | Recommended action                 | Action Timescale | Date action completed                                                               |
|                |          |               |               |             |                 | 07/2015           | 2m²        | Restrict access to area and remove |                  |                                                                                     |

| Item Reference | Sample   | Building      | Floor         | Room        | Position | Item desc         | Conclusion | Material Assessment                | Risk code        |                                                                                     |
|----------------|----------|---------------|---------------|-------------|----------|-------------------|------------|------------------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #111   | JC001192 | Main Building | Z-Sub Level 1 | Boiler Room | floor    | dust & debris     | Chrysotile | 10                                 | Risk code A      |  |
|                |          |               |               |             |          |                   |            | High Material Risk                 |                  |                                                                                     |
| Comments       |          |               |               |             |          | Next reinspection | Extent     | Recommended action                 | Action Timescale | Date action completed                                                               |
|                |          |               |               |             |          | 07/2015           | 3m²        | Restrict access to area and remove |                  |                                                                                     |

| Item Reference | Sample   | Building      | Floor         | Room        | Position | Item desc         | Conclusion | Material Assessment                | Risk code        |                                                                                     |
|----------------|----------|---------------|---------------|-------------|----------|-------------------|------------|------------------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #112   | JC001193 | Main Building | Z-Sub Level 1 | Boiler Room | floor    | dust & debris     | Chrysotile | 10                                 | Risk code A      |  |
|                |          |               |               |             |          |                   |            | High Material Risk                 |                  |                                                                                     |
| Comments       |          |               |               |             |          | Next reinspection | Extent     | Recommended action                 | Action Timescale | Date action completed                                                               |
|                |          |               |               |             |          | 07/2015           | 3m²        | Restrict access to area and remove |                  |                                                                                     |

| Item Reference | Sample   | Building      | Floor         | Room        | Position | Item desc         | Conclusion | Material Assessment                | Risk code        |                                                                                       |
|----------------|----------|---------------|---------------|-------------|----------|-------------------|------------|------------------------------------|------------------|---------------------------------------------------------------------------------------|
| J050727 #113   | JC001194 | Main Building | Z-Sub Level 1 | Boiler Room | floor    | dust & debris     | Chrysotile | 10                                 | Risk code A      |  |
|                |          |               |               |             |          |                   |            | High Material Risk                 |                  |                                                                                       |
| Comments       |          |               |               |             |          | Next reinspection | Extent     | Recommended action                 | Action Timescale | Date action completed                                                                 |
|                |          |               |               |             |          | 07/2015           | 3m²        | Restrict access to area and remove |                  |                                                                                       |

| Item Reference | Sample   | Building      | Floor        | Room       | Position            | Item desc         | Conclusion | Material Assessment    | Risk code        |  |
|----------------|----------|---------------|--------------|------------|---------------------|-------------------|------------|------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #6     | JC001141 | Main Building | Ground Floor | Corridor A | floor (below vinyl) | bitumen screed    | Chrysotile | 2                      | Risk code B      |                                                                                     |
|                |          |               |              |            |                     |                   |            | Very Low Material Risk |                  |                                                                                     |
| Comments       |          |               |              |            |                     | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                               |
|                |          |               |              |            |                     | 07/2015           | 11m²       | Remove                 |                  |                                                                                     |

| Item Reference | Sample   | Building      | Floor        | Room       | Position   | Item desc         | Conclusion           | Material Assessment | Risk code        |  |
|----------------|----------|---------------|--------------|------------|------------|-------------------|----------------------|---------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #4     | JC001140 | Main Building | Ground Floor | Cupboard 1 | above door | insulation panel  | Chrysotile + Amosite | 6                   | Risk code B      |                                                                                     |
|                |          |               |              |            |            |                   |                      | Low Material Risk   |                  |                                                                                     |
| Comments       |          |               |              |            |            | Next reinspection | Extent               | Recommended action  | Action Timescale | Date action completed                                                               |
|                |          |               |              |            |            | 07/2015           | 1no.                 | Remove              |                  |                                                                                     |


| Item Reference | Sample   | Building      | Floor    | Room           | Position                      | Item desc         | Conclusion           | Material Assessment  | Risk code        |  |
|----------------|----------|---------------|----------|----------------|-------------------------------|-------------------|----------------------|----------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #128   | JC001203 | Main Building | External | External Areas | fire exit ceiling and upstand | insulation panels | Chrysotile + Amosite | 7                    | Risk code D      |                                                                                     |
|                |          |               |          |                |                               |                   |                      | Medium Material Risk |                  |                                                                                     |
| Comments       |          |               |          |                |                               | Next reinspection | Extent               | Recommended action   | Action Timescale | Date action completed                                                               |
|                |          |               |          |                |                               | 07/2015           | 2m²                  | Remove               |                  |                                                                                     |

| Item Reference | Sample   | Building      | Floor        | Room   | Position         | Item desc         | Conclusion | Material Assessment | Risk code        |  |
|----------------|----------|---------------|--------------|--------|------------------|-------------------|------------|---------------------|------------------|--------------------------------------------------------------------------------------|
| J050727 #11    | JC001145 | Main Building | Ground Floor | Office | panel above door | insulation panel  | Amosite    | 5                   | Risk code D      |                                                                                      |
|                |          |               |              |        |                  |                   |            | Low Material Risk   |                  |                                                                                      |
| Comments       |          |               |              |        |                  | Next reinspection | Extent     | Recommended action  | Action Timescale | Date action completed                                                                |
|                |          |               |              |        |                  | 07/2015           | 1no.       | Remove              |                  |                                                                                      |

| Item Reference | Sample   | Building      | Floor     | Room                 | Position   | Item desc         | Conclusion           | Material Assessment | Risk code        |                                                                                     |
|----------------|----------|---------------|-----------|----------------------|------------|-------------------|----------------------|---------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #67    | JC001167 | Main Building | 1st Floor | Stairwell 2 Cupboard | above door | insulation panel  | Chrysotile + Amosite | 5                   | Risk code D      |  |
|                |          |               |           |                      |            |                   |                      | Low Material Risk   |                  |                                                                                     |
| Comments       |          |               |           |                      |            | Next reinspection | Extent               | Recommended action  | Action Timescale | Date action completed                                                               |
|                |          |               |           |                      |            | 07/2015           | 1no.                 | Remove              |                  |                                                                                     |


| Item Reference | Sample   | Building      | Floor    | Room           | Position     | Item desc         | Conclusion | Material Assessment    | Risk code        |                                                                                     |
|----------------|----------|---------------|----------|----------------|--------------|-------------------|------------|------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #123   | JC001201 | Main Building | External | External Areas | below window | damp proof course | Chrysotile | 2                      | Risk code E      |  |
|                |          |               |          |                |              |                   |            | Very Low Material Risk |                  |                                                                                     |
| Comments       |          |               |          |                |              | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                               |
|                |          |               |          |                |              | 07/2015           | 1lm        | Remove                 |                  |                                                                                     |

| Item Reference | Sample   | Building      | Floor         | Room    | Position | Item desc         | Conclusion | Material Assessment    | Risk code        |                                                                                     |
|----------------|----------|---------------|---------------|---------|----------|-------------------|------------|------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #61    | JC001162 | Main Building | Z-Sub Level 1 | Laundry | ceiling  | textured coating  | Chrysotile | 3                      | Risk code E      |  |
|                |          |               |               |         |          |                   |            | Very Low Material Risk |                  |                                                                                     |
| Comments       |          |               |               |         |          | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                               |
|                |          |               |               |         |          | 07/2015           | 30m²       | Remove                 |                  |                                                                                     |

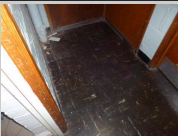
| Item Reference                            | Sample   | Building      | Floor         | Room    | Position | Item desc         | Conclusion | Material Assessment    | Risk code        |                                                                                      |
|-------------------------------------------|----------|---------------|---------------|---------|----------|-------------------|------------|------------------------|------------------|--------------------------------------------------------------------------------------|
| J050727 #64                               | JC001165 | Main Building | Z-Sub Level 1 | Lobby 1 | floor    | floor tiles       | Chrysotile | 2                      | Risk code E      |  |
|                                           |          |               |               |         |          |                   |            | Very Low Material Risk |                  |                                                                                      |
| Comments                                  |          |               |               |         |          | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                                |
| Chrysotile found in adhesive & floor tile |          |               |               |         |          | 07/2015           | 2m²        | Remove                 |                  |                                                                                      |


| Item Reference                            | Sample   | Building      | Floor        | Room        | Position            | Item desc         | Conclusion | Material Assessment    | Risk code        |                                                                                     |
|-------------------------------------------|----------|---------------|--------------|-------------|---------------------|-------------------|------------|------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727<br>#7                             | JC001142 | Main Building | Ground Floor | Drying Room | floor (below vinyl) | floor tiles       | Chrysotile | 2                      | Risk code E      |  |
|                                           |          |               |              |             |                     |                   |            | Very Low Material Risk |                  |                                                                                     |
| Comments                                  |          |               |              |             |                     | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                               |
| Chrysotile found in adhesive & floor tile |          |               |              |             |                     | 07/2015           | 4m²        | Remove                 |                  |                                                                                     |

| Item Reference | Sample   | Building      | Floor        | Room           | Position            | Item desc         | Conclusion | Material Assessment    | Risk code        |                                                                                     |
|----------------|----------|---------------|--------------|----------------|---------------------|-------------------|------------|------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727<br>#9  | JC001144 | Main Building | Ground Floor | Female Toilets | floor (below vinyl) | floor tiles       | Chrysotile | 2                      | Risk code E      |  |
|                |          |               |              |                |                     |                   |            | Very Low Material Risk |                  |                                                                                     |
| Comments       |          |               |              |                |                     | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                               |
|                |          |               |              |                |                     | 07/2015           | 5m²        | Remove                 |                  |                                                                                     |
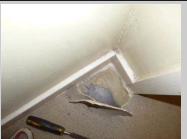
| Item Reference                            | Sample   | Building      | Floor        | Room         | Position            | Item desc         | Conclusion | Material Assessment    | Risk code        |                                                                                     |
|-------------------------------------------|----------|---------------|--------------|--------------|---------------------|-------------------|------------|------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727<br>#8                             | JC001143 | Main Building | Ground Floor | Male Toilets | floor (below vinyl) | floor tiles       | Chrysotile | 2                      | Risk code E      |  |
|                                           |          |               |              |              |                     |                   |            | Very Low Material Risk |                  |                                                                                     |
| Comments                                  |          |               |              |              |                     | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                               |
| Chrysotile found in adhesive & floor tile |          |               |              |              |                     | 07/2015           | 5m²        | Remove                 |                  |                                                                                     |

| Item Reference                            | Sample   | Building      | Floor        | Room                                    | Position | Item desc         | Conclusion | Material Assessment    | Risk code        |                                                                                      |
|-------------------------------------------|----------|---------------|--------------|-----------------------------------------|----------|-------------------|------------|------------------------|------------------|--------------------------------------------------------------------------------------|
| J050727<br>#116                           | JC001197 | Main Building | Ground Floor | Stairwell 1<br>(ground to lower ground) | floor    | floor tiles       | Chrysotile | 2                      | Risk code E      |  |
|                                           |          |               |              |                                         |          |                   |            | Very Low Material Risk |                  |                                                                                      |
| Comments                                  |          |               |              |                                         |          | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                                |
| Chrysotile found in adhesive & floor tile |          |               |              |                                         |          | 07/2015           | 8m²        | Remove                 |                  |                                                                                      |
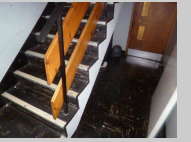
| Item Reference                            | Sample   | Building      | Floor     | Room                                | Position | Item desc         | Conclusion | Material Assessment    | Risk code        |  |
|-------------------------------------------|----------|---------------|-----------|-------------------------------------|----------|-------------------|------------|------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #65                               | JC001166 | Main Building | 1st Floor | Stairwell 2 & Lobby (1st to ground) | floor    | floor tiles       | Chrysotile | 2                      | Risk code E      |                                                                                     |
|                                           |          |               |           |                                     |          |                   |            | Very Low Material Risk |                  |                                                                                     |
| Comments                                  |          |               |           |                                     |          | Next reinspection | Extent     | Recommended action     | Action Timescale | Date action completed                                                               |
| Chrysotile found in adhesive & floor tile |          |               |           |                                     |          | 07/2015           | 10m²       | Remove                 |                  |                                                                                     |
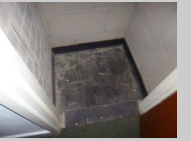
| Item Reference                            | Sample             | Building      | Floor     | Room                 | Position | Item desc         | Conclusion  | Material Assessment    | Risk code        |  |
|-------------------------------------------|--------------------|---------------|-----------|----------------------|----------|-------------------|-------------|------------------------|------------------|-------------------------------------------------------------------------------------|
| J050727 #66                               | As Sample JC001166 | Main Building | 1st Floor | Stairwell 2 Cupboard | floor    | floor tiles       | Chrysotile* | 2                      | Risk code E      |                                                                                     |
|                                           |                    |               |           |                      |          |                   |             | Very Low Material Risk |                  |                                                                                     |
| Comments                                  |                    |               |           |                      |          | Next reinspection | Extent      | Recommended action     | Action Timescale | Date action completed                                                               |
| Chrysotile found in adhesive & floor tile |                    |               |           |                      |          | 07/2015           | 1m²         | Remove                 |                  |                                                                                     |

**NON-ACCESSIBLE AREAS REGISTER**

All non accessed or limited access areas have been listed. These areas or items must be presumed to contain asbestos until such a time as full access and inspection can be undertaken.

| Item Reference  | Building      | Floor level   | Room                           | Position | Item         | Access level |
|-----------------|---------------|---------------|--------------------------------|----------|--------------|--------------|
| J050727<br>#124 | Main Building | External      | Garages                        |          | Inaccessible | No Access    |
| J050727<br>#98  | Main Building | External      | Lift Motor Room                | motor    | brake shoes  | No Access    |
| J050727<br>#101 | Main Building | External      | Stairwell 2 External Tank Room |          | Inaccessible | No Access    |
| J050727<br>#55  | Main Building | Z-Sub Level 1 | Electrical Cupboard            |          | Inaccessible | No Access    |
| J050727<br>#50  | Main Building | Z-Sub Level 1 | Room 500                       |          | Inaccessible | No Access    |
| J050727<br>#49  | Main Building | Z-Sub Level 1 | Room 501                       |          | Inaccessible | No Access    |
| J050727<br>#48  | Main Building | Z-Sub Level 1 | Room 502                       |          | Inaccessible | No Access    |
| J050727<br>#47  | Main Building | Z-Sub Level 1 | Room 503                       |          | Inaccessible | No Access    |
| J050727<br>#46  | Main Building | Z-Sub Level 1 | Room 504                       |          | Inaccessible | No Access    |
| J050727<br>#45  | Main Building | Z-Sub Level 1 | Room 505                       |          | Inaccessible | No Access    |
| J050727<br>#44  | Main Building | Z-Sub Level 1 | Room 506                       |          | Inaccessible | No Access    |
| J050727<br>#43  | Main Building | Z-Sub Level 1 | Room 507                       |          | Inaccessible | No Access    |
| J050727<br>#42  | Main Building | Z-Sub Level 1 | Room 508                       |          | Inaccessible | No Access    |
| J050727<br>#58  | Main Building | Z-Sub Level 1 | Room 509                       |          | Inaccessible | No Access    |
| J050727<br>#59  | Main Building | Z-Sub Level 1 | Room 510                       |          | Inaccessible | No Access    |
| J050727<br>#54  | Main Building | Z-Sub Level 1 | Toilet 3                       |          | Inaccessible | No Access    |
| J050727<br>#118 | Main Building | Z-Sub Level 1 | Understairs Cupboard           |          | Inaccessible | No Access    |
| J050727<br>#16  | Main Building | Ground Floor  | Cupboard 2                     |          | Inaccessible | No Access    |
| J050727<br>#21  | Main Building | Ground Floor  | Lift                           |          | Inaccessible | No Access    |
| J050727<br>#35  | Main Building | Ground Floor  | Room 13                        |          | Inaccessible | No Access    |
| J050727<br>#34  | Main Building | Ground Floor  | Room 14                        |          | Inaccessible | No Access    |
| J050727<br>#33  | Main Building | Ground Floor  | Room 15                        |          | Inaccessible | No Access    |
| J050727<br>#32  | Main Building | Ground Floor  | Room 16                        |          | Inaccessible | No Access    |

|                |               |              |          |  |              |           |
|----------------|---------------|--------------|----------|--|--------------|-----------|
| J050727<br>#30 | Main Building | Ground Floor | Room 17  |  | Inaccessible | No Access |
| J050727<br>#29 | Main Building | Ground Floor | Room 18  |  | Inaccessible | No Access |
| J050727<br>#17 | Main Building | Ground Floor | Room 19  |  | Inaccessible | No Access |
| J050727<br>#28 | Main Building | Ground Floor | Room 19  |  | Inaccessible | No Access |
| J050727<br>#27 | Main Building | Ground Floor | Room 20  |  | Inaccessible | No Access |
| J050727<br>#26 | Main Building | Ground Floor | Room 21  |  | Inaccessible | No Access |
| J050727<br>#25 | Main Building | Ground Floor | Room 22  |  | Inaccessible | No Access |
| J050727<br>#24 | Main Building | Ground Floor | Room 23  |  | Inaccessible | No Access |
| J050727<br>#15 | Main Building | Ground Floor | Room 24  |  | Inaccessible | No Access |
| J050727<br>#12 | Main Building | Ground Floor | Room 24a |  | Inaccessible | No Access |
| J050727<br>#10 | Main Building | Ground Floor | Room 24c |  | Inaccessible | No Access |
| J050727<br>#5  | Main Building | Ground Floor | Room 24d |  | Inaccessible | No Access |
| J050727<br>#3  | Main Building | Ground Floor | Room 24e |  | Inaccessible | No Access |
| J050727<br>#91 | Main Building | 1st Floor    | Room 1   |  | Inaccessible | No Access |
| J050727<br>#79 | Main Building | 1st Floor    | Room 10  |  | Inaccessible | No Access |
| J050727<br>#80 | Main Building | 1st Floor    | Room 11  |  | Inaccessible | No Access |
| J050727<br>#81 | Main Building | 1st Floor    | Room 12  |  | Inaccessible | No Access |
| J050727<br>#70 | Main Building | 1st Floor    | Room 12a |  | Inaccessible | No Access |
| J050727<br>#92 | Main Building | 1st Floor    | Room 2   |  | Inaccessible | No Access |
| J050727<br>#93 | Main Building | 1st Floor    | Room 3   |  | Inaccessible | No Access |
| J050727<br>#94 | Main Building | 1st Floor    | Room 4   |  | Inaccessible | No Access |
| J050727<br>#74 | Main Building | 1st Floor    | Room 5   |  | Inaccessible | No Access |
| J050727<br>#71 | Main Building | 1st Floor    | Room 6   |  | Inaccessible | No Access |
| J050727<br>#75 | Main Building | 1st Floor    | Room 7   |  | Inaccessible | No Access |
| J050727<br>#76 | Main Building | 1st Floor    | Room 8   |  | Inaccessible | No Access |
| J050727<br>#78 | Main Building | 1st Floor    | Room 9   |  | Inaccessible | No Access |

|                                                                                  |                                                                                                                                                                                                |            |                                                                                                                                                                                                                                                                                                                                                 |             |                                                                                                                          |
|----------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------|--------------------------------------------------------------------------------------------------------------------------|
| Date of survey                                                                   | 21 Jul 2014 to 31 Jul 2014                                                                                                                                                                     | Survey ref | J050727                                                                                                                                                                                                                                                                                                                                         | Survey type | Demolition survey (MA only) + Management Plan                                                                            |
| Location<br>Cranwood<br>100 Woodside Avenue<br>Muswell Hill<br>London<br>N10 3JA | Material Assessment<br>10+ High potential to release fibres<br>7 - 9 Medium potential to release fibres<br>5 - 6 Low potential to release fibres<br>2 - 4 Very low potential to release fibres |            | Material Key<br>Asbestos thermal insulations<br>Asbestos board<br>Asbestos cement materials<br>Asbestos textured coatings<br>Asbestos flooring materials<br>Asbestos paper<br>Asbestos gaskets, ropes, textiles<br>Asbestos lagging<br>Asbestos Bitumen and well bound materials<br>Asbestos reinforced composites or Asbestos friction product |             | THIS REGISTER SHOULD BE READ IN CONJUNCTION WITH THE ENTIRE REPORT THAT DETAILS THE SCOPE AND LIMITATIONS OF THE SURVEY. |

| BUILDING       |            |                               | Main Building     |                           |                    |                       |                                            |                      |                   |          |       |             |
|----------------|------------|-------------------------------|-------------------|---------------------------|--------------------|-----------------------|--------------------------------------------|----------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |                               | External          |                           |                    |                       |                                            |                      |                   |          |       |             |
| ROOM           |            |                               | External Areas    |                           | ROOM DESCRIPTION   |                       | WALLS: brick FLOOR: concrete metal windows |                      |                   |          |       |             |
| Item Reference | Sample Ref | Position                      | Item Description  | Product Type              | Condition / Damage | Surface Treatment     | Extent                                     | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |                               |                   |                           |                    |                       |                                            |                      | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #123   | JC001201   | below window                  | damp proof course | Bitumen Products          | (0) Good Condition | (0) Completely Sealed | 1lm                                        | Chrysotile           | 2                 | N/A      | N/A   | Risk code E |
| Comments       |            |                               |                   |                           |                    |                       | Recommended action                         |                      | Remove            |          |       |             |
|                |            |                               |                   |                           |                    |                       |                                            |                      |                   |          |       |             |
| J050727 #128   | JC001203   | fire exit ceiling and upstand | insulation panels | Asbestos Insulating Board | (1) Low Damage     | (2) Unsealed          | 2m²                                        | Chrysotile + Amosite | 7                 | N/A      | N/A   | Risk code D |
| Comments       |            |                               |                   |                           |                    |                       | Recommended action                         |                      | Remove            |          |       |             |
|                |            |                               |                   |                           |                    |                       |                                            |                      |                   |          |       |             |

|                |            |          |                  |              |                    |                   |                                  |                      |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|----------------------------------|----------------------|-------------------|----------|-------|-----------|
| BUILDING       |            |          | Main Building    |              |                    |                   |                                  |                      |                   |          |       |           |
| FLOOR LEVEL    |            |          | External         |              |                    |                   |                                  |                      |                   |          |       |           |
| ROOM           |            |          | External Roof    |              | ROOM DESCRIPTION   |                   | WALLS: brick FLOOR: bitumen felt |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                           | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                                  |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #100   | JC001182   |          | bitumen felt     |              |                    |                   |                                  | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action               |                      |                   |          |       |           |

| BUILDING        |            |          | Main Building    |              |                    |                   |        |                                          |                   |          |       |             |
|-----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL     |            |          | External         |              |                    |                   |        |                                          |                   |          |       |             |
| ROOM            |            |          | Garages          |              | ROOM DESCRIPTION   |                   |        |                                          |                   |          |       |             |
| Item Reference  | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                 |            |          |                  |              |                    |                   |        |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#124 |            |          | Inaccessible     |              |                    |                   |        | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |

|          |                    |  |
|----------|--------------------|--|
| Comments | Recommended action |  |
| no keys  |                    |  |

| BUILDING       |                    |                         | Main Building    |              |                    |                   |                                                |                                |                   |          |       |             |
|----------------|--------------------|-------------------------|------------------|--------------|--------------------|-------------------|------------------------------------------------|--------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |                    |                         | External         |              |                    |                   |                                                |                                |                   |          |       |             |
| ROOM           |                    |                         | Lift Motor Room  |              | ROOM DESCRIPTION   |                   | WALLS: brick CEILING: concrete FLOOR: concrete |                                |                   |          |       |             |
| Item Reference | Sample Ref         | Position                | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                         | Conclusion                     | ASSESSMENT SCORES |          |       | Risk Code   |
|                |                    |                         |                  |              |                    |                   |                                                |                                | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #98    |                    | motor                   | brake shoes      |              |                    |                   | 2no.                                           | Inaccessable, Presume asbestos |                   | N/A      | N/A   | Risk code F |
| Comments       |                    |                         |                  |              |                    |                   | Recommended action                             |                                |                   |          |       |             |
|                |                    |                         |                  |              |                    |                   |                                                |                                |                   |          |       |             |
| J050727 #99    | As Sample JC001181 | around doors (external) | putty            |              |                    |                   |                                                | No Asbestos Detected           |                   | N/A      | N/A   |             |
| Comments       |                    |                         |                  |              |                    |                   | Recommended action                             |                                |                   |          |       |             |

| BUILDING        |            |          | Main Building                  |              |                    |                   |                    |                                          |                   |          |       |           |
|-----------------|------------|----------|--------------------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL     |            |          | External                       |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM            |            |          | Stairwell 2 External Tank Room |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference  | Sample Ref | Position | Item Description               | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                 |            |          |                                |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#101 |            |          | Inaccessible                   |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments        |            |          |                                |              |                    |                   | Recommended action |                                          |                   |          |       |           |
|                 |            |          |                                |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |                    |          | Main Building    |              |                    |                   |                    |                                                              |                   |          |       |           |
|----------------|--------------------|----------|------------------|--------------|--------------------|-------------------|--------------------|--------------------------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |                    |          | External         |              |                    |                   |                    |                                                              |                   |          |       |           |
| ROOM           |                    |          | Store 1          |              |                    | ROOM DESCRIPTION  |                    | WALLS: brick CEILING: strumitt board FLOOR: timber, concrete |                   |          |       |           |
| Item Reference | Sample Ref         | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                                                   | ASSESSMENT SCORES |          |       | Risk Code |
|                |                    |          |                  |              |                    |                   |                    |                                                              | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #125   | As Sample JC001180 | ceiling  | strumitt board   |              |                    |                   |                    | No Asbestos Detected                                         |                   | N/A      | N/A   |           |
| Comments       |                    |          |                  |              |                    |                   | Recommended action |                                                              |                   |          |       |           |

| BUILDING       |                    |          | Main Building    |              |                    |                   |        |                                                              |                   |          |       |           |
|----------------|--------------------|----------|------------------|--------------|--------------------|-------------------|--------|--------------------------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |                    |          | External         |              |                    |                   |        |                                                              |                   |          |       |           |
| ROOM           |                    |          | Store 2          |              |                    | ROOM DESCRIPTION  |        | WALLS: brick CEILING: strumitt board FLOOR: timber, concrete |                   |          |       |           |
| Item Reference | Sample Ref         | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion                                                   | ASSESSMENT SCORES |          |       | Risk Code |
|                |                    |          |                  |              |                    |                   |        |                                                              | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #126   | As Sample JC001180 | ceiling  | strumitt board   |              |                    |                   |        | No Asbestos Detected                                         |                   | N/A      | N/A   |           |

|              |          |              |       |  |  |  |                    |                      |  |     |     |  |
|--------------|----------|--------------|-------|--|--|--|--------------------|----------------------|--|-----|-----|--|
| Comments     |          |              |       |  |  |  | Recommended action |                      |  |     |     |  |
| J050727 #127 | JC001202 | around doors | putty |  |  |  |                    | No Asbestos Detected |  | N/A | N/A |  |
| Comments     |          |              |       |  |  |  | Recommended action |                      |  |     |     |  |

| BUILDING       |            |                         | Main Building    |              |                    |                   |                    |                                                                                               |                   |          |       |           |
|----------------|------------|-------------------------|------------------|--------------|--------------------|-------------------|--------------------|-----------------------------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                         | External         |              |                    |                   |                    |                                                                                               |                   |          |       |           |
| ROOM           |            |                         | Tank Room        |              |                    | ROOM DESCRIPTION  |                    | WALLS: brick CEILING: strumitt board FLOOR: concrete mmmf to pipes, metal and fibreglass tank |                   |          |       |           |
| Item Reference | Sample Ref | Position                | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                                                                                    | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                         |                  |              |                    |                   |                    |                                                                                               | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #95    | JC001179   | brick piers             | bitumen felt     |              |                    |                   |                    | No Asbestos Detected                                                                          |                   | N/A      | N/A   |           |
| Comments       |            |                         |                  |              |                    |                   | Recommended action |                                                                                               |                   |          |       |           |
| J050727 #96    | JC001180   | ceiling                 | strumitt board   |              |                    |                   |                    | No Asbestos Detected                                                                          |                   | N/A      | N/A   |           |
| Comments       |            |                         |                  |              |                    |                   | Recommended action |                                                                                               |                   |          |       |           |
| J050727 #97    | JC001181   | around doors (external) | putty            |              |                    |                   |                    | No Asbestos Detected                                                                          |                   | N/A      | N/A   |           |
| Comments       |            |                         |                  |              |                    |                   | Recommended action |                                                                                               |                   |          |       |           |

|             |  |  |               |  |  |                  |                    |                                                                                                                            |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|----------------------------------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                                            |  |     |     |  |
| FLOOR LEVEL |  |  | Z-Sub Level 1 |  |  |                  |                    |                                                                                                                            |  |     |     |  |
| ROOM        |  |  | Bathroom      |  |  | ROOM DESCRIPTION |                    | WALLS: ceramic, solid rendered, timber<br>CEILING: plasterboard, concrete<br>FLOOR: vinyl, concrete no access within riser |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                                                     |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                                            |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                                            |  |     |     |  |

| BUILDING       |            |              | Main Building              |              |                    |                   |                    |                                                                                                                   |                   |          |       |           |
|----------------|------------|--------------|----------------------------|--------------|--------------------|-------------------|--------------------|-------------------------------------------------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |              | Z-Sub Level 1              |              |                    |                   |                    |                                                                                                                   |                   |          |       |           |
| ROOM           |            |              | Boiler Room                |              |                    | ROOM DESCRIPTION  |                    | WALLS: brick, concrete CEILING: concrete FLOOR: concrete mmmf to pipes, limited access, no access within boilers. |                   |          |       |           |
| Item Reference | Sample Ref | Position     | Item Description           | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                                                                                                        | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |              |                            |              |                    |                   |                    |                                                                                                                   | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #102   | JC001183   | wall         | insulation residue (pink)  |              |                    |                   |                    | No Asbestos Detected                                                                                              |                   | N/A      | N/A   |           |
| Comments       |            |              |                            |              |                    |                   | Recommended action |                                                                                                                   |                   |          |       |           |
| J050727 #103   | JC001184   | wall         | insulation residue (pink)  |              |                    |                   |                    | No Asbestos Detected                                                                                              |                   | N/A      | N/A   |           |
| Comments       |            |              |                            |              |                    |                   | Recommended action |                                                                                                                   |                   |          |       |           |
| J050727 #104   | JC001185   | wall         | insulation residue (white) |              |                    |                   |                    | No Asbestos Detected                                                                                              |                   | N/A      | N/A   |           |
| Comments       |            |              |                            |              |                    |                   | Recommended action |                                                                                                                   |                   |          |       |           |
| J050727        | JC001186   | wall (behind | insulation residue         |              |                    |                   |                    | No Asbestos                                                                                                       |                   | N/A      | N/A   |           |

| J050727      |          | Asbestos Survey Of Cranwood, 100 Woodside Avenue, Muswell Hill, London |                            |             |                 |  |                    |                      |                                    |     |     | Page 14 of 120 |             |
|--------------|----------|------------------------------------------------------------------------|----------------------------|-------------|-----------------|--|--------------------|----------------------|------------------------------------|-----|-----|----------------|-------------|
| #105         |          | pipe)                                                                  | (white)                    |             |                 |  |                    | Detected             |                                    |     |     |                |             |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      |                                    |     |     |                |             |
| J050727 #106 | JC001187 | wall                                                                   | insulation residue (white) |             |                 |  |                    | No Asbestos Detected |                                    | N/A | N/A |                |             |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      |                                    |     |     |                |             |
| J050727 #107 | JC001188 | wall (understairs)                                                     | insulation residue (white) |             |                 |  |                    | No Asbestos Detected |                                    | N/A | N/A |                |             |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      |                                    |     |     |                |             |
| J050727 #108 | JC001189 | flanges                                                                | gaskets                    |             |                 |  |                    | No Asbestos Detected |                                    | N/A | N/A |                |             |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      |                                    |     |     |                |             |
| J050727 #109 | JC001190 | stairwell floor                                                        | insulation debris          |             |                 |  |                    | No Asbestos Detected |                                    | N/A | N/A |                |             |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      |                                    |     |     |                |             |
| J050727 #110 | JC001191 | stairwell floor                                                        | insulation debris          | Dust/Debris | (3) High Damage |  | 2m²                | Chrysotile           | 10                                 | N/A | N/A |                | Risk code A |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      | Restrict access to area and remove |     |     |                |             |
| J050727 #111 | JC001192 | floor                                                                  | dust & debris              | Dust/Debris | (3) High Damage |  | 3m²                | Chrysotile           | 10                                 | N/A | N/A |                | Risk code A |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      | Restrict access to area and remove |     |     |                |             |
| J050727 #112 | JC001193 | floor                                                                  | dust & debris              | Dust/Debris | (3) High Damage |  | 3m²                | Chrysotile           | 10                                 | N/A | N/A |                | Risk code A |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      | Restrict access to area and remove |     |     |                |             |
| J050727 #113 | JC001194 | floor                                                                  | dust & debris              | Dust/Debris | (3) High Damage |  | 3m²                | Chrysotile           | 10                                 | N/A | N/A |                | Risk code A |
| Comments     |          |                                                                        |                            |             |                 |  | Recommended action |                      | Restrict access to area and remove |     |     |                |             |

|             |  |               |  |  |  |                  |                    |                                                                                                     |  |     |     |  |  |
|-------------|--|---------------|--|--|--|------------------|--------------------|-----------------------------------------------------------------------------------------------------|--|-----|-----|--|--|
| BUILDING    |  | Main Building |  |  |  |                  |                    |                                                                                                     |  |     |     |  |  |
| FLOOR LEVEL |  | Z-Sub Level 1 |  |  |  |                  |                    |                                                                                                     |  |     |     |  |  |
| ROOM        |  | Corridor A    |  |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered CEILING: concrete, timber FLOOR: vinyl, concrete timber boxing, mmmf to pipes |  |     |     |  |  |
|             |  |               |  |  |  |                  |                    | No Asbestos Identified                                                                              |  | N/A | N/A |  |  |
| Comments    |  |               |  |  |  |                  | Recommended action |                                                                                                     |  |     |     |  |  |

|             |  |               |  |  |  |                  |  |                                                                                                     |  |     |     |  |  |
|-------------|--|---------------|--|--|--|------------------|--|-----------------------------------------------------------------------------------------------------|--|-----|-----|--|--|
| BUILDING    |  | Main Building |  |  |  |                  |  |                                                                                                     |  |     |     |  |  |
| FLOOR LEVEL |  | Z-Sub Level 1 |  |  |  |                  |  |                                                                                                     |  |     |     |  |  |
| ROOM        |  | Corridor B    |  |  |  | ROOM DESCRIPTION |  | WALLS: solid rendered CEILING: concrete, timber FLOOR: vinyl, concrete timber boxing, mmmf to pipes |  |     |     |  |  |
|             |  |               |  |  |  |                  |  | No Asbestos Identified                                                                              |  | N/A | N/A |  |  |

|          |                    |
|----------|--------------------|
| Comments | Recommended action |
|          |                    |

|             |  |  |               |  |  |                  |                    |                                                                                                                            |                        |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|----------------------------------------------------------------------------------------------------------------------------|------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                                            |                        |  |     |     |  |
| FLOOR LEVEL |  |  | Z-Sub Level 1 |  |  |                  |                    |                                                                                                                            |                        |  |     |     |  |
| ROOM        |  |  | Corridor C    |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered<br>CEILING: suspended tiles, concrete, timber<br>FLOOR: vinyl, concrete timber boxing, mmmf to pipes |                        |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                                            | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                                            |                        |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                                            |                        |  |     |     |  |

| BUILDING       |            |                                  | Main Building    |              |                    |                   |                                                                                                                        |                      |                   |          |       |           |
|----------------|------------|----------------------------------|------------------|--------------|--------------------|-------------------|------------------------------------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                                  | Z-Sub Level 1    |              |                    |                   |                                                                                                                        |                      |                   |          |       |           |
| ROOM           |            |                                  | Corridor D       |              | ROOM DESCRIPTION   |                   | WALLS: solid rendered CEILING: concrete, suspended tiles FLOOR: vinyl, concrete, carpet. mmmf to pipes, plastic boxing |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position                         | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                                                                                 | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                                  |                  |              |                    |                   |                                                                                                                        |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #56    | JC001159   | above door (electrical cupboard) | insulation panel |              |                    |                   |                                                                                                                        | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                                  |                  |              |                    |                   | Recommended action                                                                                                     |                      |                   |          |       |           |

| BUILDING       |            |                         | Main Building    |              |                    |                   |                                                                      |                      |                   |          |       |           |
|----------------|------------|-------------------------|------------------|--------------|--------------------|-------------------|----------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                         | Z-Sub Level 1    |              |                    |                   |                                                                      |                      |                   |          |       |           |
| ROOM           |            |                         | Cupboard 1       |              | ROOM DESCRIPTION   |                   | WALLS: block CEILING: concrete FLOOR: vinyl, concrete limited access |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position                | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                               | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                         |                  |              |                    |                   |                                                                      |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #36    | JC001154   | infill panel above door | insulation panel |              |                    |                   |                                                                      | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                         |                  |              |                    |                   | Recommended action                                                   |                      |                   |          |       |           |
| J050727 #39    | JC001157   | floor                   | vinyl covering   |              |                    |                   |                                                                      | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                         |                  |              |                    |                   | Recommended action                                                   |                      |                   |          |       |           |

| BUILDING       |                    |                         | Main Building    |              |                    |                   |                                                                                 |                      |                   |          |       |           |
|----------------|--------------------|-------------------------|------------------|--------------|--------------------|-------------------|---------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |                    |                         | Z-Sub Level 1    |              |                    |                   |                                                                                 |                      |                   |          |       |           |
| ROOM           |                    |                         | Cupboard 2       |              | ROOM DESCRIPTION   |                   | WALLS: plaster rendered CEILING: concrete FLOOR: vinyl, concrete limited access |                      |                   |          |       |           |
| Item Reference | Sample Ref         | Position                | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                                          | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |                    |                         |                  |              |                    |                   |                                                                                 |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #37    | JC001155           | infill panel above door | insulation panel |              |                    |                   |                                                                                 | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |                    |                         |                  |              |                    |                   | Recommended action                                                              |                      |                   |          |       |           |
| J050727 #40    | As Sample JC001157 | floor                   | vinyl covering   |              |                    |                   |                                                                                 | No Asbestos Detected |                   | N/A      | N/A   |           |

|          |                    |  |
|----------|--------------------|--|
| Comments | Recommended action |  |
|----------|--------------------|--|

| BUILDING       |                    |                         | Main Building    |              |                    |                   |                    |                                                                                 |                   |          |       |           |
|----------------|--------------------|-------------------------|------------------|--------------|--------------------|-------------------|--------------------|---------------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |                    |                         | Z-Sub Level 1    |              |                    |                   |                    |                                                                                 |                   |          |       |           |
| ROOM           |                    |                         | Cupboard 3       |              |                    | ROOM DESCRIPTION  |                    | WALLS: plaster rendered CEILING: concrete FLOOR: vinyl, concrete limited access |                   |          |       |           |
| Item Reference | Sample Ref         | Position                | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                                                                      | ASSESSMENT SCORES |          |       | Risk Code |
|                |                    |                         |                  |              |                    |                   |                    |                                                                                 | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #38    | JC001156           | infill panel above door | insulation panel |              |                    |                   |                    | No Asbestos Detected                                                            |                   | N/A      | N/A   |           |
| Comments       |                    |                         |                  |              |                    |                   | Recommended action |                                                                                 |                   |          |       |           |
| J050727 #41    | As Sample JC001157 | floor                   | vinyl covering   |              |                    |                   |                    | No Asbestos Detected                                                            |                   | N/A      | N/A   |           |
| Comments       |                    |                         |                  |              |                    |                   | Recommended action |                                                                                 |                   |          |       |           |

| BUILDING       |                    |                         | Main Building    |              |                    |                   |                    |                                                                                                |                   |          |       |           |
|----------------|--------------------|-------------------------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |                    |                         | Z-Sub Level 1    |              |                    |                   |                    |                                                                                                |                   |          |       |           |
| ROOM           |                    |                         | Cupboard 4       |              |                    | ROOM DESCRIPTION  |                    | WALLS: plaster rendered CEILING: concrete FLOOR: vinyl, concrete limited access, mmmf to pipes |                   |          |       |           |
| Item Reference | Sample Ref         | Position                | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                                                                                     | ASSESSMENT SCORES |          |       | Risk Code |
|                |                    |                         |                  |              |                    |                   |                    |                                                                                                | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #51    | As Sample JC001156 | infill panel above door | insulation panel |              |                    |                   |                    | No Asbestos Detected                                                                           |                   | N/A      | N/A   |           |
| Comments       |                    |                         |                  |              |                    |                   | Recommended action |                                                                                                |                   |          |       |           |
| J050727 #52    | As Sample JC001157 | floor                   | vinyl covering   |              |                    |                   |                    | No Asbestos Detected                                                                           |                   | N/A      | N/A   |           |
| Comments       |                    |                         |                  |              |                    |                   | Recommended action |                                                                                                |                   |          |       |           |

| BUILDING       |            |                         | Main Building    |              |                    |                   |                    |                                                                                                |                   |          |       |           |
|----------------|------------|-------------------------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                         | Z-Sub Level 1    |              |                    |                   |                    |                                                                                                |                   |          |       |           |
| ROOM           |            |                         | Cupboard 5       |              |                    | ROOM DESCRIPTION  |                    | WALLS: plaster rendered CEILING: concrete FLOOR: vinyl, concrete limited access, mmmf to pipes |                   |          |       |           |
| Item Reference | Sample Ref | Position                | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                                                                                     | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                         |                  |              |                    |                   |                    |                                                                                                | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #53    | JC001158   | infill panel above door | insulation panel |              |                    |                   |                    | No Asbestos Detected                                                                           |                   | N/A      | N/A   |           |
| Comments       |            |                         |                  |              |                    |                   | Recommended action |                                                                                                |                   |          |       |           |

| BUILDING       |            |          | Main Building       |              |                    |                   |        |                                          |                   |          |       |             |
|----------------|------------|----------|---------------------|--------------|--------------------|-------------------|--------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Z-Sub Level 1       |              |                    |                   |        |                                          |                   |          |       |             |
| ROOM           |            |          | Electrical Cupboard |              |                    | ROOM DESCRIPTION  |        |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description    | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                     |              |                    |                   |        |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #55    |            |          | Inaccessible        |              |                    |                   |        | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |

| Comments | Recommended action |
|----------|--------------------|
|          |                    |

| BUILDING       |            |           | Main Building    |              |                    |                   |                                                                                                                  |                      |                   |          |       |           |
|----------------|------------|-----------|------------------|--------------|--------------------|-------------------|------------------------------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |           | Z-Sub Level 1    |              |                    |                   |                                                                                                                  |                      |                   |          |       |           |
| ROOM           |            |           | Kitchen          |              | ROOM DESCRIPTION   |                   | WALLS: ceramic, solid rendered<br>CEILING: concrete<br>FLOOR: vinyl, concrete<br>no access within timber boxing. |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position  | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                                                                           | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |           |                  |              |                    |                   |                                                                                                                  |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #57    | JC001160   | sink unit | bitumen pads     |              |                    |                   |                                                                                                                  | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |           |                  |              |                    |                   | Recommended action                                                                                               |                      |                   |          |       |           |

| BUILDING       |            |                          | Main Building    |                  |                    |                    |                                                                                                        |                      |                   |          |       |             |
|----------------|------------|--------------------------|------------------|------------------|--------------------|--------------------|--------------------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |                          | Z-Sub Level 1    |                  |                    |                    |                                                                                                        |                      |                   |          |       |             |
| ROOM           |            |                          | Laundry          |                  | ROOM DESCRIPTION   |                    | WALLS: brick, solid rendered, block CEILING: concrete, fibreboard FLOOR: vinyl, concrete mmmf to pipes |                      |                   |          |       |             |
| Item Reference | Sample Ref | Position                 | Item Description | Product Type     | Condition / Damage | Surface Treatment  | Extent                                                                                                 | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |                          |                  |                  |                    |                    |                                                                                                        |                      | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #60    | JC001161   | timber panels to windows | mastic           |                  |                    |                    |                                                                                                        | No Asbestos Detected |                   | N/A      | N/A   |             |
| Comments       |            |                          |                  |                  |                    |                    | Recommended action                                                                                     |                      |                   |          |       |             |
| J050727 #61    | JC001162   | ceiling                  | textured coating | Textured Coating | (0) Good Condition | (1) Surface Sealed | 30m²                                                                                                   | Chrysotile           | 3                 | N/A      | N/A   | Risk code E |
| Comments       |            |                          |                  |                  |                    |                    | Recommended action                                                                                     |                      | Remove            |          |       |             |
|                |            |                          |                  |                  |                    |                    |                                                                                                        |                      |                   |          |       |             |
| J050727 #62    | JC001163   | sink unit                | bitumen pads     |                  |                    |                    |                                                                                                        | No Asbestos Detected |                   | N/A      | N/A   |             |
| Comments       |            |                          |                  |                  |                    |                    | Recommended action                                                                                     |                      |                   |          |       |             |

| BUILDING                                  |            |          | Main Building     |              |                    |                       |                                                                                       |                      |                   |          |       |             |
|-------------------------------------------|------------|----------|-------------------|--------------|--------------------|-----------------------|---------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL                               |            |          | Z-Sub Level 1     |              |                    |                       |                                                                                       |                      |                   |          |       |             |
| ROOM                                      |            |          | Lobby 1           |              | ROOM DESCRIPTION   |                       | WALLS: brick, block, concrete CEILING: insulation panels FLOOR: floor tiles, concrete |                      |                   |          |       |             |
| Item Reference                            | Sample Ref | Position | Item Description  | Product Type | Condition / Damage | Surface Treatment     | Extent                                                                                | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code   |
|                                           |            |          |                   |              |                    |                       |                                                                                       |                      | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #63                               | JC001164   | ceiling  | insulation panels |              |                    |                       |                                                                                       | No Asbestos Detected |                   | N/A      | N/A   |             |
| Comments                                  |            |          |                   |              |                    |                       | Recommended action                                                                    |                      |                   |          |       |             |
| J050727 #64                               | JC001165   | floor    | floor tiles       | Floor Tiles  | (0) Good Condition | (0) Completely Sealed | 2m²                                                                                   | Chrysotile           | 2                 | N/A      | N/A   | Risk code E |
| Comments                                  |            |          |                   |              |                    |                       | Recommended action                                                                    |                      | Remove            |          |       |             |
| Chrysotile found in adhesive & floor tile |            |          |                   |              |                    |                       |                                                                                       |                      |                   |          |       |             |

|                 |               |
|-----------------|---------------|
| <b>BUILDING</b> | Main Building |
|-----------------|---------------|

| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| ROOM           |            |          | Room 500         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727<br>#50 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Room 501         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727<br>#49 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 502         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#48 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 503         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#47 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Room 504         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727 #46    |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 505         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #45    |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 506         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#44 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| <b>BUILDING</b>    |            |          | Main Building    |              |                    |                         |        |                                          |                   |          |       |             |
|--------------------|------------|----------|------------------|--------------|--------------------|-------------------------|--------|------------------------------------------|-------------------|----------|-------|-------------|
| <b>FLOOR LEVEL</b> |            |          | Z-Sub Level 1    |              |                    |                         |        |                                          |                   |          |       |             |
| <b>ROOM</b>        |            |          | Room 507         |              |                    | <b>ROOM DESCRIPTION</b> |        |                                          |                   |          |       |             |
| Item Reference     | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment       | Extent | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                    |            |          |                  |              |                    |                         |        |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #43        |            |          | Inaccessible     |              |                    |                         |        | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |

|          |                    |
|----------|--------------------|
| Comments | Recommended action |
| occupied |                    |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Room 508         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727<br>#42 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Room 509         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727<br>#58 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Room 510         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727<br>#59 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

|             |  |  |               |  |  |                  |                    |                                                                                              |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|----------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                              |  |     |     |  |
| FLOOR LEVEL |  |  | Z-Sub Level 1 |  |  |                  |                    |                                                                                              |  |     |     |  |
| ROOM        |  |  | Sluice Room   |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered CEILING: concrete FLOOR: vinyl, concrete timber boxing, rubber cistern |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                       |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                              |  |     |     |  |

|  |
|--|
|  |
|--|

| BUILDING       |            |          | Main Building                           |              |                    |                   |                                                                                                 |                      |                   |          |       |           |
|----------------|------------|----------|-----------------------------------------|--------------|--------------------|-------------------|-------------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | Z-Sub Level 1                           |              |                    |                   |                                                                                                 |                      |                   |          |       |           |
| ROOM           |            |          | Stairwell 3 (lower ground to 1st floor) |              | ROOM DESCRIPTION   |                   | WALLS: solid rendered CEILING: plasterboard FLOOR: vinyl, concrete no access above ceiling void |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description                        | Product Type | Condition / Damage | Surface Treatment | Extent                                                                                          | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                                         |              |                    |                   |                                                                                                 |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #119   | JC001199   | floor    | vinyl                                   |              |                    |                   |                                                                                                 | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |          |                                         |              |                    |                   | Recommended action                                                                              |                      |                   |          |       |           |
| J050727 #120   | JC001200   | floor    | stair nosing                            |              |                    |                   |                                                                                                 | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |          |                                         |              |                    |                   | Recommended action                                                                              |                      |                   |          |       |           |

| BUILDING       |                    |          | Main Building                           |              |                    |                   |                                                                                                 |                      |                   |          |       |           |
|----------------|--------------------|----------|-----------------------------------------|--------------|--------------------|-------------------|-------------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |                    |          | Z-Sub Level 1                           |              |                    |                   |                                                                                                 |                      |                   |          |       |           |
| ROOM           |                    |          | Stairwell 4 (lower ground to 1st floor) |              | ROOM DESCRIPTION   |                   | WALLS: solid rendered CEILING: plasterboard FLOOR: vinyl, concrete no access above ceiling void |                      |                   |          |       |           |
| Item Reference | Sample Ref         | Position | Item Description                        | Product Type | Condition / Damage | Surface Treatment | Extent                                                                                          | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |                    |          |                                         |              |                    |                   |                                                                                                 |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #121   | As Sample JC001199 | floor    | vinyl                                   |              |                    |                   |                                                                                                 | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |                    |          |                                         |              |                    |                   | Recommended action                                                                              |                      |                   |          |       |           |
| J050727 #122   | As Sample JC001200 | floor    | stair nosing                            |              |                    |                   |                                                                                                 | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |                    |          |                                         |              |                    |                   | Recommended action                                                                              |                      |                   |          |       |           |

| BUILDING       |            |                                          | Main Building      |              |                    |                   |                                                                                    |                      |                   |          |       |           |
|----------------|------------|------------------------------------------|--------------------|--------------|--------------------|-------------------|------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                                          | Z-Sub Level 1      |              |                    |                   |                                                                                    |                      |                   |          |       |           |
| ROOM           |            |                                          | Tank Room          |              | ROOM DESCRIPTION   |                   | WALLS: brick, concrete CEILING: concrete FLOOR: concrete mmmf to pipes, metal tank |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position                                 | Item Description   | Product Type | Condition / Damage | Surface Treatment | Extent                                                                             | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                                          |                    |              |                    |                   |                                                                                    |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #114   | JC001195   | between brick walls and concrete ceiling | insulation packing |              |                    |                   |                                                                                    | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                                          |                    |              |                    |                   | Recommended action                                                                 |                      |                   |          |       |           |
| J050727 #115   | JC001196   | flanges                                  | gaskets            |              |                    |                   |                                                                                    | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                                          |                    |              |                    |                   | Recommended action                                                                 |                      |                   |          |       |           |

|             |  |  |               |  |  |                  |  |                                                                                               |  |  |  |  |  |
|-------------|--|--|---------------|--|--|------------------|--|-----------------------------------------------------------------------------------------------|--|--|--|--|--|
| BUILDING    |  |  | Main Building |  |  |                  |  |                                                                                               |  |  |  |  |  |
| FLOOR LEVEL |  |  | Z-Sub Level 1 |  |  |                  |  |                                                                                               |  |  |  |  |  |
| ROOM        |  |  | Toilet 1      |  |  | ROOM DESCRIPTION |  | WALLS: ceramic, timber, solid rendered CEILING: concrete FLOOR: vinyl, concrete mmmf to pipes |  |  |  |  |  |

|                 |  |  |  |  |  |  |                           |  |     |     |  |
|-----------------|--|--|--|--|--|--|---------------------------|--|-----|-----|--|
|                 |  |  |  |  |  |  | No Asbestos Identified    |  | N/A | N/A |  |
| <b>Comments</b> |  |  |  |  |  |  | <b>Recommended action</b> |  |     |     |  |
|                 |  |  |  |  |  |  |                           |  |     |     |  |

| BUILDING    |  |  | Main Building |  |                  |  |                                                                                               |                        |  |     |     |  |
|-------------|--|--|---------------|--|------------------|--|-----------------------------------------------------------------------------------------------|------------------------|--|-----|-----|--|
| FLOOR LEVEL |  |  | Z-Sub Level 1 |  |                  |  |                                                                                               |                        |  |     |     |  |
| ROOM        |  |  | Toilet 2      |  | ROOM DESCRIPTION |  | WALLS: ceramic, timber, solid rendered CEILING: concrete FLOOR: vinyl, concrete mmmf to pipes |                        |  |     |     |  |
|             |  |  |               |  |                  |  |                                                                                               | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |               |  |                  |  | Recommended action                                                                            |                        |  |     |     |  |
|             |  |  |               |  |                  |  |                                                                                               |                        |  |     |     |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Z-Sub Level 1    |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Toilet 3         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727<br>#54 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
|                |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

| BUILDING        |            |          | Main Building        |              |                    |                   |                    |                                          |                   |          |       |             |
|-----------------|------------|----------|----------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL     |            |          | Z-Sub Level 1        |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM            |            |          | Understairs Cupboard |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference  | Sample Ref | Position | Item Description     | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                 |            |          |                      |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#118 |            |          | Inaccessible         |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments        |            |          |                      |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| no keys         |            |          |                      |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING    |  |  | Main Building          |  |  |                  |  |                                                       |                        |  |     |     |  |
|-------------|--|--|------------------------|--|--|------------------|--|-------------------------------------------------------|------------------------|--|-----|-----|--|
| FLOOR LEVEL |  |  | Z-Sub Level 1          |  |  |                  |  |                                                       |                        |  |     |     |  |
| ROOM        |  |  | Understairs Cupboard 1 |  |  | ROOM DESCRIPTION |  | WALLS: brick, block CEILING: concrete FLOOR: concrete |                        |  |     |     |  |
|             |  |  |                        |  |  |                  |  |                                                       | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |                        |  |  |                  |  | Recommended action                                    |                        |  |     |     |  |
|             |  |  |                        |  |  |                  |  |                                                       |                        |  |     |     |  |

| BUILDING    |  |  | Main Building |  |                  |  |                                                                                       |                        |  |     |     |  |
|-------------|--|--|---------------|--|------------------|--|---------------------------------------------------------------------------------------|------------------------|--|-----|-----|--|
| FLOOR LEVEL |  |  | Ground Floor  |  |                  |  |                                                                                       |                        |  |     |     |  |
| ROOM        |  |  | Bathroom      |  | ROOM DESCRIPTION |  | WALLS: solid rendered, ceramic CEILING: concrete FLOOR: vinyl, concrete timber boxing |                        |  |     |     |  |
|             |  |  |               |  |                  |  |                                                                                       | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |               |  |                  |  | Recommended action                                                                    |                        |  |     |     |  |
|             |  |  |               |  |                  |  |                                                                                       |                        |  |     |     |  |

| BUILDING       |            |                     | Main Building    |                     |                    |                       |                                                                                                             |            |                   |          |       |             |
|----------------|------------|---------------------|------------------|---------------------|--------------------|-----------------------|-------------------------------------------------------------------------------------------------------------|------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |                     | Ground Floor     |                     |                    |                       |                                                                                                             |            |                   |          |       |             |
| ROOM           |            |                     | Corridor A       |                     | ROOM DESCRIPTION   |                       | WALLS: solid rendered<br>CEILING: concrete<br>FLOOR: vinyl, bitumen, concrete<br>timber riser, plastic pipe |            |                   |          |       |             |
| Item Reference | Sample Ref | Position            | Item Description | Product Type        | Condition / Damage | Surface Treatment     | Extent                                                                                                      | Conclusion | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |                     |                  |                     |                    |                       |                                                                                                             |            | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #6     | JC001141   | floor (below vinyl) | bitumen screed   | Well Bound Material | (0) Good Condition | (0) Completely Sealed | 11m²                                                                                                        | Chrysotile | 2                 | N/A      | N/A   | Risk code B |
| Comments       |            |                     |                  |                     |                    |                       | Recommended action                                                                                          |            | Remove            |          |       |             |
|                |            |                     |                  |                     |                    |                       |                                                                                                             |            |                   |          |       |             |

| BUILDING       |            |              | Main Building    |              |                    |                   |                                                                                                  |                      |                   |          |       |           |
|----------------|------------|--------------|------------------|--------------|--------------------|-------------------|--------------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |              | Ground Floor     |              |                    |                   |                                                                                                  |                      |                   |          |       |           |
| ROOM           |            |              | Corridor B       |              | ROOM DESCRIPTION   |                   | WALLS: solid rendered, glass CEILING: concrete, plasterboard, strumit<br>FLOOR: carpet, concrete |                      |                   |          |       |           |
|                |            |              |                  |              |                    |                   | Extent                                                                                           | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
| Item Reference | Sample Ref | Position     | Item Description | Product Type | Condition / Damage | Surface Treatment |                                                                                                  |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#13 | JC001146   | ceiling void | strumitt board   |              |                    |                   |                                                                                                  | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |              |                  |              |                    |                   | Recommended action                                                                               |                      |                   |          |       |           |

|             |  |  |               |  |  |                  |                    |                                                                 |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|-----------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                 |  |     |     |  |
| FLOOR LEVEL |  |  | Ground Floor  |  |  |                  |                    |                                                                 |  |     |     |  |
| ROOM        |  |  | Corridor C    |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered CEILING: concrete FLOOR: carpet, concrete |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                          |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                 |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                 |  |     |     |  |

|             |  |  |               |  |  |                  |                    |                                                                 |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|-----------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                 |  |     |     |  |
| FLOOR LEVEL |  |  | Ground Floor  |  |  |                  |                    |                                                                 |  |     |     |  |
| ROOM        |  |  | Corridor D    |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered CEILING: concrete FLOOR: carpet, concrete |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                          |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                 |  |     |     |  |

| BUILDING       |            |            | Main Building    |                           |                    |                    |                                                                                |                      |                   |          |       |             |
|----------------|------------|------------|------------------|---------------------------|--------------------|--------------------|--------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |            | Ground Floor     |                           |                    |                    |                                                                                |                      |                   |          |       |             |
| ROOM           |            |            | Cupboard 1       |                           | ROOM DESCRIPTION   |                    | WALLS: block, brick CEILING: concrete FLOOR: carpet, concrete mmmf to pipework |                      |                   |          |       |             |
| Item Reference | Sample Ref | Position   | Item Description | Product Type              | Condition / Damage | Surface Treatment  | Extent                                                                         | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |            |                  |                           |                    |                    |                                                                                |                      | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #4     | JC001140   | above door | insulation panel | Asbestos Insulating Board | (1) Low Damage     | (1) Surface Sealed | 1no.                                                                           | Chrysotile + Amosite | 6                 | N/A      | N/A   | Risk code B |
| Comments       |            |            |                  |                           |                    |                    | Recommended action                                                             |                      | Remove            |          |       |             |
|                |            |            |                  |                           |                    |                    |                                                                                |                      |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Cupboard 2       |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#16 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| no keys        |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |                  | Main Building    |              |                    |                   |                                                       |                      |                   |          |       |           |
|----------------|------------|------------------|------------------|--------------|--------------------|-------------------|-------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                  | Ground Floor     |              |                    |                   |                                                       |                      |                   |          |       |           |
| ROOM           |            |                  | Cupboard 2       |              | ROOM DESCRIPTION   |                   | WALLS: brick, block CEILING: concrete FLOOR: concrete |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position         | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                  |                  |              |                    |                   |                                                       |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #19    | JC001148   | panel above door | insulation panel |              |                    |                   |                                                       | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                  |                  |              |                    |                   | Recommended action                                    |                      |                   |          |       |           |

| BUILDING       |            |                  | Main Building    |              |                    |                   |                                                       |                      |                   |          |       |           |
|----------------|------------|------------------|------------------|--------------|--------------------|-------------------|-------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                  | Ground Floor     |              |                    |                   |                                                       |                      |                   |          |       |           |
| ROOM           |            |                  | Cupboard 3       |              | ROOM DESCRIPTION   |                   | WALLS: brick, block CEILING: concrete FLOOR: concrete |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position         | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                  |                  |              |                    |                   |                                                       |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #20    | JC001150   | panel above door | insulation panel |              |                    |                   |                                                       | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                  |                  |              |                    |                   | Recommended action                                    |                      |                   |          |       |           |

|                    |               |
|--------------------|---------------|
| <b>BUILDING</b>    | Main Building |
| <b>FLOOR LEVEL</b> | Ground Floor  |

| ROOM           |            |                  | Cupboard 4       |              | ROOM DESCRIPTION   |                   | WALLS: block CEILING: concrete FLOOR: concrete limited access |                      |                   |          |       |           |
|----------------|------------|------------------|------------------|--------------|--------------------|-------------------|---------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| Item Reference | Sample Ref | Position         | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                        | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                  |                  |              |                    |                   |                                                               |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #23    | JC001152   | panel above door | insulation panel |              |                    |                   |                                                               | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                  |                  |              |                    |                   | Recommended action                                            |                      |                   |          |       |           |

| BUILDING       |            |                  | Main Building    |              |                    |                   |                                                                        |                      |                   |          |       |           |
|----------------|------------|------------------|------------------|--------------|--------------------|-------------------|------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                  | Ground Floor     |              |                    |                   |                                                                        |                      |                   |          |       |           |
| ROOM           |            |                  | Cupboard 5       |              | ROOM DESCRIPTION   |                   | WALLS: solid rendered CEILING: concrete FLOOR: concrete limited access |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position         | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                                 | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                  |                  |              |                    |                   |                                                                        |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #31    | JC001153   | panel above door | insulation panel |              |                    |                   |                                                                        | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                  |                  |              |                    |                   | Recommended action                                                     |                      |                   |          |       |           |

| BUILDING                                  |            |                     | Main Building    |              |                    |                       |                                                                                 |            |                   |          |       |             |
|-------------------------------------------|------------|---------------------|------------------|--------------|--------------------|-----------------------|---------------------------------------------------------------------------------|------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL                               |            |                     | Ground Floor     |              |                    |                       |                                                                                 |            |                   |          |       |             |
| ROOM                                      |            |                     | Drying Room      |              | ROOM DESCRIPTION   |                       | WALLS: solid rendered, plasterboard CEILING: concrete FLOOR: vinyl, floor tiles |            |                   |          |       |             |
| Item Reference                            | Sample Ref | Position            | Item Description | Product Type | Condition / Damage | Surface Treatment     | Extent                                                                          | Conclusion | ASSESSMENT SCORES |          |       | Risk Code   |
|                                           |            |                     |                  |              |                    |                       |                                                                                 |            | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #7                                | JC001142   | floor (below vinyl) | floor tiles      | Floor Tiles  | (0) Good Condition | (0) Completely Sealed | 4m²                                                                             | Chrysotile | 2                 | N/A      | N/A   | Risk code E |
| Comments                                  |            |                     |                  |              |                    |                       | Recommended action                                                              |            | Remove            |          |       |             |
| Chrysotile found in adhesive & floor tile |            |                     |                  |              |                    |                       |                                                                                 |            |                   |          |       |             |

| BUILDING       |            |                  | Main Building         |              |                    |                   |                                                       |                      |                   |          |       |           |
|----------------|------------|------------------|-----------------------|--------------|--------------------|-------------------|-------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |                  | Ground Floor          |              |                    |                   |                                                       |                      |                   |          |       |           |
| ROOM           |            |                  | Electrical Cupboard 1 |              | ROOM DESCRIPTION   |                   | WALLS: brick, block CEILING: concrete FLOOR: concrete |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position         | Item Description      | Product Type | Condition / Damage | Surface Treatment | Extent                                                | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                  |                       |              |                    |                   |                                                       |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #18    | JC001147   | panel above door | insulation panel      |              |                    |                   |                                                       | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |                  |                       |              |                    |                   | Recommended action                                    |                      |                   |          |       |           |

| BUILDING       |                    |              | Main Building    |              |                    |                   |                                                                                            |                      |                   |          |       |           |
|----------------|--------------------|--------------|------------------|--------------|--------------------|-------------------|--------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |                    |              | Ground Floor     |              |                    |                   |                                                                                            |                      |                   |          |       |           |
| ROOM           |                    |              | Entrance Lobby   |              | ROOM DESCRIPTION   |                   | WALLS: solid rendered, glass CEILING: plasterboard, strumitt board FLOOR: carpet, concrete |                      |                   |          |       |           |
| Item Reference | Sample Ref         | Position     | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                                                     | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |                    |              |                  |              |                    |                   |                                                                                            |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #14    | As Sample JC001146 | ceiling void | strumitt board   |              |                    |                   |                                                                                            | No Asbestos Detected |                   | N/A      | N/A   |           |

| Comments | Recommended action |
|----------|--------------------|
|----------|--------------------|

| BUILDING       |            |                     | Main Building    |              |                    |                       |                                                                                                              |            |                   |          |       |             |
|----------------|------------|---------------------|------------------|--------------|--------------------|-----------------------|--------------------------------------------------------------------------------------------------------------|------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |                     | Ground Floor     |              |                    |                       |                                                                                                              |            |                   |          |       |             |
| ROOM           |            |                     | Female Toilets   |              | ROOM DESCRIPTION   |                       | WALLS: solid rendered, block CEILING: concrete FLOOR: vinyl, loor tiles, concrete timber riser, plastic pipe |            |                   |          |       |             |
| Item Reference | Sample Ref | Position            | Item Description | Product Type | Condition / Damage | Surface Treatment     | Extent                                                                                                       | Conclusion | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |                     |                  |              |                    |                       |                                                                                                              |            | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #9     | JC001144   | floor (below vinyl) | floor tiles      | Floor Tiles  | (0) Good Condition | (0) Completely Sealed | 5m²                                                                                                          | Chrysotile | 2                 | N/A      | N/A   | Risk code E |
| Comments       |            |                     |                  |              |                    |                       | Recommended action                                                                                           |            | Remove            |          |       |             |
|                |            |                     |                  |              |                    |                       |                                                                                                              |            |                   |          |       |             |

| BUILDING       |            |           | Main Building    |              |                    |                   |                                                                                     |                      |                   |          |       |           |
|----------------|------------|-----------|------------------|--------------|--------------------|-------------------|-------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |           | Ground Floor     |              |                    |                   |                                                                                     |                      |                   |          |       |           |
| ROOM           |            |           | Kitchen 1        |              | ROOM DESCRIPTION   |                   | WALLS: solid rendered, ceramic CEILING: plasterboard, timber FLOOR: vinyl, concrete |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position  | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                                              | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |           |                  |              |                    |                   |                                                                                     |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#1  | JC001138   | sink unit | bitumen pads     |              |                    |                   |                                                                                     | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |           |                  |              |                    |                   | Recommended action                                                                  |                      |                   |          |       |           |

| BUILDING       |            |           | Main Building    |              |                    |                   |                                                                                 |                      |                   |          |       |           |
|----------------|------------|-----------|------------------|--------------|--------------------|-------------------|---------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |           | Ground Floor     |              |                    |                   |                                                                                 |                      |                   |          |       |           |
| ROOM           |            |           | Kitchen 2        |              | ROOM DESCRIPTION   |                   | WALLS: solid rendered, ceramic, timber CEILING: concrete FLOOR: vinyl, concrete |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position  | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                                          | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |           |                  |              |                    |                   |                                                                                 |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #22    | JC001151   | sink unit | bitumen pads     |              |                    |                   |                                                                                 | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |           |                  |              |                    |                   | Recommended action                                                              |                      |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Lift             |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#21 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| no access      |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

|                 |                      |
|-----------------|----------------------|
| <b>BUILDING</b> | <b>Main Building</b> |
|-----------------|----------------------|

| FLOOR LEVEL |  |  | Ground Floor |  |                  |  |                                                                                             |                        |  |     |     |  |
|-------------|--|--|--------------|--|------------------|--|---------------------------------------------------------------------------------------------|------------------------|--|-----|-----|--|
| ROOM        |  |  | Lobby 1      |  | ROOM DESCRIPTION |  | WALLS: solid rendered CEILING: concrete FLOOR: carpet, concrete timber boxing, metal pipes. |                        |  |     |     |  |
|             |  |  |              |  |                  |  |                                                                                             | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |              |  |                  |  | Recommended action                                                                          |                        |  |     |     |  |
|             |  |  |              |  |                  |  |                                                                                             |                        |  |     |     |  |

|                |            |                       |                  |              |                    |                   |        |                                                                                                     |                   |          |       |           |
|----------------|------------|-----------------------|------------------|--------------|--------------------|-------------------|--------|-----------------------------------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| BUILDING       |            |                       | Main Building    |              |                    |                   |        |                                                                                                     |                   |          |       |           |
| FLOOR LEVEL    |            |                       | Ground Floor     |              |                    |                   |        |                                                                                                     |                   |          |       |           |
| ROOM           |            |                       | Lounge           |              |                    | ROOM DESCRIPTION  |        | WALLS: solid rendered, plasterboard, glass CEILING: concrete FLOOR: vinyl, carpet, timber, concrete |                   |          |       |           |
| Item Reference | Sample Ref | Position              | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion                                                                                          | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |                       |                  |              |                    |                   |        |                                                                                                     | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #2     | JC001139   | below parkay flooring | bitumen glue     |              |                    |                   |        | No Asbestos Detected                                                                                |                   | N/A      | N/A   |           |
| Comments       |            |                       |                  |              |                    |                   |        | Recommended action                                                                                  |                   |          |       |           |

| BUILDING                                  |            |                     | Main Building    |              |                    |                       |                                                                                                               |            |                   |          |       |             |
|-------------------------------------------|------------|---------------------|------------------|--------------|--------------------|-----------------------|---------------------------------------------------------------------------------------------------------------|------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL                               |            |                     | Ground Floor     |              |                    |                       |                                                                                                               |            |                   |          |       |             |
| ROOM                                      |            |                     | Male Toilets     |              | ROOM DESCRIPTION   |                       | WALLS: solid rendered, block CEILING: concrete FLOOR: vinyl, floor tiles, concrete timber riser, plastic pipe |            |                   |          |       |             |
| Item Reference                            | Sample Ref | Position            | Item Description | Product Type | Condition / Damage | Surface Treatment     | Extent                                                                                                        | Conclusion | ASSESSMENT SCORES |          |       | Risk Code   |
|                                           |            |                     |                  |              |                    |                       |                                                                                                               |            | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #8                                | JC001143   | floor (below vinyl) | floor tiles      | Floor Tiles  | (0) Good Condition | (0) Completely Sealed | 5m²                                                                                                           | Chrysotile | 2                 | N/A      | N/A   | Risk code E |
| Comments                                  |            |                     |                  |              |                    |                       | Recommended action                                                                                            |            | Remove            |          |       |             |
| Chrysotile found in adhesive & floor tile |            |                     |                  |              |                    |                       |                                                                                                               |            |                   |          |       |             |

| BUILDING       |            |                  | Main Building    |                           |                    |                    |                                                                                                                                 |            |                   |          |       |             |
|----------------|------------|------------------|------------------|---------------------------|--------------------|--------------------|---------------------------------------------------------------------------------------------------------------------------------|------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |                  | Ground Floor     |                           |                    |                    |                                                                                                                                 |            |                   |          |       |             |
| ROOM           |            |                  | Office           |                           | ROOM DESCRIPTION   |                    | WALLS: solid rendered CEILING: concrete FLOOR: carpet, concrete timber boxing, mmmf to metal pipe, timber panels above cupboard |            |                   |          |       |             |
| Item Reference | Sample Ref | Position         | Item Description | Product Type              | Condition / Damage | Surface Treatment  | Extent                                                                                                                          | Conclusion | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |                  |                  |                           |                    |                    |                                                                                                                                 |            | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #11    | JC001145   | panel above door | insulation panel | Asbestos Insulating Board | (0) Good Condition | (1) Surface Sealed | 1no.                                                                                                                            | Amosite    | 5                 | N/A      | N/A   | Risk code D |
| Comments       |            |                  |                  |                           |                    |                    | Recommended action                                                                                                              |            | Remove            |          |       |             |
|                |            |                  |                  |                           |                    |                    |                                                                                                                                 |            |                   |          |       |             |

|                |            |          |                  |              |                    |                   |        |            |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------|------------|-------------------|----------|-------|-----------|
| BUILDING       |            |          | Main Building    |              |                    |                   |        |            |                   |          |       |           |
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |        |            |                   |          |       |           |
| ROOM           |            |          | Room 13          |              |                    | ROOM DESCRIPTION  |        |            |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |        |            | MATERIAL          | PRIORITY | TOTAL |           |

|                 |  |  |              |  |  |  |                                                   |  |     |     |             |
|-----------------|--|--|--------------|--|--|--|---------------------------------------------------|--|-----|-----|-------------|
| J050727<br>#35  |  |  | Inaccessible |  |  |  | No access to<br>room/area<br>presume<br>asbestos. |  | N/A | N/A | Risk code F |
| <b>Comments</b> |  |  |              |  |  |  | <b>Recommended action</b>                         |  |     |     |             |
| occupied        |  |  |              |  |  |  |                                                   |  |     |     |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 14          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#34 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 15          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#33 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 16          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#32 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

|             |               |                  |  |
|-------------|---------------|------------------|--|
| BUILDING    | Main Building |                  |  |
| FLOOR LEVEL | Ground Floor  |                  |  |
| ROOM        | Room 17       | ROOM DESCRIPTION |  |

| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#30 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 18          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#29 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 19          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#17 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 19          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#28 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

|                 |               |
|-----------------|---------------|
| <b>BUILDING</b> | Main Building |
|-----------------|---------------|

| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| ROOM           |            |          | Room 20          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#27 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 21          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#26 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 22          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#25 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 23          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727<br>#24 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |
| ROOM           |            |          | Room 24          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #15    |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Room 24a         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727 #12    |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Room 24c         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727 #10    |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

| <b>BUILDING</b>    |            |          | Main Building    |              |                    |                         |        |                                          |                   |          |       |             |
|--------------------|------------|----------|------------------|--------------|--------------------|-------------------------|--------|------------------------------------------|-------------------|----------|-------|-------------|
| <b>FLOOR LEVEL</b> |            |          | Ground Floor     |              |                    |                         |        |                                          |                   |          |       |             |
| <b>ROOM</b>        |            |          | Room 24d         |              |                    | <b>ROOM DESCRIPTION</b> |        |                                          |                   |          |       |             |
| Item Reference     | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment       | Extent | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |
|                    |            |          |                  |              |                    |                         |        |                                          | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #5         |            |          | Inaccessible     |              |                    |                         |        | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |

|          |                    |
|----------|--------------------|
| Comments | Recommended action |
| occupied |                    |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |             |  |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-------------|--|
| FLOOR LEVEL    |            |          | Ground Floor     |              |                    |                   |                    |                                          |                   |          |       |             |  |
| ROOM           |            |          | Room 24e         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |             |  |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code   |  |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |             |  |
| J050727<br>#3  |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   | Risk code F |  |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |             |  |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |             |  |

|             |  |  |               |  |  |                  |                    |                                                                                                                                     |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|-------------------------------------------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                                                     |  |     |     |  |
| FLOOR LEVEL |  |  | Ground Floor  |  |  |                  |                    |                                                                                                                                     |  |     |     |  |
| ROOM        |  |  | Shower Room 1 |  |  | ROOM DESCRIPTION |                    | WALLS: ceramic, solid rendered, plasterboard CEILING: suspended tiles, concrete FLOOR: vinyl, concrete timber risers, plastic pipes |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                                                              |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                                                     |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                                                     |  |     |     |  |

|             |  |  |               |  |  |                  |                    |                                                                               |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|-------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                               |  |     |     |  |
| FLOOR LEVEL |  |  | Ground Floor  |  |  |                  |                    |                                                                               |  |     |     |  |
| ROOM        |  |  | Sluice Room   |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered CEILING: concrete FLOOR: vinyl, concrete limited access |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                        |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                               |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                               |  |     |     |  |

| BUILDING                                  |            |            | Main Building                        |              |                    |                       |                                                                                             |                      |                   |          |       |             |
|-------------------------------------------|------------|------------|--------------------------------------|--------------|--------------------|-----------------------|---------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL                               |            |            | Ground Floor                         |              |                    |                       |                                                                                             |                      |                   |          |       |             |
| ROOM                                      |            |            | Stairwell 1 (ground to lower ground) |              | ROOM DESCRIPTION   |                       | WALLS: solid rendered CEILING: concrete FLOOR: floor tiles, concrete timber boxing to walls |                      |                   |          |       |             |
| Item Reference                            | Sample Ref | Position   | Item Description                     | Product Type | Condition / Damage | Surface Treatment     | Extent                                                                                      | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code   |
|                                           |            |            |                                      |              |                    |                       |                                                                                             |                      | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #116                              | JC001197   | floor      | floor tiles                          | Floor Tiles  | (0) Good Condition | (0) Completely Sealed | 8m²                                                                                         | Chrysotile           | 2                 | N/A      | N/A   | Risk code E |
| Comments                                  |            |            |                                      |              |                    |                       | Recommended action                                                                          |                      | Remove            |          |       |             |
| Chrysotile found in adhesive & floor tile |            |            |                                      |              |                    |                       |                                                                                             |                      |                   |          |       |             |
| J050727 #117                              | JC001198   | above door | insulation panel                     |              |                    |                       |                                                                                             | No Asbestos Detected |                   | N/A      | N/A   |             |

|             |  |  |               |  |                  |                    |                                                                                                                                     |                        |  |     |     |  |
|-------------|--|--|---------------|--|------------------|--------------------|-------------------------------------------------------------------------------------------------------------------------------------|------------------------|--|-----|-----|--|
| Comments    |  |  |               |  |                  | Recommended action |                                                                                                                                     |                        |  |     |     |  |
| BUILDING    |  |  | Main Building |  |                  |                    |                                                                                                                                     |                        |  |     |     |  |
| FLOOR LEVEL |  |  | Ground Floor  |  |                  |                    |                                                                                                                                     |                        |  |     |     |  |
| ROOM        |  |  | Toilet 1      |  | ROOM DESCRIPTION |                    | WALLS: ceramic, plasterboard, solid rendered CEILING: suspended tiles, concrete FLOOR: vinyl, concrete timber risers, plastic pipes |                        |  |     |     |  |
|             |  |  |               |  |                  |                    |                                                                                                                                     | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |               |  |                  | Recommended action |                                                                                                                                     |                        |  |     |     |  |
|             |  |  |               |  |                  |                    |                                                                                                                                     |                        |  |     |     |  |

| BUILDING    |  |  | Main Building |  |                  |  |                                                                                                                             |                        |  |     |     |  |
|-------------|--|--|---------------|--|------------------|--|-----------------------------------------------------------------------------------------------------------------------------|------------------------|--|-----|-----|--|
| FLOOR LEVEL |  |  | Ground Floor  |  |                  |  |                                                                                                                             |                        |  |     |     |  |
| ROOM        |  |  | Toilet 2      |  | ROOM DESCRIPTION |  | WALLS: ceramic, solid rendered<br>CEILING: suspended tiles, concrete<br>FLOOR: vinyl, concrete timber risers, plastic pipes |                        |  |     |     |  |
|             |  |  |               |  |                  |  |                                                                                                                             | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |               |  |                  |  | Recommended action                                                                                                          |                        |  |     |     |  |
|             |  |  |               |  |                  |  |                                                                                                                             |                        |  |     |     |  |

|             |  |  |               |  |  |                  |                    |                                                                                                                                     |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|-------------------------------------------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                                                     |  |     |     |  |
| FLOOR LEVEL |  |  | Ground Floor  |  |  |                  |                    |                                                                                                                                     |  |     |     |  |
| ROOM        |  |  | Toilet 3      |  |  | ROOM DESCRIPTION |                    | WALLS: ceramic, solid rendered, plasterboard CEILING: suspended tiles, concrete FLOOR: vinyl, concrete timber risers, plastic pipes |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                                                              |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                                                     |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                                                     |  |     |     |  |

|             |  |  |               |  |  |                  |                    |                                                                                      |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|--------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                      |  |     |     |  |
| FLOOR LEVEL |  |  | Ground Floor  |  |  |                  |                    |                                                                                      |  |     |     |  |
| ROOM        |  |  | Toilet 4      |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered, ceramic CEILING: concrete FLOOR: vinyl, ceramic timber boxing |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                               |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                      |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                      |  |     |     |  |

|             |  |  |               |  |  |                  |                    |                                                                                                |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                |  |     |     |  |
| FLOOR LEVEL |  |  | 1st Floor     |  |  |                  |                    |                                                                                                |  |     |     |  |
| ROOM        |  |  | Bathroom 1    |  |  | ROOM DESCRIPTION |                    | WALLS: ceramic, solid rendered CEILING: plasterboard, strumitt board<br>FLOOR: vinyl, concrete |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                         |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                |  |     |     |  |

|             |  |  |               |  |  |                  |                    |                                                                                                   |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|---------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                   |  |     |     |  |
| FLOOR LEVEL |  |  | 1st Floor     |  |  |                  |                    |                                                                                                   |  |     |     |  |
| ROOM        |  |  | Bathroom 2    |  |  | ROOM DESCRIPTION |                    | WALLS: ceramic, solid rendered<br>CEILING: plasterboard, strumitt board<br>FLOOR: vinyl, concrete |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                            |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                   |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                   |  |     |     |  |

|             |  |  |               |  |  |                  |                    |                                                                                                           |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|-----------------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                           |  |     |     |  |
| FLOOR LEVEL |  |  | 1st Floor     |  |  |                  |                    |                                                                                                           |  |     |     |  |
| ROOM        |  |  | Corridor A    |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered, plasterboard, timber CEILING: plasterboard, strumitt board FLOOR: carpet, concrete |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                                    |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                           |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                           |  |     |     |  |

| BUILDING    |  |  | Main Building    |  |                  |  |                                                                                      |                        |  |     |     |  |
|-------------|--|--|------------------|--|------------------|--|--------------------------------------------------------------------------------------|------------------------|--|-----|-----|--|
| FLOOR LEVEL |  |  | 1st Floor        |  |                  |  |                                                                                      |                        |  |     |     |  |
| ROOM        |  |  | Corridor A Riser |  | ROOM DESCRIPTION |  | WALLS: solid rendered, plasterboard CEILING: plasterboard FLOOR: concrete metal duct |                        |  |     |     |  |
|             |  |  |                  |  |                  |  |                                                                                      | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |                  |  |                  |  | Recommended action                                                                   |                        |  |     |     |  |
|             |  |  |                  |  |                  |  |                                                                                      |                        |  |     |     |  |

|             |  |  |               |  |  |                  |                    |                                                                                                                         |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|-------------------------------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                                         |  |     |     |  |
| FLOOR LEVEL |  |  | 1st Floor     |  |  |                  |                    |                                                                                                                         |  |     |     |  |
| ROOM        |  |  | Corridor B    |  |  | ROOM DESCRIPTION |                    | WALLS: solid rendered, plasterboard, timber CEILING: plasterboard, strumitt board FLOOR: carpet, concrete timber boxing |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                                                  |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                                         |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                                         |  |     |     |  |

|                |            |            |                  |              |                    |                   |                    |                                                                                    |                   |          |       |           |
|----------------|------------|------------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| BUILDING       |            |            | Main Building    |              |                    |                   |                    |                                                                                    |                   |          |       |           |
| FLOOR LEVEL    |            |            | 1st Floor        |              |                    |                   |                    |                                                                                    |                   |          |       |           |
| ROOM           |            |            | Cupboard 1       |              |                    | ROOM DESCRIPTION  |                    | WALLS: solid rendered CEILING: plasterboard, strumitt board FLOOR: vinyl, concrete |                   |          |       |           |
| Item Reference | Sample Ref | Position   | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                                                                         | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |            |                  |              |                    |                   |                    |                                                                                    | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #82    | JC001173   | above door | insulation panel |              |                    |                   |                    | No Asbestos Detected                                                               |                   | N/A      | N/A   |           |
| Comments       |            |            |                  |              |                    |                   | Recommended action |                                                                                    |                   |          |       |           |
| J050727        | JC001174   | floor      | vinyl            |              |                    |                   |                    | No Asbestos                                                                        |                   | N/A      | N/A   |           |

|          |  |  |  |  |  |  |  |                    |  |  |  |  |
|----------|--|--|--|--|--|--|--|--------------------|--|--|--|--|
| #83      |  |  |  |  |  |  |  | Detected           |  |  |  |  |
| Comments |  |  |  |  |  |  |  | Recommended action |  |  |  |  |

|             |  |  |               |  |                  |  |                                                                            |                        |  |     |     |  |
|-------------|--|--|---------------|--|------------------|--|----------------------------------------------------------------------------|------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |                  |  |                                                                            |                        |  |     |     |  |
| FLOOR LEVEL |  |  | 1st Floor     |  |                  |  |                                                                            |                        |  |     |     |  |
| ROOM        |  |  | Cupboard 2    |  | ROOM DESCRIPTION |  | WALLS: solid rendered CEILING: plasterboard, strumitt board FLOOR: ceramic |                        |  |     |     |  |
|             |  |  |               |  |                  |  |                                                                            | No Asbestos Identified |  | N/A | N/A |  |
| Comments    |  |  |               |  |                  |  | Recommended action                                                         |                        |  |     |     |  |
|             |  |  |               |  |                  |  |                                                                            |                        |  |     |     |  |

|                |            |            |                  |              |                    |                   |        |                                                                            |                   |          |       |           |
|----------------|------------|------------|------------------|--------------|--------------------|-------------------|--------|----------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| BUILDING       |            |            | Main Building    |              |                    |                   |        |                                                                            |                   |          |       |           |
| FLOOR LEVEL    |            |            | 1st Floor        |              |                    |                   |        |                                                                            |                   |          |       |           |
| ROOM           |            |            | Cupboard 3       |              |                    | ROOM DESCRIPTION  |        | WALLS: brick, block CEILING: concrete FLOOR: vinyl, concrete mmmf to pipes |                   |          |       |           |
| Item Reference | Sample Ref | Position   | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion                                                                 | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |            |                  |              |                    |                   |        |                                                                            | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #84    | JC001175   | above door | insulation panel |              |                    |                   |        | No Asbestos Detected                                                       |                   | N/A      | N/A   |           |
| Comments       |            |            |                  |              |                    |                   |        | Recommended action                                                         |                   |          |       |           |
| J050727 #85    | JC001176   | floor      | vinyl            |              |                    |                   |        | No Asbestos Detected                                                       |                   | N/A      | N/A   |           |
| Comments       |            |            |                  |              |                    |                   |        | Recommended action                                                         |                   |          |       |           |

|                |                    |            |                  |              |                    |                   |        |                                                                            |                   |          |       |           |
|----------------|--------------------|------------|------------------|--------------|--------------------|-------------------|--------|----------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| BUILDING       |                    |            | Main Building    |              |                    |                   |        |                                                                            |                   |          |       |           |
| FLOOR LEVEL    |                    |            | 1st Floor        |              |                    |                   |        |                                                                            |                   |          |       |           |
| ROOM           |                    |            | Cupboard 4       |              |                    | ROOM DESCRIPTION  |        | WALLS: brick, block CEILING: concrete FLOOR: vinyl, concrete mmmf to pipes |                   |          |       |           |
| Item Reference | Sample Ref         | Position   | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion                                                                 | ASSESSMENT SCORES |          |       | Risk Code |
|                |                    |            |                  |              |                    |                   |        |                                                                            | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #89    | JC001178           | above door | insulation panel |              |                    |                   |        | No Asbestos Detected                                                       |                   | N/A      | N/A   |           |
| Comments       |                    |            |                  |              |                    |                   |        | Recommended action                                                         |                   |          |       |           |
| J050727 #90    | As Sample JC001176 | floor      | vinyl            |              |                    |                   |        | No Asbestos Detected                                                       |                   | N/A      | N/A   |           |
| Comments       |                    |            |                  |              |                    |                   |        | Recommended action                                                         |                   |          |       |           |

|                |            |            |                  |              |                    |                   |        |                                                                            |                   |          |       |           |
|----------------|------------|------------|------------------|--------------|--------------------|-------------------|--------|----------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| BUILDING       |            |            | Main Building    |              |                    |                   |        |                                                                            |                   |          |       |           |
| FLOOR LEVEL    |            |            | 1st Floor        |              |                    |                   |        |                                                                            |                   |          |       |           |
| ROOM           |            |            | Cupboard 5       |              |                    | ROOM DESCRIPTION  |        | WALLS: brick, block CEILING: concrete FLOOR: vinyl, concrete mmmf to pipes |                   |          |       |           |
| Item Reference | Sample Ref | Position   | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion                                                                 | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |            |                  |              |                    |                   |        |                                                                            | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #86    | JC001177   | above door | insulation panel |              |                    |                   |        | No Asbestos Detected                                                       |                   | N/A      | N/A   |           |
| Comments       |            |            |                  |              |                    |                   |        | Recommended action                                                         |                   |          |       |           |

| BUILDING       |            |              | Main Building    |              |                    |                   |                                                                                                     |                      |                   |          |       |           |
|----------------|------------|--------------|------------------|--------------|--------------------|-------------------|-----------------------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |              | 1st Floor        |              |                    |                   |                                                                                                     |                      |                   |          |       |           |
| ROOM           |            |              | Kitchen          |              | ROOM DESCRIPTION   |                   | WALLS: ceramic, solid rendered, plasterboard CEILING: plasterboard, strumitt FLOOR: vinyl, concrete |                      |                   |          |       |           |
| Item Reference | Sample Ref | Position     | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent                                                                                              | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |              |                  |              |                    |                   |                                                                                                     |                      | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #68    | JC001168   | ceiling void | strumitt board   |              |                    |                   |                                                                                                     | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |              |                  |              |                    |                   | Recommended action                                                                                  |                      |                   |          |       |           |
| J050727 #69    | JC001169   | sink unit    | bitumen pads     |              |                    |                   |                                                                                                     | No Asbestos Detected |                   | N/A      | N/A   |           |
| Comments       |            |              |                  |              |                    |                   | Recommended action                                                                                  |                      |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 1           |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #91    |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 10          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #79    |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |        |                                |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------|--------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |        |                                |                   |          |       |           |
| ROOM           |            |          | Room 11          |              | ROOM DESCRIPTION   |                   |        |                                |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion                     | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |        |                                | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#80 |            |          | Inaccessible     |              |                    |                   |        | No access to room/area presume |                   | N/A      | N/A   |           |

|          |  |  |  |  |  |  |  | asbestos.          |  |  |  |  |  |
|----------|--|--|--|--|--|--|--|--------------------|--|--|--|--|--|
| Comments |  |  |  |  |  |  |  | Recommended action |  |  |  |  |  |
| occupied |  |  |  |  |  |  |  |                    |  |  |  |  |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 12          |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#81 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 12a         |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#70 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 2           |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#92 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |        |            |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------|------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |        |            |                   |          |       |           |
| ROOM           |            |          | Room 3           |              | ROOM DESCRIPTION   |                   |        |            |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent | Conclusion | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |        |            | MATERIAL          | PRIORITY | TOTAL |           |

|                 |  |  |              |  |  |  |                                                   |  |     |     |  |
|-----------------|--|--|--------------|--|--|--|---------------------------------------------------|--|-----|-----|--|
| J050727<br>#93  |  |  | Inaccessible |  |  |  | No access to<br>room/area<br>presume<br>asbestos. |  | N/A | N/A |  |
| <b>Comments</b> |  |  |              |  |  |  | <b>Recommended action</b>                         |  |     |     |  |
| occupied        |  |  |              |  |  |  |                                                   |  |     |     |  |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 4           |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#94 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 5           |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#74 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 6           |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#71 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

|             |               |                  |  |
|-------------|---------------|------------------|--|
| BUILDING    | Main Building |                  |  |
| FLOOR LEVEL | 1st Floor     |                  |  |
| ROOM        | Room 7        | ROOM DESCRIPTION |  |

| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#75 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 8           |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#76 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

| BUILDING       |            |          | Main Building    |              |                    |                   |                    |                                          |                   |          |       |           |
|----------------|------------|----------|------------------|--------------|--------------------|-------------------|--------------------|------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |          | 1st Floor        |              |                    |                   |                    |                                          |                   |          |       |           |
| ROOM           |            |          | Room 9           |              | ROOM DESCRIPTION   |                   |                    |                                          |                   |          |       |           |
| Item Reference | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                               | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |          |                  |              |                    |                   |                    |                                          | MATERIAL          | PRIORITY | TOTAL |           |
| J050727<br>#78 |            |          | Inaccessible     |              |                    |                   |                    | No access to room/area presume asbestos. |                   | N/A      | N/A   |           |
| Comments       |            |          |                  |              |                    |                   | Recommended action |                                          |                   |          |       |           |
| occupied       |            |          |                  |              |                    |                   |                    |                                          |                   |          |       |           |

|             |  |  |               |  |  |                  |                    |                                                                                                              |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|--------------------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                              |  |     |     |  |
| FLOOR LEVEL |  |  | 1st Floor     |  |  |                  |                    |                                                                                                              |  |     |     |  |
| ROOM        |  |  | Sluice Room   |  |  | ROOM DESCRIPTION |                    | WALLS: ceramic, solid rendered CEILING: plasterboard, strumitt board<br>FLOOR: vinyl, concrete timber boxing |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                                       |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                              |  |     |     |  |
|             |  |  |               |  |  |                  |                    |                                                                                                              |  |     |     |  |

|             |                                     |                  |                                                                                     |
|-------------|-------------------------------------|------------------|-------------------------------------------------------------------------------------|
| BUILDING    | Main Building                       |                  |                                                                                     |
| FLOOR LEVEL | 1st Floor                           |                  |                                                                                     |
| ROOM        | Stairwell 2 & Lobby (1st to ground) | ROOM DESCRIPTION | WALLS: solid rendered CEILING: concrete FLOOR: floor tiles, concrete rubber nosings |

| Item Reference                            | Sample Ref | Position | Item Description | Product Type | Condition / Damage | Surface Treatment     | Extent             | Conclusion | ASSESSMENT SCORES |          |       | Risk Code   |
|-------------------------------------------|------------|----------|------------------|--------------|--------------------|-----------------------|--------------------|------------|-------------------|----------|-------|-------------|
|                                           |            |          |                  |              |                    |                       |                    |            | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #65                               | JC001166   | floor    | floor tiles      | Floor Tiles  | (0) Good Condition | (0) Completely Sealed | 10m²               | Chrysotile | 2                 | N/A      | N/A   | Risk code E |
| Comments                                  |            |          |                  |              |                    |                       | Recommended action |            | Remove            |          |       |             |
| Chrysotile found in adhesive & floor tile |            |          |                  |              |                    |                       |                    |            |                   |          |       |             |

| BUILDING                                  |                    |            | Main Building        |                           |                    |                       |                                                                                     |                      |                   |          |       |             |
|-------------------------------------------|--------------------|------------|----------------------|---------------------------|--------------------|-----------------------|-------------------------------------------------------------------------------------|----------------------|-------------------|----------|-------|-------------|
| FLOOR LEVEL                               |                    |            | 1st Floor            |                           |                    |                       |                                                                                     |                      |                   |          |       |             |
| ROOM                                      |                    |            | Stairwell 2 Cupboard |                           | ROOM DESCRIPTION   |                       | WALLS: solid rendered CEILING: concrete FLOOR: floor tiles, concrete rubber nosings |                      |                   |          |       |             |
| Item Reference                            | Sample Ref         | Position   | Item Description     | Product Type              | Condition / Damage | Surface Treatment     | Extent                                                                              | Conclusion           | ASSESSMENT SCORES |          |       | Risk Code   |
|                                           |                    |            |                      |                           |                    |                       |                                                                                     |                      | MATERIAL          | PRIORITY | TOTAL |             |
| J050727 #66                               | As Sample JC001166 | floor      | floor tiles          | Floor Tiles               | (0) Good Condition | (0) Completely Sealed | 1m²                                                                                 | Chrysotile*          | 2                 | N/A      | N/A   | Risk code E |
| Comments                                  |                    |            |                      |                           |                    |                       | Recommended action                                                                  |                      | Remove            |          |       |             |
| Chrysotile found in adhesive & floor tile |                    |            |                      |                           |                    |                       |                                                                                     |                      |                   |          |       |             |
| J050727 #67                               | JC001167           | above door | insulation panel     | Asbestos Insulating Board | (0) Good Condition | (1) Surface Sealed    | 1no.                                                                                | Chrysotile + Amosite | 5                 | N/A      | N/A   | Risk code D |
| Comments                                  |                    |            |                      |                           |                    |                       | Recommended action                                                                  |                      | Remove            |          |       |             |
|                                           |                    |            |                      |                           |                    |                       |                                                                                     |                      |                   |          |       |             |

| BUILDING       |            |            | Main Building    |              |                    |                   |                    |                                                                                                     |                   |          |       |           |
|----------------|------------|------------|------------------|--------------|--------------------|-------------------|--------------------|-----------------------------------------------------------------------------------------------------|-------------------|----------|-------|-----------|
| FLOOR LEVEL    |            |            | 1st Floor        |              |                    |                   |                    |                                                                                                     |                   |          |       |           |
| ROOM           |            |            | Toilet 1         |              |                    | ROOM DESCRIPTION  |                    | WALLS: ceramic, solid rendered, timber CEILING: plasterboard, strumitt board FLOOR: vinyl, concrete |                   |          |       |           |
| Item Reference | Sample Ref | Position   | Item Description | Product Type | Condition / Damage | Surface Treatment | Extent             | Conclusion                                                                                          | ASSESSMENT SCORES |          |       | Risk Code |
|                |            |            |                  |              |                    |                   |                    |                                                                                                     | MATERIAL          | PRIORITY | TOTAL |           |
| J050727 #77    | JC001172   | above door | insulation panel |              |                    |                   |                    | No Asbestos Detected                                                                                |                   | N/A      | N/A   |           |
| Comments       |            |            |                  |              |                    |                   | Recommended action |                                                                                                     |                   |          |       |           |

|             |  |  |               |  |  |                  |                    |                                                                                                         |  |     |     |  |
|-------------|--|--|---------------|--|--|------------------|--------------------|---------------------------------------------------------------------------------------------------------|--|-----|-----|--|
| BUILDING    |  |  | Main Building |  |  |                  |                    |                                                                                                         |  |     |     |  |
| FLOOR LEVEL |  |  | 1st Floor     |  |  |                  |                    |                                                                                                         |  |     |     |  |
| ROOM        |  |  | Toilet 2      |  |  | ROOM DESCRIPTION |                    | WALLS: ceramic, plasterboard, solid rendered CEILING: plasterboard FLOOR: vinyl, concrete mmmf to pipes |  |     |     |  |
|             |  |  |               |  |  |                  |                    | No Asbestos Identified                                                                                  |  | N/A | N/A |  |
| Comments    |  |  |               |  |  |                  | Recommended action |                                                                                                         |  |     |     |  |

|             |  |  |               |  |  |                  |  |                                                                                                     |  |  |  |  |
|-------------|--|--|---------------|--|--|------------------|--|-----------------------------------------------------------------------------------------------------|--|--|--|--|
| BUILDING    |  |  | Main Building |  |  |                  |  |                                                                                                     |  |  |  |  |
| FLOOR LEVEL |  |  | 1st Floor     |  |  |                  |  |                                                                                                     |  |  |  |  |
| ROOM        |  |  | Toilet 3      |  |  | ROOM DESCRIPTION |  | WALLS: ceramic, solid rendered, timber CEILING: plasterboard, strumitt board FLOOR: vinyl, concrete |  |  |  |  |



**DATA ANALYSIS SHEETS**



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #1                                                   |
| Sample reference number   | JC001138                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Kitchen 1                                                    |
| Position                  | sink unit                                                    |
| Item description          | bitumen pads                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #2                                                   |
| Sample reference number   | JC001139                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Lounge                                                       |
| Position                  | below parkay flooring                                        |
| Item description          | bitumen glue                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #3                                                   |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 24e                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

Recommended Action

Comments: occupied



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #4                                                   |
| Sample reference number   | JC001140                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Cupboard 1                                                   |
| Position                  | above door                                                   |
| Item description          | insulation panel                                             |
| Condition / damage        | (1) Low Damage                                               |
| Surface treatment         | (1) Surface Sealed                                           |
| Product type              | Asbestos Insulating Board                                    |
| Asbestos Type             | Chrysotile + Amosite                                         |
| Extent                    | 1no.                                                         |
| Accessibility             | Low                                                          |
| Material assessment score | 6                                                            |
| Risk code                 | Risk code B                                                  |


Recommended Action

Remove

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #5                                                   |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 24d                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

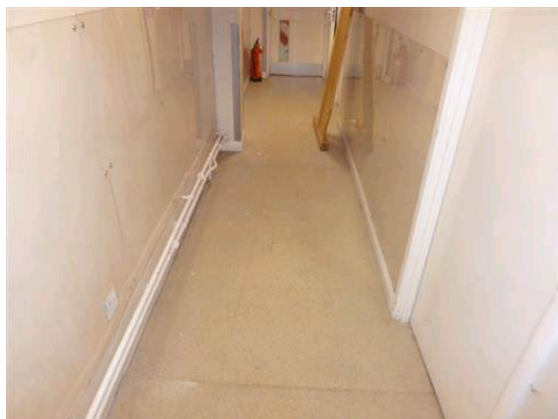**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #6                                                   |
| Sample reference number   | JC001141                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Corridor A                                                   |
| Position                  | floor (below vinyl)                                          |
| Item description          | bitumen screed                                               |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (0) Completely Sealed                                        |
| Product type              | Well Bound Material                                          |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 11m <sup>2</sup>                                             |
| Accessibility             | Low                                                          |
| Material assessment score | 2                                                            |
| Risk code                 | Risk code B                                                  |

**Recommended Action**

Remove

**Comments:**



|                                                            |        |
|------------------------------------------------------------|--------|
| <b>Recommended Action</b>                                  | Remove |
| <b>Comments:</b> Chrysotile found in adhesive & floor tile |        |

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #7                                                   |
| Sample reference number   | JC001142                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Drying Room                                                  |
| Position                  | floor (below vinyl)                                          |
| Item description          | floor tiles                                                  |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (0) Completely Sealed                                        |
| Product type              | Floor Tiles                                                  |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 4m²                                                          |
| Accessibility             | Low                                                          |
| Material assessment score | 2                                                            |
| Risk code                 | Risk code E                                                  |

|                                                                                     |                         |                                                              |
|-------------------------------------------------------------------------------------|-------------------------|--------------------------------------------------------------|
|  | Item Reference          | J050727 #8                                                   |
|                                                                                     | Sample reference number | JC001143                                                     |
|                                                                                     | Client name             | Haringey Council                                             |
|                                                                                     | Site address            | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed           | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed           | August 15 2014                                               |
|                                                                                     | Building                | Main Building                                                |
|                                                                                     | Floor level             | Ground Floor                                                 |
|                                                                                     | Room                    | Male Toilets                                                 |
|                                                                                     | Position                | floor (below vinyl)                                          |
|                                                                                     | Item description        | floor tiles                                                  |
|                                                                                     | Condition / damage      | (0) Good Condition                                           |
|                                                                                     | Surface treatment       | (0) Completely Sealed                                        |
|                                                                                     | Product type            | Floor Tiles                                                  |
|                                                                                     | Asbestos Type           | Chrysotile                                                   |
|                                                                                     | Extent                  | 5m <sup>2</sup>                                              |
| Accessibility                                                                       | Low                     |                                                              |
| Material assessment score                                                           |                         | 2                                                            |
| Risk code                                                                           |                         | Risk code E                                                  |

|                                                            |        |
|------------------------------------------------------------|--------|
| <b>Recommended Action</b>                                  | Remove |
| <b>Comments:</b> Chrysotile found in adhesive & floor tile |        |

|                                                                                   |                           |  |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--|--------------------------------------------------------------|
|  | Item Reference            |  | J050727 #9                                                   |
|                                                                                   | Sample reference number   |  | JC001144                                                     |
|                                                                                   | Client name               |  | Haringey Council                                             |
|                                                                                   | Site address              |  | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             |  | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             |  | August 15 2014                                               |
|                                                                                   | Building                  |  | Main Building                                                |
|                                                                                   | Floor level               |  | Ground Floor                                                 |
|                                                                                   | Room                      |  | Female Toilets                                               |
|                                                                                   | Position                  |  | floor (below vinyl)                                          |
|                                                                                   | Item description          |  | floor tiles                                                  |
|                                                                                   | Condition / damage        |  | (0) Good Condition                                           |
|                                                                                   | Surface treatment         |  | (0) Completely Sealed                                        |
|                                                                                   | Product type              |  | Floor Tiles                                                  |
| <b>Recommended Action</b><br><b>Comments:</b>                                     | Remove                    |  |                                                              |
|                                                                                   | Accessibility             |  | Low                                                          |
|                                                                                   | Material assessment score |  | 2                                                            |
|                                                                                   | Risk code                 |  | Risk code E                                                  |
|                                                                                   |                           |  |                                                              |

|                                                                                     |                           |  |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--|--------------------------------------------------------------|
|  | Item Reference            |  | J050727 #10                                                  |
|                                                                                     | Sample reference number   |  |                                                              |
|                                                                                     | Client name               |  | Haringey Council                                             |
|                                                                                     | Site address              |  | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             |  | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             |  |                                                              |
|                                                                                     | Building                  |  | Main Building                                                |
|                                                                                     | Floor level               |  | Ground Floor                                                 |
|                                                                                     | Room                      |  | Room 24c                                                     |
|                                                                                     | Position                  |  |                                                              |
|                                                                                     | Item description          |  | Inaccessible                                                 |
|                                                                                     | Condition / damage        |  |                                                              |
|                                                                                     | Surface treatment         |  |                                                              |
|                                                                                     | Product type              |  |                                                              |
| <b>Recommended Action</b><br><b>Comments:</b> occupied                              | Asbestos Type             |  | No access to room/area presume asbestos.                     |
|                                                                                     | Extent                    |  |                                                              |
|                                                                                     | Accessibility             |  | -                                                            |
|                                                                                     | Material assessment score |  |                                                              |
|                                                                                     | Risk code                 |  | Risk code F                                                  |



|                    |        |
|--------------------|--------|
| Recommended Action | Remove |
| Comments:          |        |

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #11                                                  |
| Sample reference number   | JC001145                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Office                                                       |
| Position                  | panel above door                                             |
| Item description          | insulation panel                                             |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (1) Surface Sealed                                           |
| Product type              | Asbestos Insulating Board                                    |
| Asbestos Type             | Amosite                                                      |
| Extent                    | 1no.                                                         |
| Accessibility             | Low                                                          |
| Material assessment score | 5                                                            |
| Risk code                 | Risk code D                                                  |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #12                                                  |
|                                                                                     | Sample reference number   |                                                              |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             |                                                              |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Ground Floor                                                 |
|                                                                                     | Room                      | Room 24a                                                     |
|                                                                                     | Position                  |                                                              |
|                                                                                     | Item description          | Inaccessible                                                 |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
|                                                                                     | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                     | Extent                    |                                                              |
| Recommended Action                                                                  | Accessibility             | -                                                            |
| Comments: occupied                                                                  | Material assessment score |                                                              |
|                                                                                     | Risk code                 | Risk code F                                                  |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #13                                                  |
| Sample reference number   | JC001146                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Corridor B                                                   |
| Position                  | ceiling void                                                 |
| Item description          | strumitt board                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #14                                                  |
| Sample reference number   | As Sample JC001146                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Entrance Lobby                                               |
| Position                  | ceiling void                                                 |
| Item description          | strumitt board                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #15                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 24                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #16                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Cupboard 2                                                   |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** no keys

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #17                                                  |
|                                                                                   | Sample reference number   |                                                              |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             |                                                              |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Ground Floor                                                 |
|                                                                                   | Room                      | Room 19                                                      |
|                                                                                   | Position                  |                                                              |
|                                                                                   | Item description          | Inaccessible                                                 |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
| <b>Recommended Action</b><br><b>Comments:</b> occupied                            | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                   | Extent                    |                                                              |
|                                                                                   | Accessibility             | -                                                            |
|                                                                                   | Material assessment score |                                                              |
|                                                                                   | Risk code                 | Risk code F                                                  |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #18                                                  |
|                                                                                     | Sample reference number   | JC001147                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 15 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Ground Floor                                                 |
|                                                                                     | Room                      | Electrical Cupboard 1                                        |
|                                                                                     | Position                  | panel above door                                             |
|                                                                                     | Item description          | insulation panel                                             |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
| <b>Recommended Action</b><br><b>Comments:</b>                                       | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                     | Extent                    |                                                              |
|                                                                                     | Accessibility             |                                                              |
|                                                                                     | Material assessment score |                                                              |
|                                                                                     | Risk code                 |                                                              |

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #19                                                  |
|                                                                                   | Sample reference number   | JC001148                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 15 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Ground Floor                                                 |
|                                                                                   | Room                      | Cupboard 2                                                   |
|                                                                                   | Position                  | panel above door                                             |
|                                                                                   | Item description          | insulation panel                                             |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                 | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                   | Extent                    |                                                              |
|                                                                                   | Accessibility             |                                                              |
|                                                                                   | Material assessment score |                                                              |
|                                                                                   |                           | Risk code                                                    |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #20                                                  |
|                                                                                     | Sample reference number   | JC001150                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 15 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Ground Floor                                                 |
|                                                                                     | Room                      | Cupboard 3                                                   |
|                                                                                     | Position                  | panel above door                                             |
|                                                                                     | Item description          | insulation panel                                             |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                   | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                     | Extent                    |                                                              |
|                                                                                     | Accessibility             |                                                              |
|                                                                                     | Material assessment score |                                                              |
|                                                                                     |                           | Risk code                                                    |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #21                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Lift                                                         |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** no access

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #22                                                  |
| Sample reference number   | JC001151                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Kitchen 2                                                    |
| Position                  | sink unit                                                    |
| Item description          | bitumen pads                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:**

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #23                                                  |
|                                                                                   | Sample reference number   | JC001152                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 15 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Ground Floor                                                 |
|                                                                                   | Room                      | Cupboard 4                                                   |
|                                                                                   | Position                  | panel above door                                             |
|                                                                                   | Item description          | insulation panel                                             |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
|                                                                                   | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                   | Extent                    |                                                              |
| Recommended Action                                                                | Accessibility             |                                                              |
| Comments:                                                                         | Material assessment score |                                                              |
|                                                                                   | Risk code                 |                                                              |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #24                                                  |
|                                                                                     | Sample reference number   |                                                              |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             |                                                              |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Ground Floor                                                 |
|                                                                                     | Room                      | Room 23                                                      |
|                                                                                     | Position                  |                                                              |
|                                                                                     | Item description          | Inaccessible                                                 |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
|                                                                                     | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                     | Extent                    |                                                              |
| Recommended Action                                                                  | Accessibility             | -                                                            |
| Comments: occupied                                                                  | Material assessment score |                                                              |
|                                                                                     | Risk code                 | Risk code F                                                  |

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #25                                                  |
|                                                                                   | Sample reference number   |                                                              |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             |                                                              |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Ground Floor                                                 |
|                                                                                   | Room                      | Room 22                                                      |
|                                                                                   | Position                  |                                                              |
|                                                                                   | Item description          | Inaccessible                                                 |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
| <b>Recommended Action</b><br><b>Comments:</b> occupied                            | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                   | Extent                    |                                                              |
|                                                                                   | Accessibility             | -                                                            |
|                                                                                   | Material assessment score |                                                              |
|                                                                                   | Risk code                 | Risk code F                                                  |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #26                                                  |
|                                                                                     | Sample reference number   |                                                              |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             |                                                              |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Ground Floor                                                 |
|                                                                                     | Room                      | Room 21                                                      |
|                                                                                     | Position                  |                                                              |
|                                                                                     | Item description          | Inaccessible                                                 |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
| <b>Recommended Action</b><br><b>Comments:</b> occupied                              | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                     | Extent                    |                                                              |
|                                                                                     | Accessibility             | -                                                            |
|                                                                                     | Material assessment score |                                                              |
|                                                                                     | Risk code                 | Risk code F                                                  |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #27                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 20                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #28                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 19                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #29                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 18                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #30                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 17                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #31                                                  |
|                                                                                   | Sample reference number   | JC001153                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 15 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Ground Floor                                                 |
|                                                                                   | Room                      | Cupboard 5                                                   |
|                                                                                   | Position                  | panel above door                                             |
|                                                                                   | Item description          | insulation panel                                             |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
|                                                                                   | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                   | Extent                    |                                                              |
| Recommended Action                                                                | Accessibility             |                                                              |
| Comments:                                                                         | Material assessment score |                                                              |
|                                                                                   | Risk code                 |                                                              |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #32                                                  |
|                                                                                     | Sample reference number   |                                                              |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             |                                                              |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Ground Floor                                                 |
|                                                                                     | Room                      | Room 16                                                      |
|                                                                                     | Position                  |                                                              |
|                                                                                     | Item description          | Inaccessible                                                 |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
|                                                                                     | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                     | Extent                    |                                                              |
| Recommended Action                                                                  | Accessibility             | -                                                            |
| Comments: occupied                                                                  | Material assessment score |                                                              |
|                                                                                     | Risk code                 | Risk code F                                                  |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #33                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 15                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied


|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #35                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Room 13                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #36                                                  |
|                                                                                   | Sample reference number   | JC001154                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 15 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Z-Sub Level 1                                                |
|                                                                                   | Room                      | Cupboard 1                                                   |
|                                                                                   | Position                  | infill panel above door                                      |
|                                                                                   | Item description          | insulation panel                                             |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
|                                                                                   | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                   | Extent                    |                                                              |
| Recommended Action                                                                | Accessibility             |                                                              |
| Comments:                                                                         | Material assessment score |                                                              |
|                                                                                   | Risk code                 |                                                              |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #37                                                  |
|                                                                                     | Sample reference number   | JC001155                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 15 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Z-Sub Level 1                                                |
|                                                                                     | Room                      | Cupboard 2                                                   |
|                                                                                     | Position                  | infill panel above door                                      |
|                                                                                     | Item description          | insulation panel                                             |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
|                                                                                     | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                     | Extent                    |                                                              |
| Recommended Action                                                                  | Accessibility             |                                                              |
| Comments:                                                                           | Material assessment score |                                                              |
|                                                                                     | Risk code                 |                                                              |

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #38                                                  |
|                                                                                   | Sample reference number   | JC001156                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 15 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Z-Sub Level 1                                                |
|                                                                                   | Room                      | Cupboard 3                                                   |
|                                                                                   | Position                  | infill panel above door                                      |
|                                                                                   | Item description          | insulation panel                                             |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
|                                                                                   | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                   | Extent                    |                                                              |
| Recommended Action                                                                | Accessibility             |                                                              |
| Comments:                                                                         | Material assessment score |                                                              |
|                                                                                   | Risk code                 |                                                              |

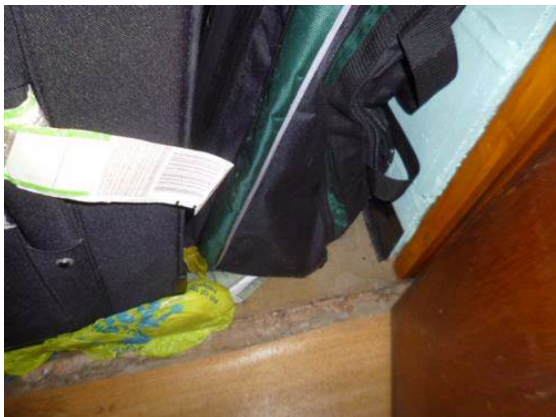
|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #39                                                  |
|                                                                                     | Sample reference number   | JC001157                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 15 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Z-Sub Level 1                                                |
|                                                                                     | Room                      | Cupboard 1                                                   |
|                                                                                     | Position                  | floor                                                        |
|                                                                                     | Item description          | vinyl covering                                               |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
|                                                                                     | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                     | Extent                    |                                                              |
| Recommended Action                                                                  | Accessibility             |                                                              |
| Comments:                                                                           | Material assessment score |                                                              |
|                                                                                     | Risk code                 |                                                              |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #40                                                  |
| Sample reference number   | As Sample JC001157                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Cupboard 2                                                   |
| Position                  | floor                                                        |
| Item description          | vinyl covering                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:

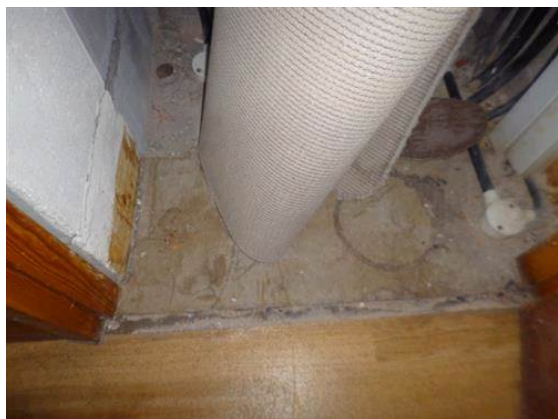

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #41                                                  |
| Sample reference number   | As Sample JC001157                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Cupboard 3                                                   |
| Position                  | floor                                                        |
| Item description          | vinyl covering                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #42                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 508                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #43                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 507                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #44                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 506                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #45                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 505                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied




|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #46                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 504                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #47                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 503                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

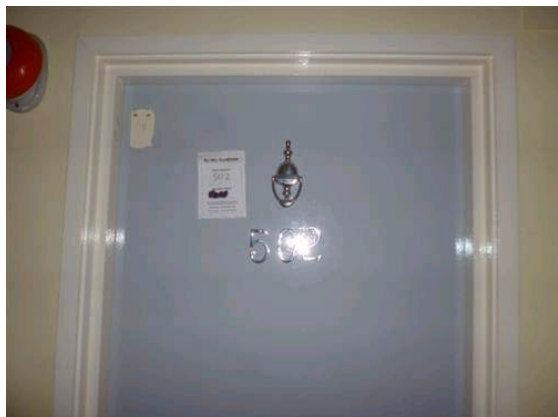

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #48                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 502                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #49                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 501                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #50                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 500                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #51                                                  |
| Sample reference number   | As Sample JC001156                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Cupboard 4                                                   |
| Position                  | infill panel above door                                      |
| Item description          | insulation panel                                             |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:**



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #52                                                  |
| Sample reference number   | As Sample JC001157                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Cupboard 4                                                   |
| Position                  | floor                                                        |
| Item description          | vinyl covering                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #53                                                  |
| Sample reference number   | JC001158                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Cupboard 5                                                   |
| Position                  | infill panel above door                                      |
| Item description          | insulation panel                                             |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #54                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Toilet 3                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #55                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Electrical Cupboard                                          |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #56                                                  |
| Sample reference number   | JC001159                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Corridor D                                                   |
| Position                  | above door (electrical cupboard)                             |
| Item description          | insulation panel                                             |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #57                                                  |
| Sample reference number   | JC001160                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Kitchen                                                      |
| Position                  | sink unit                                                    |
| Item description          | bitumen pads                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #58                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 509                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #59                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Room 510                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** occupied

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #60                                                  |
|                                                                                   | Sample reference number   | JC001161                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 15 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Z-Sub Level 1                                                |
|                                                                                   | Room                      | Laundry                                                      |
|                                                                                   | Position                  | timber panels to windows                                     |
|                                                                                   | Item description          | mastic                                                       |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
|                                                                                   | Asbestos Type             | No Asbestos Detected                                         |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                 | Extent                    |                                                              |
|                                                                                   | Accessibility             |                                                              |
|                                                                                   | Material assessment score |                                                              |
|                                                                                   | Risk code                 |                                                              |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #61                                                  |
|                                                                                     | Sample reference number   | JC001162                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 15 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Z-Sub Level 1                                                |
|                                                                                     | Room                      | Laundry                                                      |
|                                                                                     | Position                  | ceiling                                                      |
|                                                                                     | Item description          | textured coating                                             |
|                                                                                     | Condition / damage        | (0) Good Condition                                           |
|                                                                                     | Surface treatment         | (1) Surface Sealed                                           |
|                                                                                     | Product type              | Textured Coating                                             |
|                                                                                     | Asbestos Type             | Chrysotile                                                   |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                   | Extent                    | 30m <sup>2</sup>                                             |
|                                                                                     | Accessibility             | Low                                                          |
|                                                                                     | Material assessment score | 3                                                            |
|                                                                                     | Risk code                 | Risk code E                                                  |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #62                                                  |
| Sample reference number   | JC001163                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Laundry                                                      |
| Position                  | sink unit                                                    |
| Item description          | bitumen pads                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action


Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #63                                                  |
| Sample reference number   | JC001164                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Lobby 1                                                      |
| Position                  | ceiling                                                      |
| Item description          | insulation panels                                            |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:

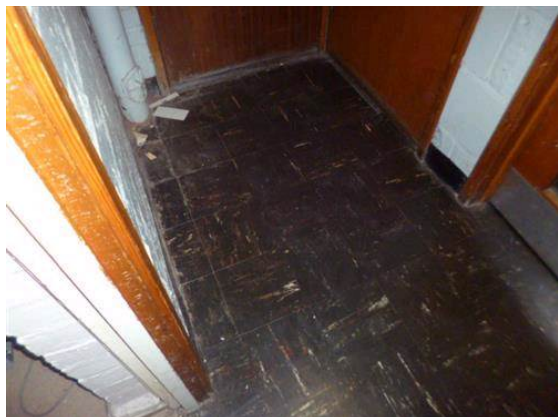

**Recommended Action** Remove  
**Comments:** Chrysotile found in adhesive & floor tile

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #64                                                  |
| Sample reference number   | JC001165                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Lobby 1                                                      |
| Position                  | floor                                                        |
| Item description          | floor tiles                                                  |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (0) Completely Sealed                                        |
| Product type              | Floor Tiles                                                  |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 2m <sup>2</sup>                                              |
| Accessibility             | Low                                                          |
| Material assessment score | 2                                                            |
| Risk code                 | Risk code E                                                  |



**Recommended Action** Remove  
**Comments:** Chrysotile found in adhesive & floor tile

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #65                                                  |
| Sample reference number   | JC001166                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Stairwell 2 & Lobby (1st to ground)                          |
| Position                  | floor                                                        |
| Item description          | floor tiles                                                  |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (0) Completely Sealed                                        |
| Product type              | Floor Tiles                                                  |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 10m <sup>2</sup>                                             |
| Accessibility             | High                                                         |
| Material assessment score | 2                                                            |
| Risk code                 | Risk code E                                                  |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #66                                                  |
| Sample reference number   | As Sample JC001166                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Stairwell 2 Cupboard                                         |
| Position                  | floor                                                        |
| Item description          | floor tiles                                                  |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (0) Completely Sealed                                        |
| Product type              | Floor Tiles                                                  |
| Asbestos Type             | Chrysotile*                                                  |
| Extent                    | 1m <sup>2</sup>                                              |
| Accessibility             | High                                                         |
| Material assessment score | 2                                                            |
| Risk code                 | Risk code E                                                  |

**Recommended Action** Remove

**Comments:** Chrysotile found in adhesive & floor tile



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #67                                                  |
| Sample reference number   | JC001167                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Stairwell 2 Cupboard                                         |
| Position                  | above door                                                   |
| Item description          | insulation panel                                             |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (1) Surface Sealed                                           |
| Product type              | Asbestos Insulating Board                                    |
| Asbestos Type             | Chrysotile + Amosite                                         |
| Extent                    | 1no.                                                         |
| Accessibility             | Low                                                          |
| Material assessment score | 5                                                            |
| Risk code                 | Risk code D                                                  |

**Recommended Action** Remove

**Comments:**



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #68                                                  |
| Sample reference number   | JC001168                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Kitchen                                                      |
| Position                  | ceiling void                                                 |
| Item description          | strumitt board                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #69                                                  |
| Sample reference number   | JC001169                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Kitchen                                                      |
| Position                  | sink unit                                                    |
| Item description          | bitumen pads                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #70                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 12a                                                     |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #71                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 6                                                       |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #74                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 5                                                       |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #75                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 7                                                       |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied




|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #76                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 8                                                       |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #77                                                  |
| Sample reference number   | JC001172                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Toilet 1                                                     |
| Position                  | above door                                                   |
| Item description          | insulation panel                                             |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:**

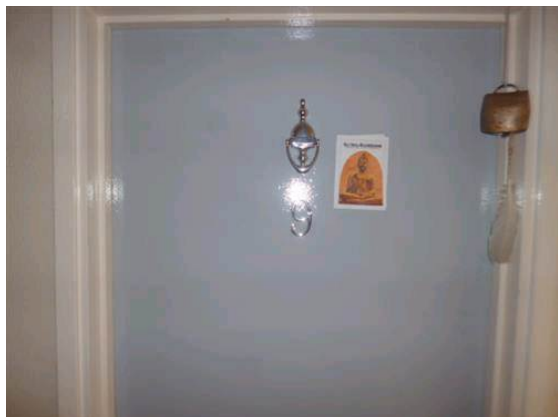

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #78                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 9                                                       |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #79                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 10                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #80                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 11                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #81                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 12                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |


**Recommended Action****Comments:** occupied



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #82                                                  |
| Sample reference number   | JC001173                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Cupboard 1                                                   |
| Position                  | above door                                                   |
| Item description          | insulation panel                                             |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:

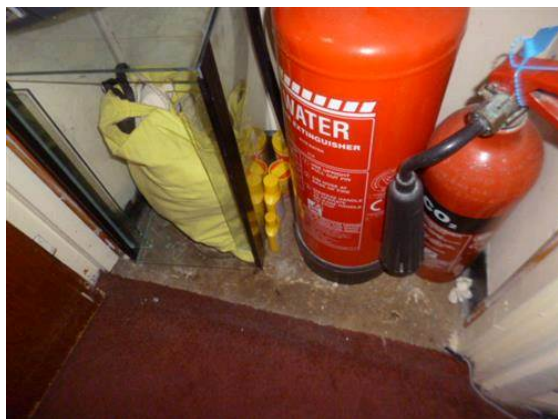

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #83                                                  |
| Sample reference number   | JC001174                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Cupboard 1                                                   |
| Position                  | floor                                                        |
| Item description          | vinyl                                                        |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action


Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #84                                                  |
| Sample reference number   | JC001175                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Cupboard 3                                                   |
| Position                  | above door                                                   |
| Item description          | insulation panel                                             |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:

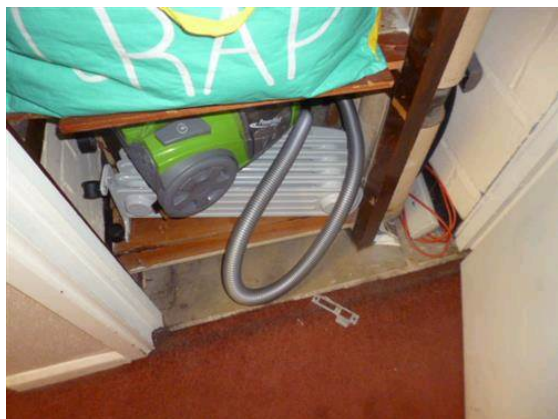

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #85                                                  |
| Sample reference number   | JC001176                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Cupboard 3                                                   |
| Position                  | floor                                                        |
| Item description          | vinyl                                                        |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:

|                                                                                   |                         |                                                              |
|-----------------------------------------------------------------------------------|-------------------------|--------------------------------------------------------------|
|  | Item Reference          | J050727 #86                                                  |
|                                                                                   | Sample reference number | JC001177                                                     |
|                                                                                   | Client name             | Haringey Council                                             |
|                                                                                   | Site address            | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed           | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed           | August 15 2014                                               |
|                                                                                   | Building                | Main Building                                                |
|                                                                                   | Floor level             | 1st Floor                                                    |
|                                                                                   | Room                    | Cupboard 5                                                   |
|                                                                                   | Position                | above door                                                   |
|                                                                                   | Item description        | insulation panel                                             |
|                                                                                   | Condition / damage      |                                                              |
|                                                                                   | Surface treatment       |                                                              |
|                                                                                   | Product type            |                                                              |
|                                                                                   | Asbestos Type           | No Asbestos Detected                                         |
| Recommended Action                                                                |                         |                                                              |
| Comments:                                                                         |                         |                                                              |
|                                                                                   |                         | Accessibility                                                |
|                                                                                   |                         | Material assessment score                                    |
|                                                                                   |                         | Risk code                                                    |

|                                                                                     |                         |                                                              |
|-------------------------------------------------------------------------------------|-------------------------|--------------------------------------------------------------|
|  | Item Reference          | J050727 #89                                                  |
|                                                                                     | Sample reference number | JC001178                                                     |
|                                                                                     | Client name             | Haringey Council                                             |
|                                                                                     | Site address            | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed           | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed           | August 15 2014                                               |
|                                                                                     | Building                | Main Building                                                |
|                                                                                     | Floor level             | 1st Floor                                                    |
|                                                                                     | Room                    | Cupboard 4                                                   |
|                                                                                     | Position                | above door                                                   |
|                                                                                     | Item description        | insulation panel                                             |
|                                                                                     | Condition / damage      |                                                              |
|                                                                                     | Surface treatment       |                                                              |
|                                                                                     | Product type            |                                                              |
|                                                                                     | Asbestos Type           | No Asbestos Detected                                         |
| Recommended Action                                                                  |                         |                                                              |
| Comments:                                                                           |                         |                                                              |
|                                                                                     |                         | Accessibility                                                |
|                                                                                     |                         | Material assessment score                                    |
|                                                                                     |                         | Risk code                                                    |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #90                                                  |
| Sample reference number   | As Sample JC001176                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Cupboard 4                                                   |
| Position                  | floor                                                        |
| Item description          | vinyl                                                        |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:**

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #91                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 1                                                       |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #92                                                  |
|                                                                                   | Sample reference number   |                                                              |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             |                                                              |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | 1st Floor                                                    |
|                                                                                   | Room                      | Room 2                                                       |
|                                                                                   | Position                  |                                                              |
|                                                                                   | Item description          | Inaccessible                                                 |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
| <b>Recommended Action</b><br><b>Comments:</b> occupied                            | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                   | Extent                    |                                                              |
|                                                                                   | Accessibility             | -                                                            |
|                                                                                   | Material assessment score |                                                              |
|                                                                                   | Risk code                 |                                                              |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #93                                                  |
|                                                                                     | Sample reference number   |                                                              |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             |                                                              |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | 1st Floor                                                    |
|                                                                                     | Room                      | Room 3                                                       |
|                                                                                     | Position                  |                                                              |
|                                                                                     | Item description          | Inaccessible                                                 |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
| <b>Recommended Action</b><br><b>Comments:</b> occupied                              | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                     | Extent                    |                                                              |
|                                                                                     | Accessibility             | -                                                            |
|                                                                                     | Material assessment score |                                                              |
|                                                                                     | Risk code                 |                                                              |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #94                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | 1st Floor                                                    |
| Room                      | Room 4                                                       |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:** occupied

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #95                                                  |
| Sample reference number   | JC001179                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 15 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Tank Room                                                    |
| Position                  | brick piers                                                  |
| Item description          | bitumen felt                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:**



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #96                                                  |
| Sample reference number   | JC001180                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Tank Room                                                    |
| Position                  | ceiling                                                      |
| Item description          | strumitt board                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #97                                                  |
| Sample reference number   | JC001181                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Tank Room                                                    |
| Position                  | around doors (external)                                      |
| Item description          | putty                                                        |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #98                                                  |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Lift Motor Room                                              |
| Position                  | motor                                                        |
| Item description          | brake shoes                                                  |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | Inaccessible, Presume asbestos                               |
| Extent                    | 2no.                                                         |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #99                                                  |
| Sample reference number   | As Sample JC001181                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Lift Motor Room                                              |
| Position                  | around doors (external)                                      |
| Item description          | putty                                                        |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #100                                                 |
| Sample reference number   | JC001182                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | External Roof                                                |
| Position                  |                                                              |
| Item description          | bitumen felt                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #101                                                 |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Stairwell 2 External Tank Room                               |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #102                                                 |
|                                                                                   | Sample reference number   | JC001183                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 16 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Z-Sub Level 1                                                |
|                                                                                   | Room                      | Boiler Room                                                  |
|                                                                                   | Position                  | wall                                                         |
|                                                                                   | Item description          | insulation residue (pink)                                    |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                 | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                   | Extent                    |                                                              |
|                                                                                   | Accessibility             |                                                              |
|                                                                                   | Material assessment score |                                                              |
|                                                                                   |                           | Risk code                                                    |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #103                                                 |
|                                                                                     | Sample reference number   | JC001184                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 16 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Z-Sub Level 1                                                |
|                                                                                     | Room                      | Boiler Room                                                  |
|                                                                                     | Position                  | wall                                                         |
|                                                                                     | Item description          | insulation residue (pink)                                    |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                   | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                     | Extent                    |                                                              |
|                                                                                     | Accessibility             |                                                              |
|                                                                                     | Material assessment score |                                                              |
|                                                                                     |                           | Risk code                                                    |

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #104                                                 |
|                                                                                   | Sample reference number   | JC001185                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 16 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Z-Sub Level 1                                                |
|                                                                                   | Room                      | Boiler Room                                                  |
|                                                                                   | Position                  | wall                                                         |
|                                                                                   | Item description          | insulation residue (white)                                   |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                 | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                   | Extent                    |                                                              |
|                                                                                   | Accessibility             |                                                              |
|                                                                                   | Material assessment score |                                                              |
|                                                                                   | Risk code                 |                                                              |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #105                                                 |
|                                                                                     | Sample reference number   | JC001186                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 16 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Z-Sub Level 1                                                |
|                                                                                     | Room                      | Boiler Room                                                  |
|                                                                                     | Position                  | wall (behind pipe)                                           |
|                                                                                     | Item description          | insulation residue (white)                                   |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                   | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                     | Extent                    |                                                              |
|                                                                                     | Accessibility             |                                                              |
|                                                                                     | Material assessment score |                                                              |
|                                                                                     | Risk code                 |                                                              |

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #106                                                 |
|                                                                                   | Sample reference number   | JC001187                                                     |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             | August 16 2014                                               |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Z-Sub Level 1                                                |
|                                                                                   | Room                      | Boiler Room                                                  |
|                                                                                   | Position                  | wall                                                         |
|                                                                                   | Item description          | insulation residue (white)                                   |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                 | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                   | Extent                    |                                                              |
|                                                                                   | Accessibility             |                                                              |
|                                                                                   | Material assessment score |                                                              |
|                                                                                   |                           | Risk code                                                    |

|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #107                                                 |
|                                                                                     | Sample reference number   | JC001188                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 16 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Z-Sub Level 1                                                |
|                                                                                     | Room                      | Boiler Room                                                  |
|                                                                                     | Position                  | wall (understairs)                                           |
|                                                                                     | Item description          | insulation residue (white)                                   |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
| <b>Recommended Action</b><br><br><b>Comments:</b>                                   | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                     | Extent                    |                                                              |
|                                                                                     | Accessibility             |                                                              |
|                                                                                     | Material assessment score |                                                              |
|                                                                                     |                           | Risk code                                                    |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #108                                                 |
| Sample reference number   | JC001189                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Boiler Room                                                  |
| Position                  | flanges                                                      |
| Item description          | gaskets                                                      |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #109                                                 |
| Sample reference number   | JC001190                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Boiler Room                                                  |
| Position                  | stairwell floor                                              |
| Item description          | insulation debris                                            |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #110                                                 |
| Sample reference number   | JC001191                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Boiler Room                                                  |
| Position                  | stairwell floor                                              |
| Item description          | insulation debris                                            |
| Condition / damage        | (3) High Damage                                              |
| Surface treatment         |                                                              |
| Product type              | Dust/Debris                                                  |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 2m <sup>2</sup>                                              |
| Accessibility             | Low                                                          |
| Material assessment score | 10                                                           |
| Risk code                 | Risk code A                                                  |

**Recommended Action**

Restrict access to area and remove

**Comments:**

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #111                                                 |
| Sample reference number   | JC001192                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Boiler Room                                                  |
| Position                  | floor                                                        |
| Item description          | dust & debris                                                |
| Condition / damage        | (3) High Damage                                              |
| Surface treatment         |                                                              |
| Product type              | Dust/Debris                                                  |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 3m <sup>2</sup>                                              |
| Accessibility             | Low                                                          |
| Material assessment score | 10                                                           |
| Risk code                 | Risk code A                                                  |

**Recommended Action**

Restrict access to area and remove


**Comments:**



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #112                                                 |
| Sample reference number   | JC001193                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Boiler Room                                                  |
| Position                  | floor                                                        |
| Item description          | dust & debris                                                |
| Condition / damage        | (3) High Damage                                              |
| Surface treatment         |                                                              |
| Product type              | Dust/Debris                                                  |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 3m <sup>2</sup>                                              |
| Accessibility             | Low                                                          |
| Material assessment score | 10                                                           |
| Risk code                 | Risk code A                                                  |

**Recommended Action**

Restrict access to area and remove

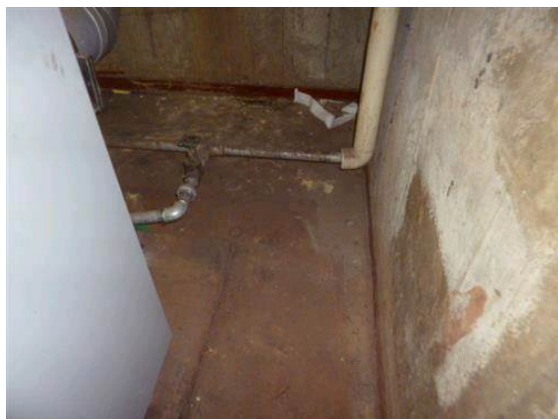**Comments:**

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #113                                                 |
| Sample reference number   | JC001194                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Boiler Room                                                  |
| Position                  | floor                                                        |
| Item description          | dust & debris                                                |
| Condition / damage        | (3) High Damage                                              |
| Surface treatment         |                                                              |
| Product type              | Dust/Debris                                                  |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 3m <sup>2</sup>                                              |
| Accessibility             | Low                                                          |
| Material assessment score | 10                                                           |
| Risk code                 | Risk code A                                                  |

**Recommended Action**

Restrict access to area and remove

**Comments:**



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #114                                                 |
| Sample reference number   | JC001195                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Tank Room                                                    |
| Position                  | between brick walls and concrete ceiling                     |
| Item description          | insulation packing                                           |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #115                                                 |
| Sample reference number   | JC001196                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 29 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Tank Room                                                    |
| Position                  | flanges                                                      |
| Item description          | gaskets                                                      |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #116                                                 |
| Sample reference number   | JC001197                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Stairwell 1 (ground to lower ground)                         |
| Position                  | floor                                                        |
| Item description          | floor tiles                                                  |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (0) Completely Sealed                                        |
| Product type              | Floor Tiles                                                  |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 8m <sup>2</sup>                                              |
| Accessibility             | Low                                                          |
| Material assessment score | 2                                                            |
| Risk code                 | Risk code E                                                  |


**Recommended Action** Remove  
**Comments:** Chrysotile found in adhesive & floor tile



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #117                                                 |
| Sample reference number   | JC001198                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Ground Floor                                                 |
| Room                      | Stairwell 1 (ground to lower ground)                         |
| Position                  | above door                                                   |
| Item description          | insulation panel                                             |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action**  
**Comments:**

|                                                                                   |                           |                                                              |
|-----------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #118                                                 |
|                                                                                   | Sample reference number   |                                                              |
|                                                                                   | Client name               | Haringey Council                                             |
|                                                                                   | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                   | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                   | Date analysed             |                                                              |
|                                                                                   | Building                  | Main Building                                                |
|                                                                                   | Floor level               | Z-Sub Level 1                                                |
|                                                                                   | Room                      | Understairs Cupboard                                         |
|                                                                                   | Position                  |                                                              |
|                                                                                   | Item description          | Inaccessible                                                 |
|                                                                                   | Condition / damage        |                                                              |
|                                                                                   | Surface treatment         |                                                              |
|                                                                                   | Product type              |                                                              |
|                                                                                   | Asbestos Type             | No access to room/area presume asbestos.                     |
|                                                                                   | Extent                    |                                                              |
| Recommended Action                                                                | Accessibility             | -                                                            |
| Comments: no keys                                                                 | Material assessment score |                                                              |
|                                                                                   | Risk code                 | Risk code F                                                  |

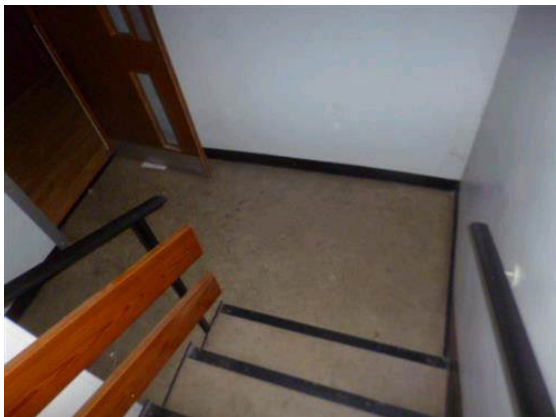
|                                                                                     |                           |                                                              |
|-------------------------------------------------------------------------------------|---------------------------|--------------------------------------------------------------|
|  | Item Reference            | J050727 #119                                                 |
|                                                                                     | Sample reference number   | JC001199                                                     |
|                                                                                     | Client name               | Haringey Council                                             |
|                                                                                     | Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
|                                                                                     | Date surveyed             | 21/07/14 TO 31/07/14                                         |
|                                                                                     | Date analysed             | August 16 2014                                               |
|                                                                                     | Building                  | Main Building                                                |
|                                                                                     | Floor level               | Z-Sub Level 1                                                |
|                                                                                     | Room                      | Stairwell 3 (lower ground to 1st floor)                      |
|                                                                                     | Position                  | floor                                                        |
|                                                                                     | Item description          | vinyl                                                        |
|                                                                                     | Condition / damage        |                                                              |
|                                                                                     | Surface treatment         |                                                              |
|                                                                                     | Product type              |                                                              |
|                                                                                     | Asbestos Type             | No Asbestos Detected                                         |
|                                                                                     | Extent                    |                                                              |
| Recommended Action                                                                  | Accessibility             |                                                              |
| Comments:                                                                           | Material assessment score |                                                              |
|                                                                                     | Risk code                 |                                                              |



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #120                                                 |
| Sample reference number   | JC001200                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Stairwell 3 (lower ground to 1st floor)                      |
| Position                  | floor                                                        |
| Item description          | stair nosing                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:

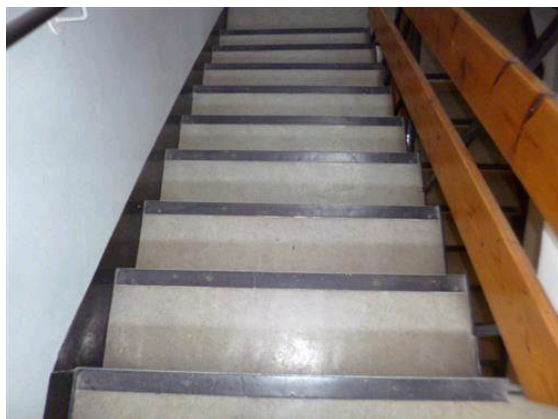

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #121                                                 |
| Sample reference number   | As Sample JC001199                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Stairwell 4 (lower ground to 1st floor)                      |
| Position                  | floor                                                        |
| Item description          | vinyl                                                        |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #122                                                 |
| Sample reference number   | As Sample JC001200                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | Z-Sub Level 1                                                |
| Room                      | Stairwell 4 (lower ground to 1st floor)                      |
| Position                  | floor                                                        |
| Item description          | stair nosing                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #123                                                 |
| Sample reference number   | JC001201                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | External Areas                                               |
| Position                  | below window                                                 |
| Item description          | damp proof course                                            |
| Condition / damage        | (0) Good Condition                                           |
| Surface treatment         | (0) Completely Sealed                                        |
| Product type              | Bitumen Products                                             |
| Asbestos Type             | Chrysotile                                                   |
| Extent                    | 1lm                                                          |
| Accessibility             | Low                                                          |
| Material assessment score | 2                                                            |
| Risk code                 | Risk code E                                                  |

Recommended Action

Remove

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #124                                                 |
| Sample reference number   |                                                              |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Garages                                                      |
| Position                  |                                                              |
| Item description          | Inaccessible                                                 |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No access to room/area presume asbestos.                     |
| Extent                    |                                                              |
| Accessibility             | -                                                            |
| Material assessment score |                                                              |
| Risk code                 | Risk code F                                                  |

**Recommended Action****Comments:** no keys

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #125                                                 |
| Sample reference number   | As Sample JC001180                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Store 1                                                      |
| Position                  | ceiling                                                      |
| Item description          | strumitt board                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

**Recommended Action****Comments:**



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #126                                                 |
| Sample reference number   | As Sample JC001180                                           |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             |                                                              |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Store 2                                                      |
| Position                  | ceiling                                                      |
| Item description          | strumitt board                                               |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:



|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #127                                                 |
| Sample reference number   | JC001202                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | Store 2                                                      |
| Position                  | around doors                                                 |
| Item description          | putty                                                        |
| Condition / damage        |                                                              |
| Surface treatment         |                                                              |
| Product type              |                                                              |
| Asbestos Type             | No Asbestos Detected                                         |
| Extent                    |                                                              |
| Accessibility             |                                                              |
| Material assessment score |                                                              |
| Risk code                 |                                                              |

Recommended Action

Comments:

**Recommended Action**

Remove

**Comments:**

|                           |                                                              |
|---------------------------|--------------------------------------------------------------|
| Item Reference            | J050727 #128                                                 |
| Sample reference number   | JC001203                                                     |
| Client name               | Haringey Council                                             |
| Site address              | Cranwood, 100 Woodside Avenue, Muswell Hill, London, N10 3JA |
| Date surveyed             | 21/07/14 TO 31/07/14                                         |
| Date analysed             | August 16 2014                                               |
| Building                  | Main Building                                                |
| Floor level               | External                                                     |
| Room                      | External Areas                                               |
| Position                  | fire exit ceiling and upstand                                |
| Item description          | insulation panels                                            |
| Condition / damage        | (1) Low Damage                                               |
| Surface treatment         | (2) Unsealed                                                 |
| Product type              | Asbestos Insulating Board                                    |
| Asbestos Type             | Chrysotile + Amosite                                         |
| Extent                    | 2m <sup>2</sup>                                              |
| Accessibility             | Low                                                          |
| Material assessment score | 7                                                            |
| Risk code                 | Risk code D                                                  |

## **APPENDIX 1**

### **SURVEY TYPE AND METHOD**

Details and scope of survey type undertaken  
Details of scoring algorithms and derivation of risk

### **LIMITATIONS**

Limitations of the survey type undertaken

## SURVEY TYPE AND METHOD

Demolition survey (HSG264). This type of survey is used to locate and describe, as far as is reasonably practical Asbestos containing materials (ACMs) in the building and may involve destructive inspection, as necessary, to gain access to areas, including those that may be difficult to reach. The survey is designed to be used as a basis for tendering the removal of ACMs from the building prior to demolition or major refurbishment.

Every effort has been made to identify all asbestos materials so far as was reasonably practical to do so within the scope of the survey and the attached report. Methods used to carry out the survey were agreed with the client prior to any works commencing. The aim of these inspections was to produce a demolition survey of the aforementioned building.

All reasonable attempts were made to access all areas within the scope of the survey. Areas not accessed are reported in the executive summary, non accessible areas register.

Due to the inherent risk to health, demolition surveys are only conducted in un-occupied buildings or sites which will remain un-occupied until any remedial or removal measures have been undertaken. If a site is to be re-occupied the requirement for testing for reoccupation will have been discussed with the client and will be dependent on the finding within this report and condition of any asbestos materials found.

Pre demolition surveys require substantial disruption to the building, i.e. partial demolition of risers, ducts, opening up of voids to walls, floor, ceiling, access hatches locked or blocked doors, etc. This cannot be accomplished without safeguards being in place and the building being empty otherwise limitations will have to be employed.

Although every effort was made to access all areas of the building it is possible that concealed cavities, floor voids etc will only be accessible during demolition, and therefore contingencies must be made to include the potential risks that asbestos containing materials may remain unidentified in the property or area covered by this inspection.

The extent and assessment of asbestos materials was determined by visible evidence on site with bulk sampling and analysis to confirm the surveyors judgement. The investigation includes an evaluation of its deterioration and homogeneity.

Samples were collected with due diligence and in line with our survey and sampling in house procedures, we hold accreditation to ISO 17020:2012 and ISO 17025:2005. Unless requested otherwise a label bearing the sample reference number is then adhered to the area sampled where practicable.

The surveyor shall take all reasonable steps in order to conclude that ACM are not present. There are obvious materials that are not asbestos. The surveyor will record basic inspection notes and conclude that no asbestos is presumed or identified for that room or area. Look-a-like materials will be sampled to support the surveyors judgement.

The destructive element of these inspections surveys will normally be completed by at least two surveyors in full RPE and PPE unless a site specific risk assessment deems otherwise.

In general terms it is the policy of this company to take samples where appropriate in order to prove the existence or otherwise of asbestos containing materials. On occasions where the report states 'presumed', 'strongly presumed' or 'no asbestos presumed', the surveyor will already have made his or her judgement, on the basis of 'reasoned argument' and with regard to their experience of similar materials. Where items have sample numbers reported "As sample NW00067" these results are strongly presumed to have the same asbestos content as identical homogenous materials that have been sampled and are related to the result of the sample to which they refer. Conclusions for "As Samples" are also appended with an asterisk "\*".

Materials are reported as 'strongly presumed' where the material appears to contain asbestos but analysis has not been undertaken. Materials will be strongly presumed in the following scenarios;

1. or based on a sample of homogenous material,
2. based on the knowledge and experience of the surveyor,
3. where materials have the appearance of asbestos or fibres are clearly visible.
4. where the materials might contain asbestos

Materials are reported as 'presumed' where asbestos materials may be present but are not accessible to inspect, assess nor sample ie there is insufficient evidence that it is asbestos free.

### **Inspection Procedure;**

Each room or designated area is inspected individually noting any building materials and those which may contain asbestos. All heating, ventilation, services, riser, voids etc, will be accessed where possible and safe to do so.

Occupied areas during demolition surveys impose restrictions on sampling and investigation to such an extent that the survey may need to be abandoned until such time as the premises is empty.

All reasonable efforts are made to access and find any concealed asbestos, e.g. below floor ducts, in ceiling voids and inside convactor heaters. However, because of the way that asbestos is used in composite structures and inaccessible places it cannot be guaranteed that all asbestos materials have been located during the surveys.

### **MATERIAL ASSESSMENT ALGORITHM SCORES (MAS) - HSG264**

Number scores are allocated to ACM depending on product type, extent of damage/ deterioration, surface treatment and asbestos type (which shall be scored as Crocidolite (blue) asbestos unless similar samples show otherwise or it is likely that another type of asbestos is almost always used).

ACM with scores of 10 or more are regarded as a high potential to release fibres if disturbed, 7- 9 medium potential, 5-6 low potential and 4 or less very low potential.

These scores and other recorded observations, which are perceived as being likely to affect the release of asbestos fibres, are then used to allocated a risk code, which provides some basic advice on how the ACM should be treated in our opinion.

| MATERIAL ALGORITHM ASSESSMENT SCORE (MAS) |          |                                                                                                                                                                      |
|-------------------------------------------|----------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Sample Variable                           | Score    | EXAMPLE                                                                                                                                                              |
| <b>Product type</b>                       | <b>1</b> | Asbestos reinforced composites(plastics, resins, mastics, roofing felts, vinyl floor tiles, semi-rigid paints or decorative finishes, asbestos cement products etc). |
|                                           | <b>2</b> | Asbestos insulation board, mill board, other low density boards, asbestos ropes and woven textiles, gaskets, asbestos paper and felt.                                |
|                                           | <b>3</b> | Thermal insulation (e.g. pipe and boiler lagging), sprayed asbestos, loose asbestos, asbestos mattresses and packing.                                                |
| <b>Extent of damage / deterioration</b>   | <b>0</b> | Good condition; no visible damage.                                                                                                                                   |
|                                           | <b>1</b> | Low damage; scratches or surface marks; broken edges to boards, tiles etc                                                                                            |
|                                           | <b>2</b> | Medium damage; significant breakage of materials or several small areas where material has been damaged revealing loose fibres.                                      |
|                                           | <b>3</b> | High damage or delamination of materials, sprays and thermal insulation. Visible asbestos debris                                                                     |
| <b>Surface treatment</b>                  | <b>0</b> | Composite materials containing asbestos; reinforced plastics, resins, vinyl tiles                                                                                    |
|                                           | <b>1</b> | Enclosed sprays and lagging, AIB (with exposed face painted or encapsulated) cement sheets etc.                                                                      |
|                                           | <b>2</b> | Unsealed AIB, or encapsulated lagging and sprays                                                                                                                     |
|                                           | <b>3</b> | Unsealed lagging and sprays.                                                                                                                                         |
| <b>Asbestos type</b>                      | <b>1</b> | Chrysotile                                                                                                                                                           |
|                                           | <b>2</b> | Amphibole asbestos excluding Crocidolite                                                                                                                             |
|                                           | <b>3</b> | Crocidolite                                                                                                                                                          |

| RISK CODE TABLE |                                                                                                                                                                                                                           |
|-----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| RISK CODE       | MANAGEMENT RECOMMENDATIONS                                                                                                                                                                                                |
| A               | Restrict access to area immediately. Remove by licence asbestos contractors under controlled conditions in accordance with CAR2012                                                                                        |
| B               | Remove or repair by licensed contractors in accordance with CAR2012.                                                                                                                                                      |
| C               | Encapsulate by licensed contractor in accordance with CAR 2012. Where appropriate label with warning signs on completion. Undertake routine re-inspections.                                                               |
| D               | High Risk ACM in good condition, encapsulation intact. Where appropriate label with warning signs. Undertake routine re-inspections for damage or deterioration in accordance with asbestos management plan and CAR 2012. |
| E               | Low risk ACM (Bound in matrix). Where appropriate label with warning signs. Undertake routine inspections for damage and deterioration. Where damaged, remove or repair in accordance with CAR2012. Reg 3(2).             |
| F               | Inaccessible room or item, maintain presumption of asbestos until accessed.                                                                                                                                               |

Tersus always recommends the use of licensed asbestos removal contractors undertaking all works in accordance with the Control of Asbestos Regulations (CAR2012).

Should you require any further assistance please do not hesitate to contact Tersus.

**LIMITATIONS**

|                                       |                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
|---------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Mechanical & Electrical installations | Where these are live and cannot be isolated presumptions as to typical asbestos in electrical plant has been made within the reports<br>Service ducts, risers, voids and cavities (concealed under floors, in voids etc.)                                                                                                                                                                                                                         |
| Reasonable access                     | Access limitations and requirements will be pre-determined in accordance with the clients requirements                                                                                                                                                                                                                                                                                                                                            |
| Fire Doors                            | Doors were only destructively inspected where doing so did not adversely affect the security or safety of the premises. These have been recorded in the report.                                                                                                                                                                                                                                                                                   |
| Plans                                 | If plans of the premises to be inspected are not made available it cannot be ascertained if all areas have been identified or accessed. All premises will be hand sketched in order to avoid misinterpretation, however in complex premises Tersus cannot guarantee that all areas have been identified. It is the clients responsibility to check the supplied drawing and to highlight any concealed or obstructed areas not shown on sketches. |

**APPENDIX 2**

**BULK ANALYSIS CERTIFICATE**



**Haringey Council**

Level 6  
River Park House  
High Road  
London

1st Floor Rainham House, Manor Way, Rainham, Essex, RM13 8RH  
T: (0) 1708 555 705, F: (0) 1708 555 925

[www.tersusgroup.co.uk](http://www.tersusgroup.co.uk), [info@tersusgroup.co.uk](mailto:info@tersusgroup.co.uk)

**For the attention of Steve  
Hollyman**

**REPORT OF ANALYTICAL EXAMINATION FOR ASBESTOS IN BULK SAMPLE(S)**

Job number J050727  
Number of samples 63  
Date sampled / received 31 Jul 2014  
Date analysed , 29 Aug 2014  
Analyst Sruveen Cheeti  
Zsolt Varga  
Sampled By John Chilvers  
Site address Cranwood, 100 Woodside Avenue, Muswell Hill, London,  
N10 3JA

**METHOD OF ANALYSIS**

The sample(s) were analysed using Polarised Light Microscopy and McCrone Dispersion Staining by the method given in HSG248, Appendix 2. This is an accredited test method under ISO 17025. We disclaim responsibility for the accuracy of information provided by and sampling undertaken by the client. "Trace" is reported as defined in HSG248 where applicable. All opinions and descriptions ie. non asbestos fibre types and material types in this report fall outside the scope of our accreditation.

| Sample ref. no. | Building      | Floor level  | Room       | Position              | Item             | Material                  | Conclusion           |
|-----------------|---------------|--------------|------------|-----------------------|------------------|---------------------------|----------------------|
| JC001138        | Main Building | Ground Floor | Kitchen 1  | sink unit             | bitumen pads     | Bitumen Products          | No Asbestos Detected |
| JC001139        | Main Building | Ground Floor | Lounge     | below parkay flooring | bitumen glue     | Bitumen Products          | No Asbestos Detected |
| JC001140        | Main Building | Ground Floor | Cupboard 1 | above door            | insulation panel | Asbestos Insulating Board | Chrysotile + Amosite |

| Sample ref. no.                           | Building      | Floor level  | Room                  | Position            | Item             | Material                  | Conclusion           |
|-------------------------------------------|---------------|--------------|-----------------------|---------------------|------------------|---------------------------|----------------------|
| JC001141                                  | Main Building | Ground Floor | Corridor A            | floor (below vinyl) | bitumen screed   | Well Bound Material       | Chrysotile           |
| JC001142                                  | Main Building | Ground Floor | Drying Room           | floor (below vinyl) | floor tiles      | Floor Tiles               | Chrysotile           |
| Chrysotile found in adhesive & floor tile |               |              |                       |                     |                  |                           |                      |
| JC001143                                  | Main Building | Ground Floor | Male Toilets          | floor (below vinyl) | floor tiles      | Floor Tiles               | Chrysotile           |
| Chrysotile found in adhesive & floor tile |               |              |                       |                     |                  |                           |                      |
| JC001144                                  | Main Building | Ground Floor | Female Toilets        | floor (below vinyl) | floor tiles      | Floor Tiles               | Chrysotile           |
| JC001145                                  | Main Building | Ground Floor | Office                | panel above door    | insulation panel | Asbestos Insulating Board | Amosite              |
| JC001146                                  | Main Building | Ground Floor | Corridor B            | ceiling void        | strumitt board   | Board                     | No Asbestos Detected |
| JC001147                                  | Main Building | Ground Floor | Electrical Cupboard 1 | panel above door    | insulation panel | Board                     | No Asbestos Detected |
| JC001148                                  | Main Building | Ground Floor | Cupboard 2            | panel above door    | insulation panel | Board                     | No Asbestos Detected |
| JC001150                                  | Main Building | Ground Floor | Cupboard 3            | panel above door    | insulation panel | Board                     | No Asbestos Detected |
| JC001151                                  | Main Building | Ground Floor | Kitchen 2             | sink unit           | bitumen pads     | Bitumen Products          | No Asbestos Detected |
| JC001152                                  | Main Building | Ground Floor | Cupboard 4            | panel above door    | insulation panel | Board                     | No Asbestos Detected |
| JC001153                                  | Main Building | Ground Floor | Cupboard 5            | panel above door    | insulation panel | Board                     | No Asbestos Detected |

[illegible]


| Sample ref. no.                           | Building      | Floor level | Room                                | Position     | Item             | Material                  | Conclusion           |
|-------------------------------------------|---------------|-------------|-------------------------------------|--------------|------------------|---------------------------|----------------------|
| JC001166                                  | Main Building | 1st Floor   | Stairwell 2 & Lobby (1st to ground) | floor        | floor tiles      | Floor Tiles               | Chrysotile           |
| Chrysotile found in adhesive & floor tile |               |             |                                     |              |                  |                           |                      |
| JC001167                                  | Main Building | 1st Floor   | Stairwell 2 Cupboard                | above door   | insulation panel | Asbestos Insulating Board | Chrysotile + Amosite |
| JC001168                                  | Main Building | 1st Floor   | Kitchen                             | ceiling void | strumitt board   | Board                     | No Asbestos Detected |
| JC001169                                  | Main Building | 1st Floor   | Kitchen                             | sink unit    | bitumen pads     | Bitumen Products          | No Asbestos Detected |
| JC001172                                  | Main Building | 1st Floor   | Toilet 1                            | above door   | insulation panel | Board                     | No Asbestos Detected |
| JC001173                                  | Main Building | 1st Floor   | Cupboard 1                          | above door   | insulation panel | Board                     | No Asbestos Detected |
| JC001174                                  | Main Building | 1st Floor   | Cupboard 1                          | floor        | vinyl            | Well Bound Material       | No Asbestos Detected |
| JC001175                                  | Main Building | 1st Floor   | Cupboard 3                          | above door   | insulation panel | Board                     | No Asbestos Detected |
| JC001176                                  | Main Building | 1st Floor   | Cupboard 3                          | floor        | vinyl            | Well Bound Material       | No Asbestos Detected |
| JC001177                                  | Main Building | 1st Floor   | Cupboard 5                          | above door   | insulation panel | Board                     | No Asbestos Detected |
| JC001178                                  | Main Building | 1st Floor   | Cupboard 4                          | above door   | insulation panel | Board                     | No Asbestos Detected |
| JC001179                                  | Main Building | External    | Tank Room                           | brick piers  | bitumen felt     | Bitumen Products          | No Asbestos Detected |

| Sample ref. no. | Building      | Floor level   | Room          | Position                | Item                       | Material            | Conclusion           |
|-----------------|---------------|---------------|---------------|-------------------------|----------------------------|---------------------|----------------------|
| JC001180        | Main Building | External      | Tank Room     | ceiling                 | strumitt board             | Board               | No Asbestos Detected |
| JC001181        | Main Building | External      | Tank Room     | around doors (external) | putty                      | Well Bound Material | No Asbestos Detected |
| JC001182        | Main Building | External      | External Roof |                         | bitumen felt               | Bitumen Products    | No Asbestos Detected |
| JC001183        | Main Building | Z-Sub Level 1 | Boiler Room   | wall                    | insulation residue (pink)  | Lagging             | No Asbestos Detected |
| JC001184        | Main Building | Z-Sub Level 1 | Boiler Room   | wall                    | insulation residue (pink)  | Lagging             | No Asbestos Detected |
| JC001185        | Main Building | Z-Sub Level 1 | Boiler Room   | wall                    | insulation residue (white) | Lagging             | No Asbestos Detected |
| JC001186        | Main Building | Z-Sub Level 1 | Boiler Room   | wall (behind pipe)      | insulation residue (white) | Lagging             | No Asbestos Detected |
| JC001187        | Main Building | Z-Sub Level 1 | Boiler Room   | wall                    | insulation residue (white) | Lagging             | No Asbestos Detected |
| JC001188        | Main Building | Z-Sub Level 1 | Boiler Room   | wall (understairs)      | insulation residue (white) | Lagging             | No Asbestos Detected |
| JC001189        | Main Building | Z-Sub Level 1 | Boiler Room   | flanges                 | gaskets                    | Gaskets             | No Asbestos Detected |
| JC001190        | Main Building | Z-Sub Level 1 | Boiler Room   | stairwell floor         | insulation debris          | Dust/Debris         | No Asbestos Detected |
| JC001191        | Main Building | Z-Sub Level 1 | Boiler Room   | stairwell floor         | insulation debris          | Dust/Debris         | Chrysotile           |

| Sample ref. no.                           | Building      | Floor level   | Room                                    | Position                                 | Item               | Material                  | Conclusion           |
|-------------------------------------------|---------------|---------------|-----------------------------------------|------------------------------------------|--------------------|---------------------------|----------------------|
| JC001192                                  | Main Building | Z-Sub Level 1 | Boiler Room                             | floor                                    | dust & debris      | Dust/Debris               | Chrysotile           |
| JC001193                                  | Main Building | Z-Sub Level 1 | Boiler Room                             | floor                                    | dust & debris      | Dust/Debris               | Chrysotile           |
| JC001194                                  | Main Building | Z-Sub Level 1 | Boiler Room                             | floor                                    | dust & debris      | Dust/Debris               | Chrysotile           |
| JC001195                                  | Main Building | Z-Sub Level 1 | Tank Room                               | between brick walls and concrete ceiling | insulation packing | Insulation                | No Asbestos Detected |
| JC001196                                  | Main Building | Z-Sub Level 1 | Tank Room                               | flanges                                  | gaskets            | Gaskets                   | No Asbestos Detected |
| JC001197                                  | Main Building | Ground Floor  | Stairwell 1 (ground to lower ground)    | floor                                    | floor tiles        | Floor Tiles               | Chrysotile           |
| Chrysotile found in adhesive & floor tile |               |               |                                         |                                          |                    |                           |                      |
| JC001198                                  | Main Building | Ground Floor  | Stairwell 1 (ground to lower ground)    | above door                               | insulation panel   | Board                     | No Asbestos Detected |
| JC001199                                  | Main Building | Z-Sub Level 1 | Stairwell 3 (lower ground to 1st floor) | floor                                    | vinyl              | Well Bound Material       | No Asbestos Detected |
| JC001200                                  | Main Building | Z-Sub Level 1 | Stairwell 3 (lower ground to 1st floor) | floor                                    | stair nosing       | Well Bound Material       | No Asbestos Detected |
| JC001201                                  | Main Building | External      | External Areas                          | below window                             | damp proof course  | Bitumen Products          | Chrysotile           |
| JC001202                                  | Main Building | External      | Store 2                                 | around doors                             | putty              | Well Bound Material       | No Asbestos Detected |
| JC001203                                  | Main Building | External      | External Areas                          | fire exit ceiling and upstand            | insulation panels  | Asbestos Insulating Board | Chrysotile + Amosite |

Authorised signatures

Zsolt Varga



### Appendix 3

#### ANNOTATED PLANS

