


Coleridge Primary School, Crouch End Hill N8 8DN





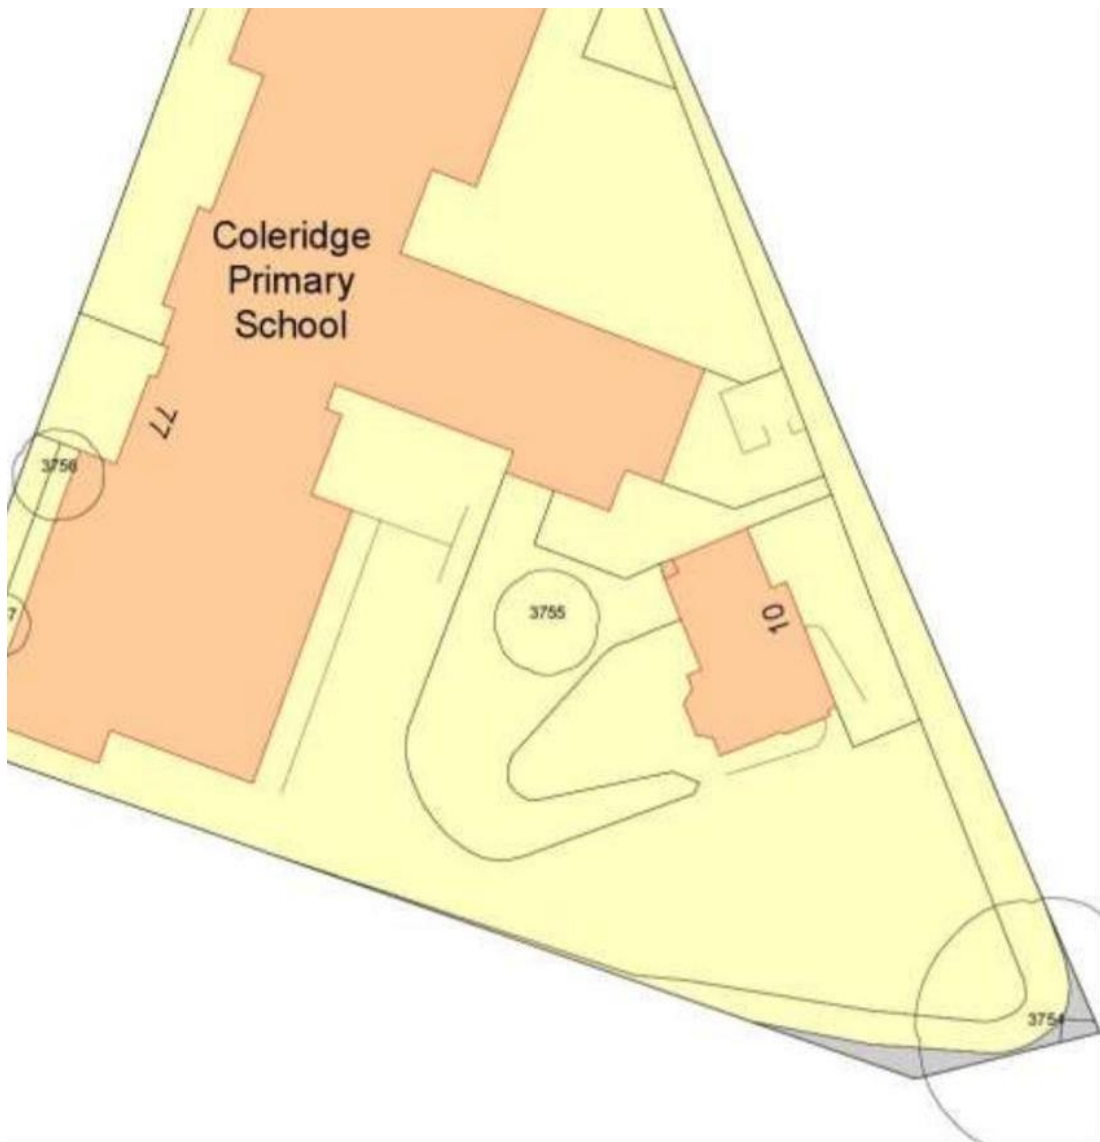

Tree Id	Species	Height (m)	DBH (mm)	Crown spread (m)	Physiological condition	Structural Condition	Observations	Recommendations
3740	Lime	10	300	8	Good	Good	Overhanging neighbouring garage.	Pollard to 7m, reduce overhang back to boundary.
3741	Lime	22	800	12	Good	Good	Large tree leaning over building. Epicormic obscuring base, ivy obscuring trunk. Dead wood, hangers.	Remove basal epicormic and ivy to enable proper inspection. Reduce canopy height by 4-5m and reshape. Remove hangers and significant dead wood.
3746	Lime	25	700	5	Good	Fair	Historically pollarded to 10m approximately. Neighbouring beech removed leaving canopy exposed. Significant dead wood.	Reduce to 15m and remove significant dead wood.
3747	Eucalyptus	20	600	8	Good	Good	Large tree leaning towards building. Lower branches contacting building. Previously pollarded at approximately 10-12m.	Raise canopy to 7m. Reduce by 5-6m.
3748	Beech	18	700	16	Good	Good	Leans towards playground and buildings. Decline in upper canopy. Dead wood throughout canopy.	Reduce height by 3- 4m to healthy growth. Reduce side by approximately 2m to reshape.
3749	Maple	15	350	4	Good	Fair	Kreschmaria deusta fruiting between north western buttresses. Pronounced buttresses consistent with good adaptive growth.	Reduce canopy by 4-5m.
3754	London plane	28	2000	20	Good	Good	Dead wood, hangers, long low limb over playground	Remove dead wood and hangers and reduce low limb over playground by 3m