

Brass & glass TEL panel: TEL to repair/clean
 Roller shutters: dismantle overhaul paint & reassemble

render + paint
 cracked/unstable
 prepare + repoint

marking on granite
 clean

brickwork stained
 clean/wire brush

granite marked
 prepare + clean

Brass frame hinges panel - fixed shut
 clean brass & seal
 Fit new sign

North West Section Elevation
 1:25

Satin Anodized Aluminium 'brass'
 colour. Clean & refam

TEL bronze + glass.

Front door
 painted bronze, remove
 paint apart from signwritten
 section & re max.
 granite margin
 clean & stain
 front door frame
 hardwood encased
 in bronze externally
 Inward
 draught excluder.

Satin Anodized Aluminium shopfront
 'brass' colour. Clean & refam

granite panels - clean &
 refam

Wood Green Underground Station shop front detail A
 © Savills November 2022

East Section Elevation
 scale 1:25

Remove modern signage
clean glass.
Retain signage
(partly concealed behind
roller shutter door)

Signwriting to panel. clean
+ retain

Bronze clad hardwood
clean, remove paint &
renov.

Section through shopfront
(replacement in S.A.A.)
@ 1:2


Replace glass in panel

blind track

S.A.A. shopfront


door frame with
(original) bronze
cladding.

hardwood door casted
externally in bronze
in place @ 1:2

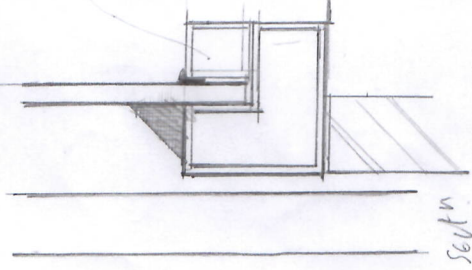


sect'n

ext.

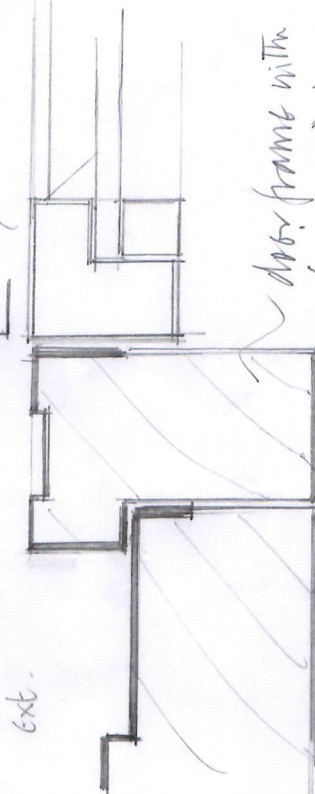

int.

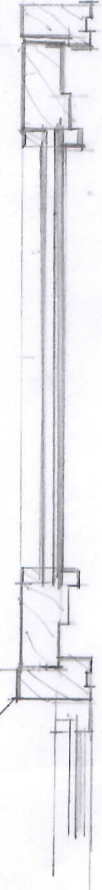

wood arm underground station shopfront detail B.

© Savills November 2012

finlays

CLAIETTE


Remove overpanel
boarding

clean & repolish
hardwood

Repair damaged
door in hardwood
to match

Introduce
applied drop
draught
excluder

External elevation to shopfront @ 1:10

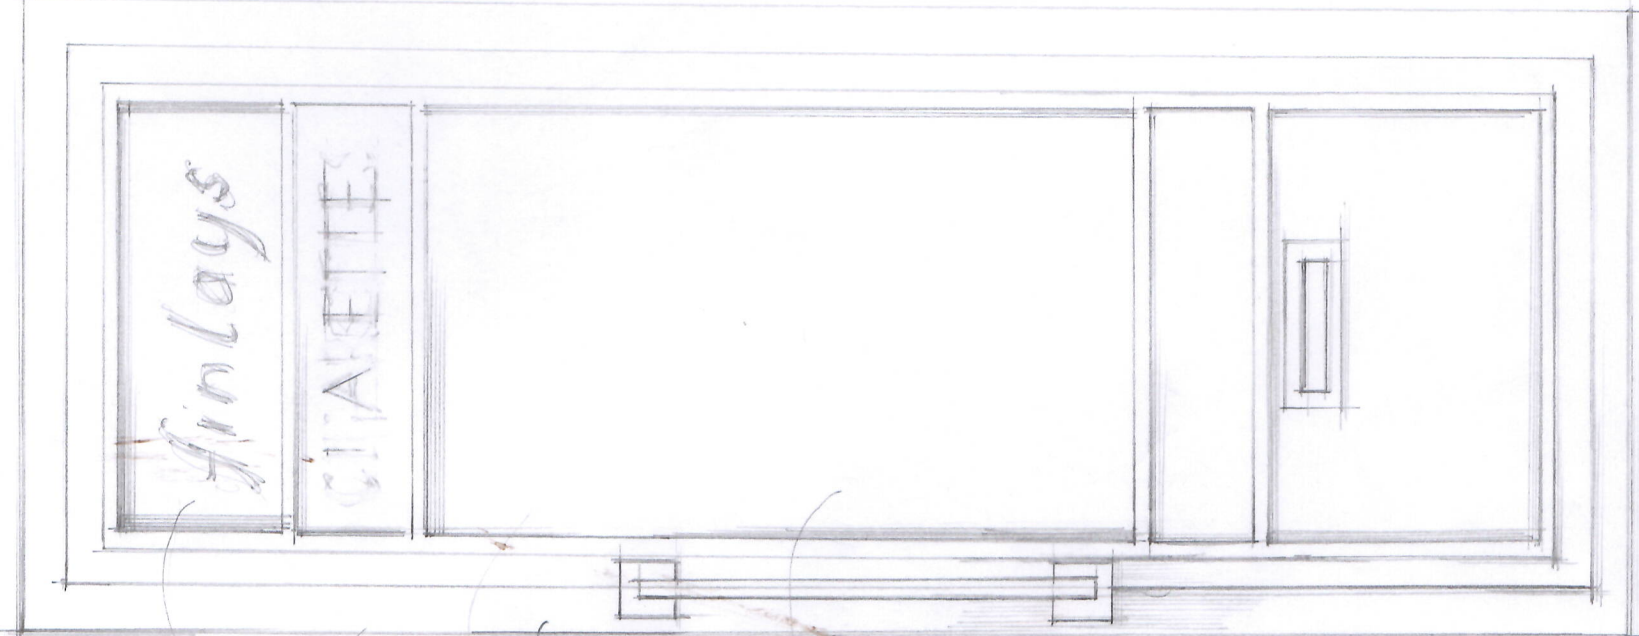

shopfront

Repair where former lockcase
damaged frame
Renew glass with
new hardwood bearing

roller shutter
S.A.A. shopfront.

Internal elevation to shopfront @ 1:10

