


| Tree reference number | Species                                      | Category grading | Works required                             | For Development | For Arboriculture | Comments                                                                                                                                                                                                   |
|-----------------------|----------------------------------------------|------------------|--------------------------------------------|-----------------|-------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| H1                    | Laurel Cherry ( <i>Prunus laurocerasus</i> ) | B2               | Remove laurel hedge between two properties | Yes             |                   | Large overgrown hedge between the two properties. Would require removal or significant cutting back regardless of application.                                                                             |
| T01                   | Common Ash ( <i>Fraxinus excelsior</i> )     | B1               | Remove tree                                | Yes             |                   | Tree will need to be removed due to proximity to patio. Tree was originally close to patio and likely to be infected with ADB in the future. Removal of tree is likely to occur regardless of application. |
| T02                   | Common Ash ( <i>Fraxinus excelsior</i> )     | B1               | Remove tree                                | Yes             |                   | Tree will need to be removed due to proximity to patio. Tree was originally close to patio and likely to be infected with ADB in the future. Removal of tree is likely to occur regardless of application. |
| T03                   | Common Ash ( <i>Fraxinus excelsior</i> )     | B1               | Remove tree                                | Yes             |                   | Tree will need to be removed due to proximity to patio. Tree was originally close to patio and likely to be infected with ADB in the future. Removal of tree is likely to occur regardless of application. |
| T04                   | Common Ash ( <i>Fraxinus excelsior</i> )     | B1               | Remove tree                                | Yes             |                   | Tree will need to be removed due to proximity to patio. Tree was originally close to patio and likely to be infected with ADB in the future. Removal of tree is likely to occur regardless of application. |
| T12                   | Not identified ( <i>Not identified</i> )     | U                | Remove Stump                               | Yes             | Yes               | Would require removal regardless of application.                                                                                                                                                           |

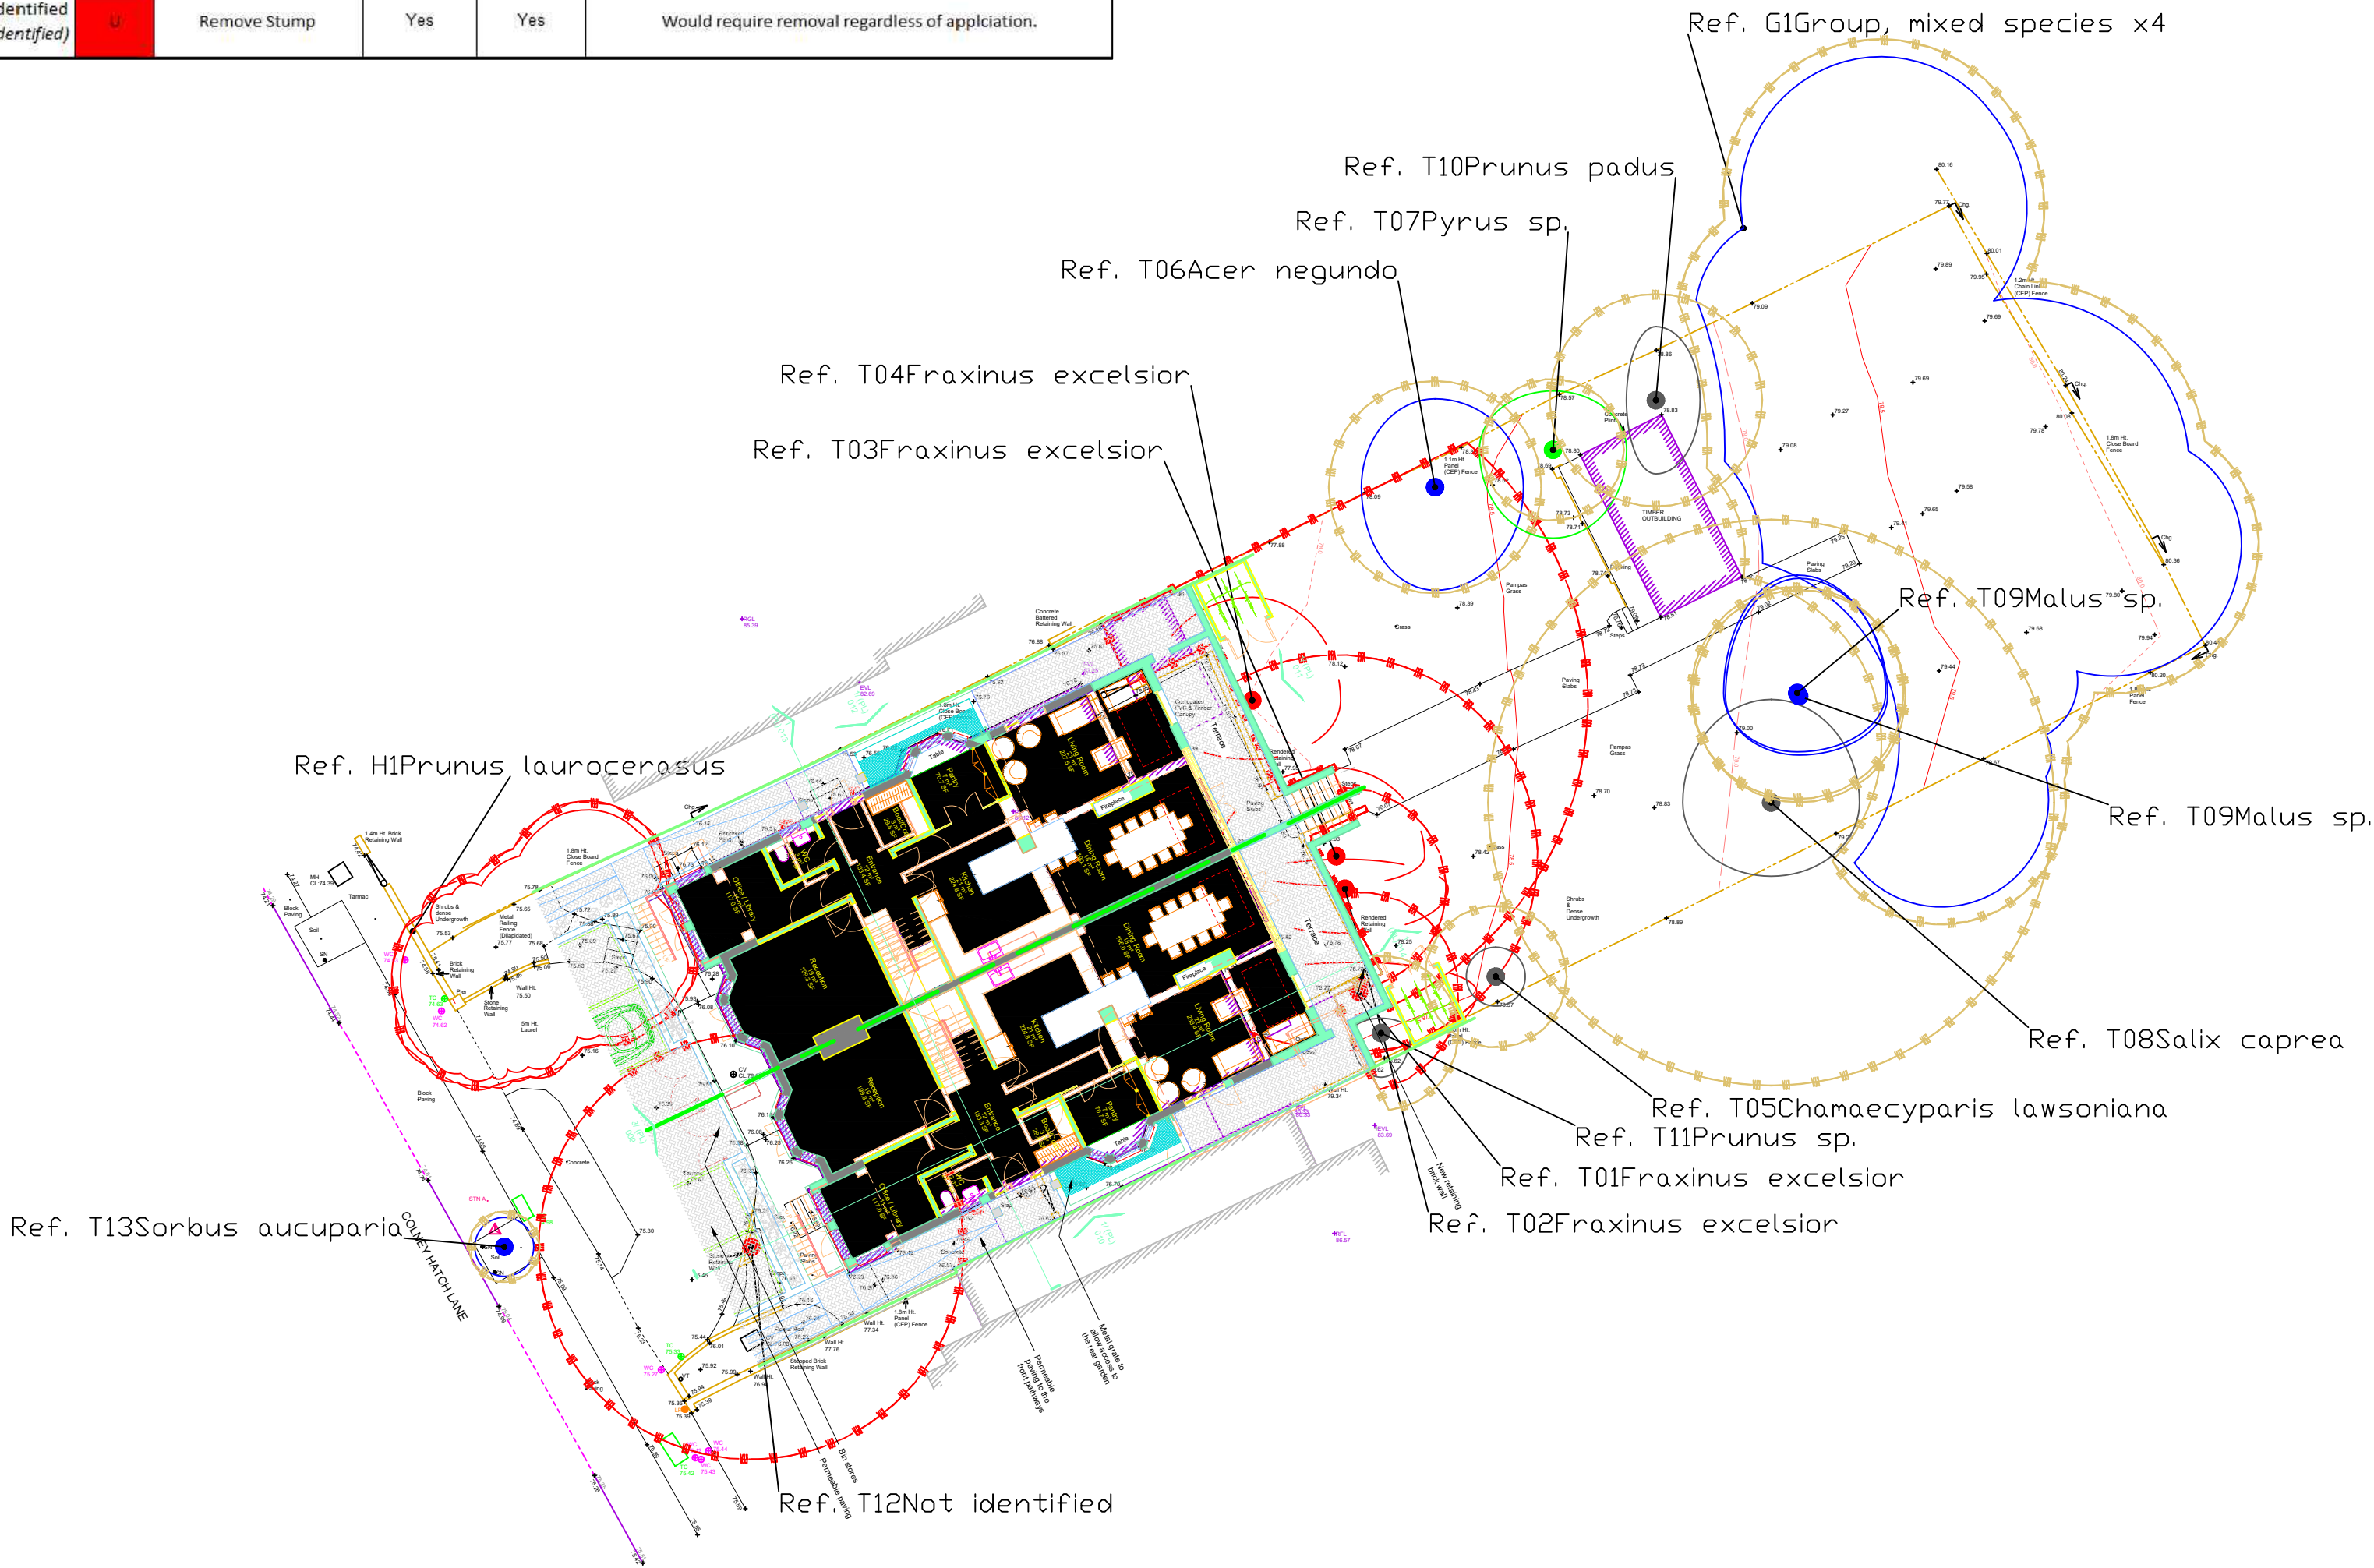

Notes :

This drawing has been prepared in accordance with BS 5837:2012.

This drawing is intended to be printed and used in colour only, and for no purpose other than the consideration of trees in accordance with BS 5837.

BS5837:2012 Cascade chart for tree quality assessment

| Category & Definition                | Criteria (including subcategories where appropriate)                                                                                                                                                                                                                                                                                                                    | Identification on plan  |
|--------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------|
| Trees unsuitable for retention       |                                                                                                                                                                                                                                                                                                                                                                         |                         |
| Category U                           | Trees that have a serious irreparable structural defect, such that their early loss is expected due to their condition. The loss or removal of such trees is likely to be significant to the overall appearance of the site. Trees that are dead or dying, or that are likely to be removed in the near future. Trees that are likely to be removed in the near future. | Red on plan RGB 127,0,0 |
| Trees to be considered for retention |                                                                                                                                                                                                                                                                                                                                                                         |                         |
| Category A                           | 1. Many arboricultural qualities<br>2. Many landscape qualities<br>3. Many cultural values, including conservation                                                                                                                                                                                                                                                      |                         |
| Category B                           | 1. Many arboricultural qualities<br>2. Many landscape qualities<br>3. Many cultural values, including conservation                                                                                                                                                                                                                                                      |                         |
| Category C                           | 1. Many arboricultural qualities<br>2. Many landscape qualities<br>3. Many cultural values, including conservation                                                                                                                                                                                                                                                      |                         |

KEY

Root Protection Area (RPA)

Tree Stem

T1 Tree No.

Tree to be removed

Tree to be pruned

Rev Details

Date

Checked By

Drawing Number

AEL-18617-TWP

APEX

Environmental

Apex Environmental Ltd

3 Lawrence Way, Lichfield, WS13 6RD

Tel: 0121 249 1235 e-mail: info@ael-treeconsultants.co.uk web: www.ael-treeconsultants.co.uk

Client

XP Property

Project

108-110 Colney Hatch Lane

Title

Tree Work Plan

Scale

Date

Drawn By

Checked By

Drawing Number

Revision

1:200

07/03/2023

RJH

B

THIS DRAWING IS CONFIDENTIAL AND MUST NOT BE REPRODUCED WITHOUT THE CONSENT OF APEX ENVIRONMENTAL LTD

