



JUNCTIONS SKYLIGHT - Minimum slope 3°

overview

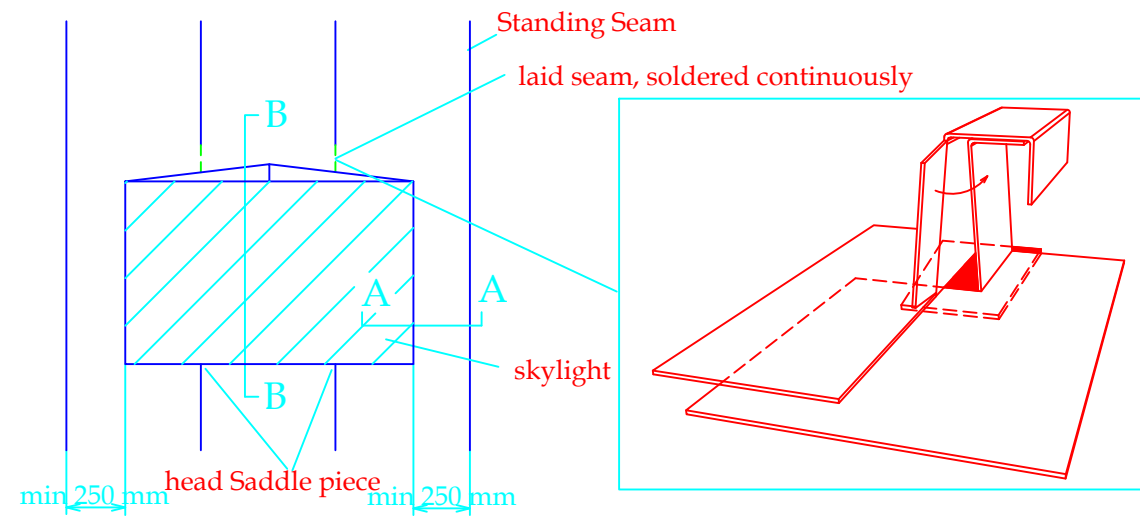


Penetrations must not interrupt more than four seams. When the slope is <25% and the skylight larger, a concealed boxgutter must be placed.
At this level, expansion of the VMZINC® must be, towards the ridge not the eaves, = no fixed clip at the ridge.

section AA

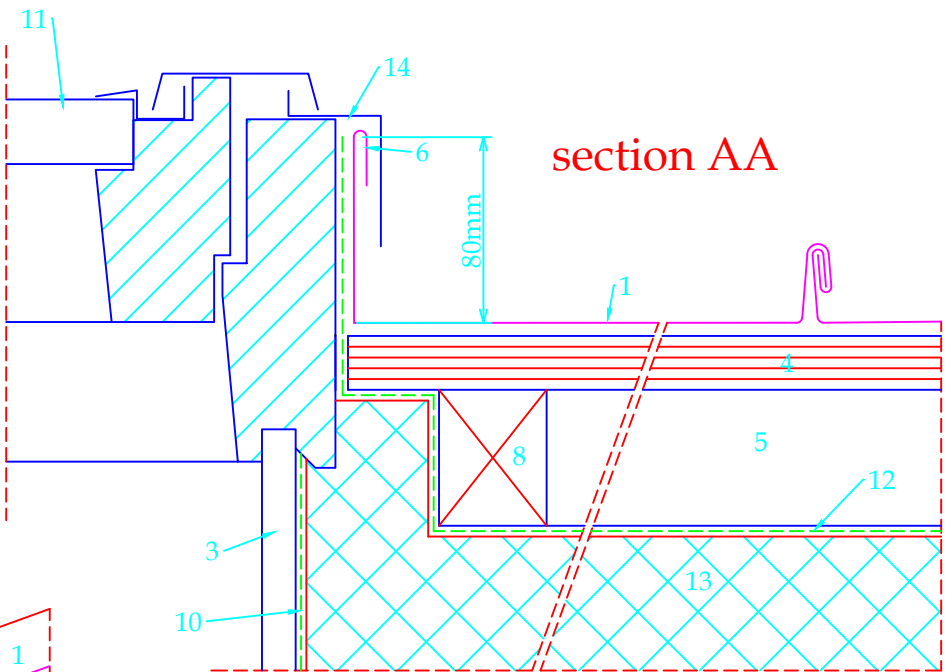

Horizontal line

section BB

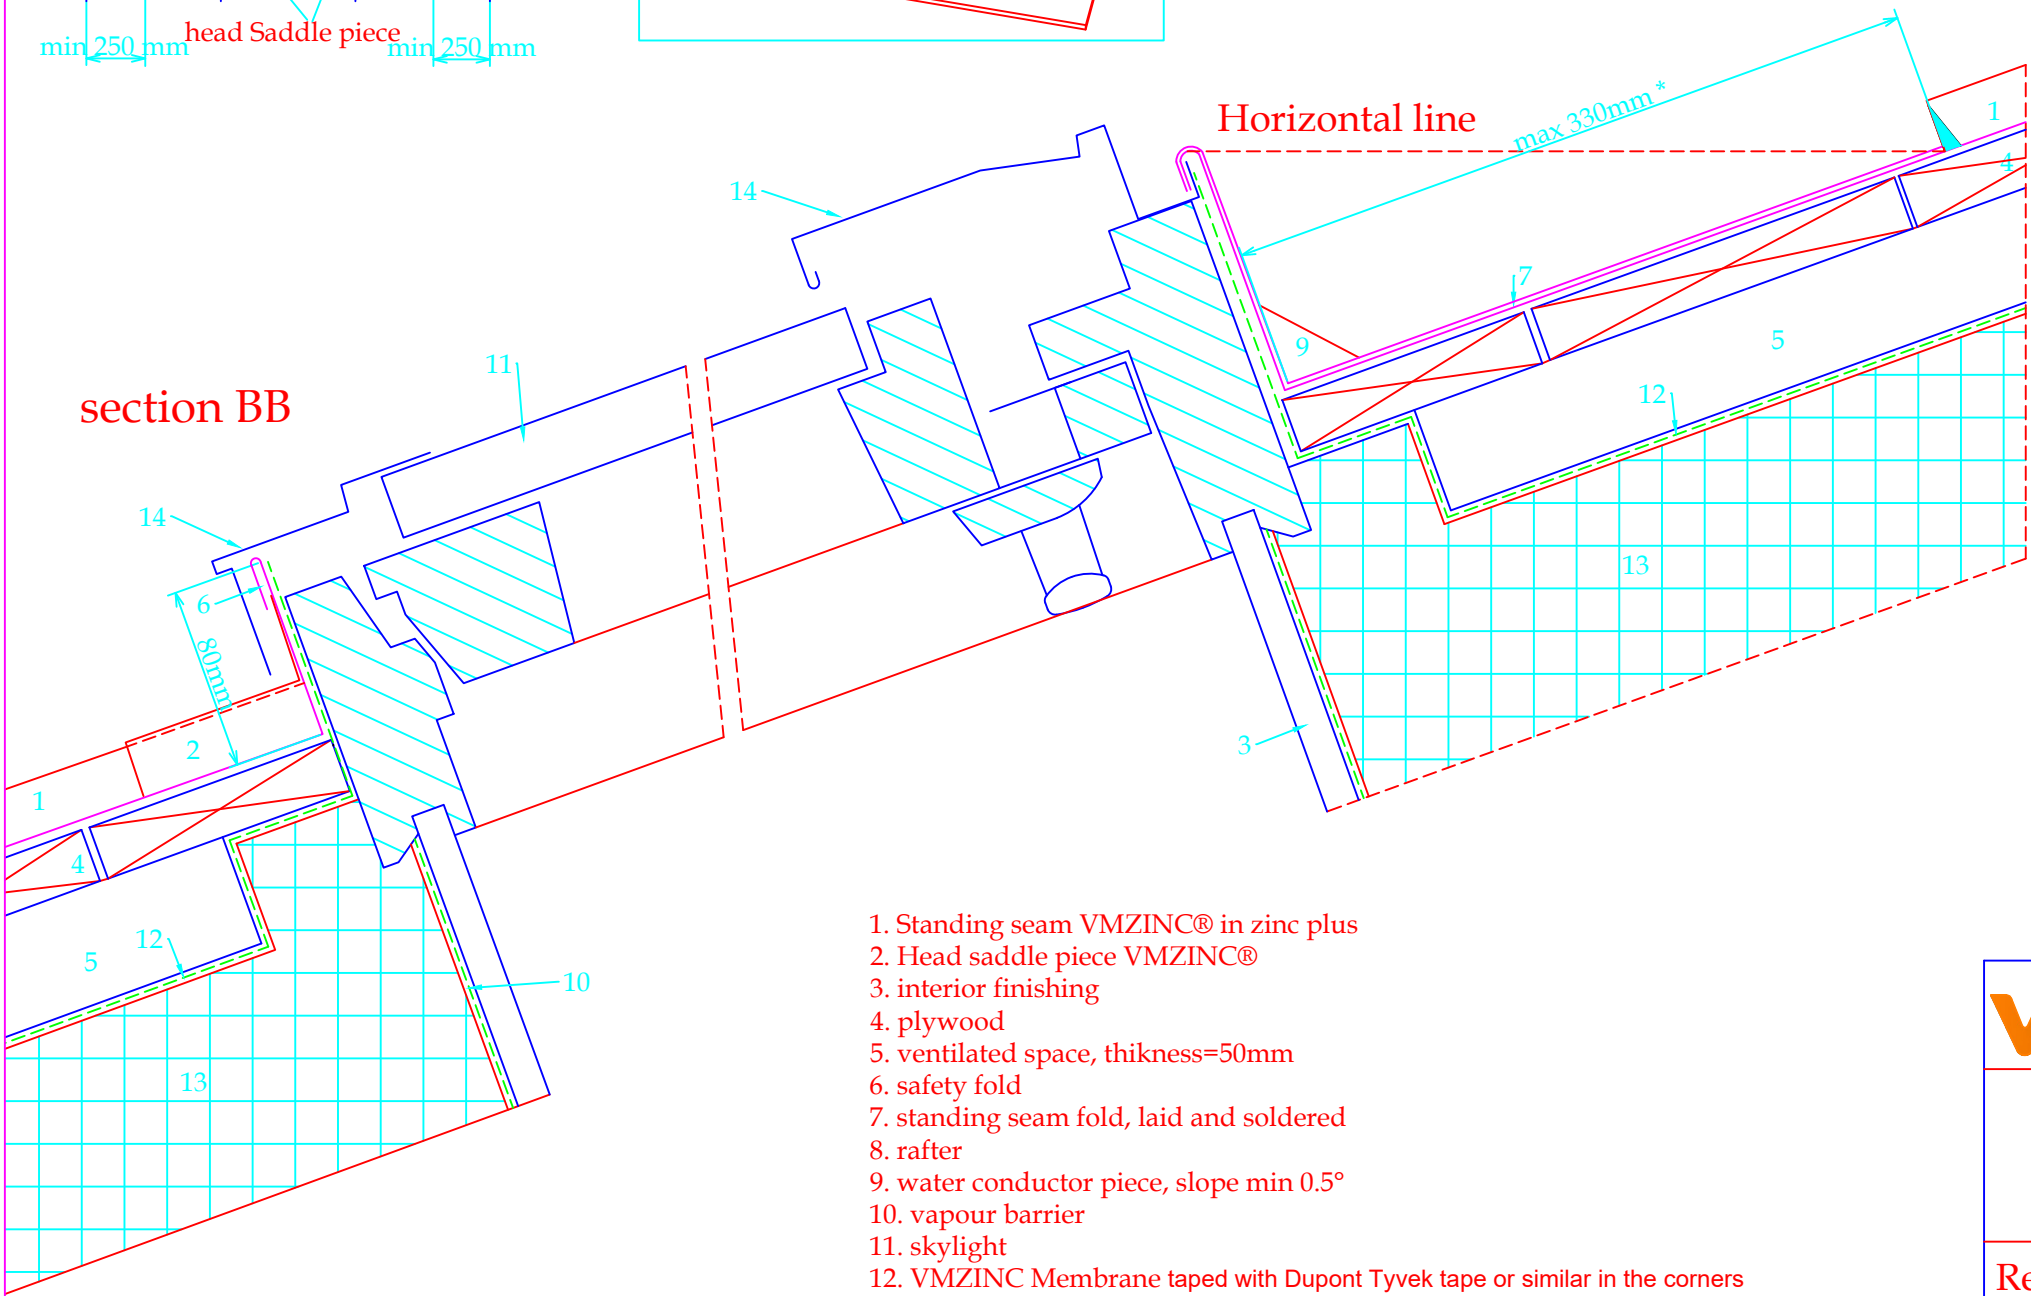

The minimum slope of the skylight depends of the skylight manufacturer's specifications

1. Standing seam VMZINC® in zinc plus
2. Head saddle piece VMZINC®
3. interior finishing
4. plywood
5. ventilated space, thickness=50mm
6. safety fold
7. standing seam fold, laid and soldered
8. rafter
9. water conductor piece, slope min 0.5°
10. vapour barrier
11. skylight
12. VMZINC Membrane taped with Dupont Tyvek tape or similar in the corners
13. insulation
14. skylight flashing

VMZINC

STANDARD DETAIL

Ref : VMZ-SN-MA-RA-b1

Date : 2021

VM Building Solutions UK Collier House, Mead Lane, Hertford, SG13 7AX Tel: 0203.445.5640

VM BUILDING SOLUTIONS