

Project Name: NGET Tottenham

Project No.
5221420

Co-ords: 535368E - 191419N

Hole Type
BH

Location: Watermead Way, Tottenham, London, N17 0SG

Level: 10.57

Scale
1:50

Client: National Grid Property Holdings Limited

Dates: 30/08/2024

Logged By
ZC and JR

Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
		0.03			0.03	10.54		TARMAC.	
		0.25			0.25	10.32		Hardstanding. CONCRETE	
		0.30 - 0.40	ES	PID=0.0				Blackish dark brown cobbly gravelly fine to coarse SAND. Gravel is angular to subangular predominantly fine to coarse of brick and concrete. Cobbles are angular to subangular red and yellow bricks. Occasional glass, ceramic tiles and clinker (MADE GROUND).	1
		0.60 - 0.70	ES	PID=0.0	0.70	9.87		Blackish dark brown gravelly fine to coarse SAND. Gravel is angular to rounded fine to coarse of brick and concrete. Occasional tile and clinker (MADE GROUND).	
		1.10 - 1.20	ES	PID=0.0	1.20	9.37		Very dense compacted light grey clayey angular to subangular COBBLES of concrete and red brick (MADE GROUND).	2
		1.10	PID	PID=0.0	1.50	9.07		Blackish brown gravelly CLAY. Gravel is subangular to subrounded predominantly fine and medium of brick, flint, slate and concrete (MADE GROUND).	
		1.50	PID	PID=0.0	2.20	8.37		<i>black stained organic and plant fragments and hydrocarbon odour</i>	
		2.00 - 2.10	ES	PID=0.7				Soft black speckled light grey CLAY. (ALLUVIUM).	3
		2.00	PID	PID=0.7	3.20	7.37		Dark brown silty CLAY. Frequent plant and shell fragments. (ALLUVIUM).	
		2.50	PID	PID=1.8					
		3.00	PID	PID=2.2					
		3.50	PID	PID=1.9					
		4.00	PID	PID=1.1					
		4.50	PID	PID=2.0	4.30	6.27		Brown organic silty CLAY with frequent plant fragments. (ALLUVIUM).	4
		5.00	PID	PID=2.2	4.70	5.87		Light grey gravelly fine and medium SAND. Gravel is subangular to subrounded fine and medium of flint. (ALLUVIUM).	
		5.50	PID	PID=0.9	4.90	5.67		Light grey CLAY. (ALLUVIUM).	5
		6.00 - 6.10	ES	PID=20.1	5.50	5.07		Slightly sandy GRAVEL. Sand is fine to coarse. Gravel is subangular to subrounded fine to coarse predominantly fine and medium of flint. (KEMPTON PARK GRAVEL MEMBER).	6
		6.00	PID	PID=20.1				<i>no sand</i>	
		6.40 - 7.00	B	PID=4.9				<i>silty clayey fine sand. No gravel</i>	
		6.50	PID	PID=4.9				<i>no sand, gravel only</i>	
		7.00 - 7.10	ES	PID=3.9	7.00	3.57		Firm to stiff light grey CLAY. Occasional mica. (LONDON CLAY).	7
		7.00	PID	PID=3.9					
		7.50	PID	PID=0.8					
		8.00	PID	PID=10.9					
		8.50	PID	PID=4.8					
		9.00	PID	PID=3.7	9.00	1.57		End of Borehole at 9.00m	9
									10

Remarks

Location concrete cored from surface to a depth of 0.2 m bgl using a 300 mm coring barrel. Follow on dynamic percussive/ rotary borehole to a final depth of 9.00 m bgl using a tracked Comacchio 205 drill rig or similar. 50 mm HDPE standpipe installed with response zone between 5.50 m and 7.00 m bgl. Location reinstated with concreted bolted traffic rated flush monitoring cover.

Project Name: NGET Tottenham

Project No.
5221420

Co-ords: 535381E - 191394N

Hole Type
BH

Location: Watermead Way, Tottenham, London, N17 0SG

Level: 10.56

Scale
1:50

Client: National Grid Property Holdings Limited

Dates: 10/09/2024

Logged By
GR

Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
					0.20	10.36		CONCRETE.	
		0.30	PID	PID=2.4				Black ashy sandy GRAVEL. Gravel is angular medium brickwork and stone (MADE GROUND).	
		0.50	PID	PID=1.9					
		0.80 - 1.00	ES					<i>hydrocarbon odour and seepage</i>	1
		0.80	PID	PID=171.9					
		1.20	PID	PID=113.7					
		1.50	PID	PID=132.1	1.50	9.06		Black to dark brown clayey gravelly fine to coarse SAND. Gravel is angular to subangular medium brickwork and stone (MADE GROUND).	2
		2.00	PID	PID=10.8	2.10	8.46		Yellowish brown sandy gravelly CLAY. Sand is fine to coarse. Gravel is subrounded small flint. (ALLUVIUM)	
		2.50	PID	PID=44.4	2.30	8.26		Yellowish brownish CLAY. Strong hydrocarbon odour.	
		3.10	PID	PID=13.2	3.10	7.46		Band of silty GRAVEL. Strong hydrocarbon odour.	3
		3.30	PID	PID=87.4	3.30	7.26		Stiff greyish brown CLAY. Strong hydrocarbon odour. (ALLUVIUM).	
		3.50	PID	PID=62.4					
		4.00	PID	PID=187.6	4.00	6.56		Brown peaty gravelly CLAY. Hydrocarbon odour and staining throughout. (ALLUVIUM).	4
		4.50	PID	PID=206.4					
		4.80	PID	PID=16.3	4.80	5.76		Band of dark brown silty sandy GRAVEL. Sand is fine to coarse. Gravel is angular to subrounded flint. Strong hydrocarbon odour. (KEMPTON PARK GRAVEL MEMBER).	5
		5.00 - 5.50	ES					Dark grey angular to subangular GRAVEL. Strong hydrocarbon odour. (KEMPTON PARK GRAVEL MEMBER).	6
		5.20	PID	PID=7.5	5.20	5.36			
		6.30 - 6.50	ES		6.50	4.06		Dark grey CLAY. (LONDON CLAY).	7
		7.00	PID	PID=0.1					
					7.50	3.06		End of Borehole at 7.50m	8
									9
									10

Remarks

Location concrete cored from surface to a depth of 0.2 m bgl using a 300 mm coring barrel. Follow on dynamic percussive/ rotary borehole to a final depth of 7.50 m bgl using a tracked Comacchio 205 drill rig or similar. 50 mm HDPE standpipe installed with response zone between 5.00 m and 6.50 m bgl. Location reinstated with concreted bolted traffic rated flush monitoring cover.

Appendix B. Site photographs





BH24-09



BH24-09



BH24-09



BH24-09



BH24-09



BH24-09



BH24-14



BH24-14




BH24-14



BH24-14



BH12-01

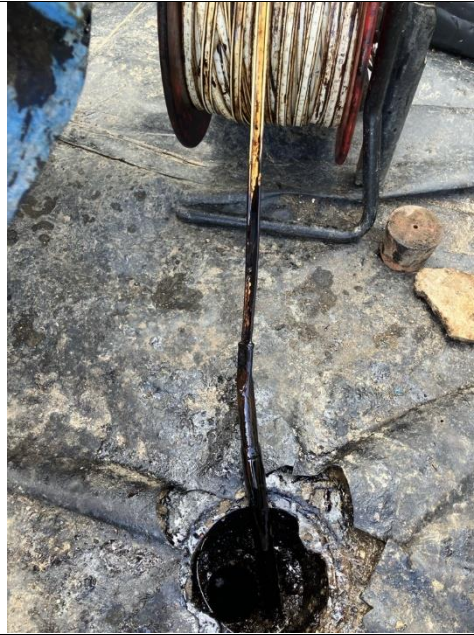

BH12-01



BH12-01



BH12-01

Appendix C. NET recovery and dip data



NET System Settings & Well Gauging Data - BH24-09

Performance Data

[illegible]

Week	Total DNAPL volume (L)	Average DNAPL volume / day
------	------------------------	----------------------------

Wk 1 - (16/2-20/2)	2.00	0.3
Wk 2 - (23/2-27/2)	8.70	1.2
Wk 3 - (2/3-6/3)	18.50	2.6
Wk 4 - (9/3-13/3)		0.0

Week	Total DNAPL volume (L)	Average DNAPL volume / day
Wk 1 - (16/2-20/2)	0.00	0.0
Wk 2 - (23/2-27/2)	0.00	0.0
Wk 3 - (2/3-6/3)	3.8	0.5
Wk 4 - (9/3-13/3)	7.5	1.1

[illegible]

Week	Total DNAPL volume (L)	Average DNAPL volume / day
Wk 1 - (16/2-20/2)	0.00	0.0
Wk 2 - (23/2-27/2)	0.00	0.0
Wk 3 - (2/3-6/3)	1.8	0.3
Wk 4 - (9/3-13/3)	0	0.0

Atkins – Tottenham Former Rus Decont – Daily Borehole Dia Data - BH24-09
BH24-09 installed on 10/09/24
**Measurements taken Type Ground Level*
Note 1 - LNAPL not expected to be present, although it is good practice to measure for it

Date	Time	Borehole ID	Depth to LNAPL* (mgl)	Depth to Water* (mgl)	Depth to DNAPL* (mgl)	Depth to Base* (where drilled) (mgl)	Current Depth to Base or puffy* (mgl)	Sitting Up (m)	Sump Depth (m)	LNAPL Thickness (m)	Effective DNAPL Thickness (where puffy if present)	Total DNAPL Thickness (incl sump) (m)	Notes
18/02/2026	09:27	BH24-09	N/A	2.67	5.72	6.50	6.54	-0.04	N/A	N/A	0.82	0.82	Monitoring (base extraction)
18/02/2026	11:58	BH24-09	N/A	2.67	5.72	6.50	6.54	-0.04	N/A	N/A	0.82	0.82	Post NET extraction (PPF R3) - Gear 10, OTR is top of puffy, stopped at 12.0m
18/02/2026	12:09	BH24-09	N/A	2.67	6.23	6.50	6.54	-0.04	N/A	N/A	0.31	0.31	NET system stopped
18/02/2026	14:17	BH24-09	N/A	2.67	6.00	6.50	6.54	-0.04	N/A	N/A	0.54	0.54	NET removed. Appendix 2 3.1 of liquid extracted (2% of DNAPL and 0.3 l of water)
18/02/2026	15:36	BH24-09	N/A	2.67	5.76	6.50	6.54	-0.04	N/A	N/A	0.58	0.58	Monitoring
18/02/2026	16:30	BH24-09	N/A	2.67	6.01	6.50	6.54	-0.04	N/A	N/A	0.53	0.53	Monitoring
18/02/2026	18:15	BH24-09	N/A	2.71	5.81	6.50	6.54	-0.04	N/A	N/A	0.63	0.63	Monitoring
19/02/2026	09:42	BH24-09	N/A	2.79	5.95	6.50	6.54	-0.04	N/A	N/A	0.59	0.59	Monitoring - may be incorrect, probe/tape were covered
19/02/2026	10:06	BH24-09	N/A	2.81	5.80	6.50	6.54	-0.04	N/A	N/A	0.86	0.86	Monitoring - Daily IP measured when tape staining seen
19/02/2026	14:30	BH24-09	N/A	2.81	5.72	6.50	6.54	-0.04	N/A	N/A	0.82	0.82	Monitoring
20/02/2026	09:05	BH24-09	N/A	2.78	5.73	6.50	6.54	-0.04	N/A	N/A	0.85	0.81	Monitoring
20/02/2026	11:42	BH24-09	N/A	2.78	5.76	6.50	6.54	-0.04	N/A	N/A	0.79	0.79	Monitoring
23/02/2026	11:21	BH24-09	N/A	2.71	5.73	6.50	6.54	-0.04	N/A	N/A	0.81	0.81	Pre-extraction
23/02/2026	11:27	BH24-09	N/A	2.71	5.73	6.50	6.23	N/A	N/A	N/A	0.50	0.81	NET deployed (Gear 10)
23/02/2026	11:38	BH24-09	N/A	2.71	6.23	6.50	6.54	-0.04	N/A	N/A	0.31	0.31	NET system stopped
23/02/2026	12:03	BH24-09	N/A	2.71	6.27	6.50	6.54	-0.04	N/A	N/A	0.27	0.27	NET removed. Appendix 2 2.1 of liquid extracted (2.0 l of DNAPL and 0.2 l of water)
23/02/2026	15:05	BH24-09	N/A	2.79	5.85	6.50	6.54	-0.04	N/A	N/A	0.65	0.65	Monitoring
23/02/2026	16:17	BH24-09	N/A	2.71	5.85	6.50	6.54	-0.04	N/A	N/A	0.69	0.69	Monitoring
24/02/2026	09:15	BH24-09	N/A	2.93	5.78	6.50	6.54	-0.04	N/A	N/A	0.76	0.76	Monitoring
24/02/2026	10:40	BH24-09	N/A	2.93	5.78	6.50	6.54	-0.04	N/A	N/A	0.76	0.76	Monitoring
24/02/2026	11:55	BH24-09	N/A	2.93	5.78	6.50	6.24	N/A	N/A	N/A	0.48	0.76	NET deployed (Gear 10)
24/02/2026	12:06	BH24-09	N/A	2.99	6.23	6.50	6.54	-0.04	N/A	N/A	0.31	0.31	NET system stopped
24/02/2026	14:32	BH24-09	N/A	2.93	5.87	6.50	6.54	-0.04	N/A	N/A	0.57	0.57	NET removed. Appendix 2 3.1 of liquid extracted (2.1 l of DNAPL and 0.2 l of water)
24/02/2026	15:17	BH24-09	N/A	2.93	5.97	6.50	6.54	-0.04	N/A	N/A	0.57	0.57	Monitoring
24/02/2026	16:04	BH24-09	N/A	2.93	5.90	6.50	6.54	-0.04	N/A	N/A	0.64	0.64	Monitoring
25/02/2026	09:30	BH24-09	N/A	2.98	5.83	6.50	6.54	-0.04	N/A	N/A	0.71	0.71	Monitoring
25/02/2026	10:36	BH24-09	N/A	2.97	5.83	6.50	6.23	N/A	N/A	N/A	0.40	0.71	NET deployed (Gear 10). Measured puffy (27 cm deep)
25/02/2026	10:46	BH24-09	N/A	2.97	6.23	6.50	6.54	-0.04	N/A	N/A	0.31	0.31	NET system stopped
25/02/2026	10:47	BH24-09	N/A	2.97	6.54	6.50	6.54	-0.04	N/A	N/A	0.00	0.00	NET removed. Appendix 2 3.1 of liquid extracted (1.6 l of DNAPL and 0.7 l of water)
25/02/2026	11:00	BH24-09	N/A	2.97	6.54	6.50	6.54	-0.04	N/A	N/A	0.00	0.00	Monitoring - DNAPL present at base but no measurable reading on IP
25/02/2026	11:12	BH24-09	N/A	2.97	6.23	6.50	6.54	-0.04	N/A	N/A	0.27	0.27	Monitoring - DNAPL present at base but no measurable reading on IP
25/02/2026	12:00	BH24-09	N/A	2.97	6.14	6.50	6.54	-0.04	N/A	N/A	0.40	0.40	Monitoring - tape approximately 37 cm covered
25/02/2026	13:55	BH24-09	N/A	2.97	5.91	6.50	6.54	-0.04	N/A	N/A	0.63	0.63	Monitoring. PPF measurement (DOC was 0.000)
25/02/2026	14:54	BH24-09	N/A	2.97	5.86	6.50	6.54	-0.04	N/A	N/A	0.68	0.68	Pre-extraction monitoring
25/02/2026	14:58	BH24-09	N/A	2.97	5.86	6.50	6.23	N/A	N/A	N/A	0.37	0.68	NET system deployed - Gear 10
25/02/2026	15:08	BH24-09	N/A	2.97	5.87	6.50	6.54	-0.04	N/A	N/A	0.67	0.67	Monitoring
25/02/2026	15:14	BH24-09	N/A	2.97	6.29	6.50	6.54	-0.04	N/A	N/A	0.25	0.25	NET removed. Approximately 2.0 l of liquid extracted (1.3 l DNAPL and 0.7 l of water)
25/02/2026	15:40	BH24-09	N/A	2.97	6.27	6.50	6.54	-0.04	N/A	N/A	0.27	0.27	Monitoring
25/02/2026	16:05	BH24-09	N/A	2.97	6.25	6.50	6.54	-0.04	N/A	N/A	0.29	0.29	Monitoring
26/02/2026	09:15	BH24-09	N/A	2.99	5.87	6.50	6.54	-0.04	N/A	N/A	0.71	0.71	Monitoring - around 84 cm on tape
27/02/2026	09:10	BH24-09	N/A	2.99	5.81	6.50	6.54	-0.04	N/A	N/A	0.73	0.73	Monitoring - around 77 cm on tape
27/02/2026	10:56	BH24-09	N/A	2.99	5.81	6.50	6.24	N/A	N/A	N/A	0.73	0.73	NET fabric adjusted specifically for BH24-09 well conditions. NET run at gear 10 for 10 minutes until deployed
27/02/2026	11:06	BH24-09	N/A	2.99	6.29	6.50	6.54	-0.04	N/A	N/A	0.25	0.25	NET removed. Approximately 2 l of liquid extracted (1.7 l of DNAPL and 0.3 l of water)
02/03/2026	10:40	BH24-09	N/A	2.99	5.69	6.50	6.54	-0.04	N/A	N/A	0.85	0.85	Pre-extraction monitoring
02/03/2026	10:59	BH24-09	N/A	2.99	5.69	6.50	6.24	N/A	N/A	N/A	0.55	0.85	NET deployed. Gear 6 to ascertain recharge potential vs extraction. Run for 17 minutes until fabric deployed
02/03/2026	11:16	BH24-09	N/A	2.99	6.23	6.50	6.54	-0.04	N/A	N/A	0.31	0.31	NET system stopped
02/03/2026	11:19	BH24-09	N/A	2.99	6.47	6.50	6.54	-0.04	N/A	N/A	0.07	0.07	NET removed. Appendix 2 3.1 of liquid removed. Water and DNAPL did not separate - were very mixed. Estimated 1.8 l of DNAPL and 1.3 l of water. Monitoring
02/03/2026	11:31	BH24-09	N/A	2.99	6.34	6.50	6.54	-0.04	N/A	N/A	0.20	0.20	Monitoring
02/03/2026	11:46	BH24-09	N/A	2.99	6.26	6.50	6.54	-0.04	N/A	N/A	0.26	0.26	Monitoring
02/03/2026	12:00	BH24-09	N/A	2.99	6.20	6.50	6.54	-0.04	N/A	N/A	0.34	0.34	Monitoring
02/03/2026	12:11	BH24-09	N/A	2.99	6.16	6.50	6.54	-0.04	N/A	N/A	0.38	0.38	Monitoring
02/03/2026	12:55	BH24-09	N/A	2.99	5.93	6.50	6.54	-0.04	N/A	N/A	0.63	0.63	Monitoring
02/03/2026	14:10	BH24-09	N/A	2.99	5.90	6.50	6.54	-0.04	N/A	N/A	0.64	0.64	Monitoring
02/03/2026	14:25	BH24-09	N/A	2.99	5.87	6.50	6.54	-0.04	N/A	N/A	0.67	0.67	Monitoring
02/03/2026	14:42	BH24-09	N/A	2.99	5.87	6.50	6.24	N/A	N/A	N/A	0.37	0.67	NET system start. Gear 6.
02/03/2026	14:56	BH24-09	N/A	2.99	6.23	6.50	6.54	-0.04	N/A	N/A	0.31	0.31	NET system stopped
02/03/2026	15:00	BH24-09	N/A	2.99	6.24	6.50	6.54	-0.04	N/A	N/A	0.30	0.30	NET removed. Approximately 2 l of liquid extracted. Water and DNAPL did not separate - were very mixed. Estimated 1.8 l of DNAPL and 0.2 l of water. Monitoring - no DNAPL detected by P. Tape was somewhat patchy but probe was relatively clean
03/03/2026	15:15	BH24-09	N/A	2.99	6.29	6.50	6.54	-0.04	N/A	N/A	0.25	0.25	Monitoring
03/03/2026	15:30	BH24-09	N/A	2.99	6.24	6.50	6.54	-0.04	N/A	N/A	0.30	0.30	Monitoring
03/03/2026	15:45	BH24-09	N/A	2.99	6.17	6.50	6.54	-0.04	N/A	N/A	0.37	0.37	Monitoring
03/03/2026	16:00	BH24-09	N/A	2.99	6.11	6.50	6.54	-0.04	N/A	N/A	0.39	0.39	Monitoring
03/03/2026	16:30	BH24-09	N/A	2.99	6.03	6.50	6.54	-0.04	N/A	N/A	0.53	0.53	Monitoring
03/03/2026	16:30	BH24-09	N/A	3.05	5.72	6.50	6.54	-0.04	N/A	N/A	0.82	0.82	Pre-extraction dip - last approximately 84 cm of tape covered
03/03/2026	16:30	BH24-09	N/A	3.05	5.72	6.50	6.24	N/A	N/A	N/A	0.37	0.82	NET system start. Gear 10. Nine minutes of extraction
03/03/2026	16:39	BH24-09	N/A	3.05	6.38	6.50	6.54	-0.04	N/A	N/A	0.16	0.16	NET system stopped. Approximately 2.5 l of liquid with 2 l of DNAPL and 0.5 l of water
03/03/2026	16:43	BH24-09	N/A	3.05	6.38	6.50	6.54	-0.04	N/A	N/A	0.16	0.16	Monitoring - tape was relatively clean
03/03/2026	16:58	BH24-09	N/A	3.05	6.32	6.50	6.54	-0.04	N/A	N/A	0.22	0.22	Monitoring - tape was relatively clean
03/03/2026	17:13	BH24-09	N/A	3.05	6.24	6.50	6.54	-0.04	N/A	N/A	0.30	0.30	Monitoring - approximately 30 cm tape covered
03/03/2026	17:43	BH24-09	N/A	3.05	6.17	6.50	6.54	-0.04	N/A	N/A	0.37	0.37	Monitoring - approximately 38 cm tape covered
03/03/2026	18:16	BH24-09	N/A	3.05	5.94	6.50	6.54	-0.04	N/A	N/A	0.60	0.60	Monitoring
03/03/2026	18:21	BH24-09	N/A	3.05	5.94	6.50	6.24	N/A	N/A	N/A	0.30	0.60	NET system start. Gear 10
03/03/2026	18:26	BH24-09	N/A	3.05	6.54	6.50	6.54	-0.04	N/A	N/A	0.00	0.00	NET system stopped. Approximately 1.3 l of liquid removed - approximately 1 l DNAPL and 0.3 l of water removed
03/03/2026	18:30	BH24-09	N/A	3.05	6.54	6.50	6.54	-0.04	N/A	N/A	0.00	0.00	Monitoring - no DNAPL detected by IP
03/03/2026	18:45	BH24-09	N/A	3.05	6.32	6.50	6.54	-0.04	N/A	N/A	0.22	0.22	Monitoring
03/03/2026	19:00	BH24-09	N/A	3.05	6.27	6.50	6.54	-0.04	N/A	N/A	0.27	0.27	Monitoring
03/03/2026	19:15	BH24-09	N/A	3.05	6.18	6.50	6.54	-0.04	N/A	N/A	0.35	0.35	Monitoring
03/03/2026	19:30	BH24-09	N/A	3.05	6.12	6.50	6.54	-0.04	N/A	N/A	0.42	0.42	Monitoring
03/03/2026	19:42	BH24-09	N/A	3.05	6.08	6.50	6.54	-0.04	N/A	N/A	0.46	0.46	Pre-extraction dip
03/03/2026	19:46	BH24-09	N/A	3.05	6.08	6.50	6.24	N/A	N/A	N/A	0.29	0.46	NET system start. Gear 10
03/03/2026	19:52	BH24-09	N/A	3.05	6.54	6.50	6.54	-0.04	N/A	N/A	0.00	0.00	NET system stopped. Approximately 1.3 l of liquid removed - approximately 0.9 l of DNAPL and 0.4 l of water removed
03/03/2026	19:55	BH24-09	N/A	3.05	6.54	6.50	6.54	-0.04	N/A	N/A	0.00	0.00	Monitoring
03/03/2026	19:59	BH24-09	N/A	3.05	6.39	6.50	6.54	-0.04	N/A	N/A	0.33	0.33	Monitoring
04/03/2026	08:19	BH24-09	N/A	3.07	5.79	6.50	6.54	-0.04	N/A	N/A	0.75	0.75	Pre-extraction dip
04/03/2026	09:17	BH24-09	N/A	3.07	5.79	6.50	6.24	N/A	N/A	N/A	0.25	0.75	NET system start. Gear 2
04/03/2026	15:46	BH24-09	N/A	3.07	N/A	6.50	6.24	0.26	N/A	N/A	IVALUE1	IVALUE1	PP attempted with fabric inside well. Diameter of well is too small for both tape and fabric. No reading to puffy. Tape covered with DNAPL from fabric
04/03/2026	15:56	BH24-09	N/A	3.07	N/A	6.50	6.24	0.26	N/A	N/A	IVALUE1	IVALUE1	NET system shifted to Gear 10 (in order to clean fabric and finish extraction)
04/03/2026	15:59	BH24-09	N/A	3.07	6.54	6.50	6.54	-0.04	N/A	N/A	0.00	0.00	Approximately 3.6 l of liquid. Approximately 3.6 l of DNAPL and 0.2 l of water
04/03/2026	16:01	BH24-09	N/A	3.07	6.54	6.50	6.54	-0.04	N/A	N/A	0.00	0.00	NET system stopped. In total, approximately 5 l of liquid, 4.8 l DNAPL and 0.2 l water
04/03/2026	16:20	BH24-09	N/A	3.07	6.54	6.5							

Atkins – Tottenham Former Bus Depot – Daily Borehole Dip Data - BH24-14

BH24-14 installed on 30/08/24

*Measurements taken from Ground Level

Note 1 - LNAPL not expected to be present, although it is good practice to measure for it

Date	Time	Borehole ID	Depth to LNAPL* (mbgl)	Depth to Water* (mbgl)	Depth to DNAPL* (mbgl)	Depth to Base* (when drilled) (mbgl)	Current Depth to Base or pulley* (mbgl)	Silting Up (m)	Sump Depth (m)	LNAPL Thickness (m)	Effective DNAPL Thickness (above pulley if present)	Total DNAPL Thickness (incl sump) (m)	Notes
17/02/2026	11:30	BH24-14	N/A	2.67	6.10	7.00	6.92	0.08	N/A	N/A	0.82	0.82	Monitoring pre-extraction
17/02/2026	14:30	BH24-14	N/A	2.67	6.10	7.00	6.60	N/A	N/A	N/A	0.50	0.82	First NET extraction (RPT R1) Gear 10. DTB is top of pulley.
17/02/2026	14:46	BH24-14	N/A	2.67	6.60	7.00	6.92	0.08	N/A	N/A	0.32	0.32	NET system stopped.
17/02/2026	15:01	BH24-14	N/A	2.67	6.69	7.00	6.92	0.08	N/A	N/A	0.23	0.23	NET removed. Approx 2.5L of liquid extracted (2.0 L of DNAPL and 0.5 L of water). Monitoring.
17/02/2026	15:15	BH24-14	N/A	2.67	6.65	7.00	6.92	0.08	N/A	N/A	0.27	0.27	Monitoring
17/02/2026	15:40	BH24-14	N/A	2.67	6.62	7.00	6.92	0.08	N/A	N/A	0.30	0.30	Monitoring
17/02/2026	16:15	BH24-14	N/A	2.67	6.57	7.00	6.92	0.08	N/A	N/A	0.35	0.35	Monitoring
18/02/2026	09:27	BH24-14	N/A	2.71	7.00	7.00	6.92	0.08	N/A	N/A	0.52	0.52	Monitoring
18/02/2026	12:45	BH24-14	N/A	2.71	6.38	7.00	6.92	0.08	N/A	N/A	0.54	0.54	Monitoring
18/02/2026	14:35	BH24-14	N/A	2.71	6.38	7.00	6.92	0.08	N/A	N/A	0.54	0.54	Monitoring
18/02/2026	14:50	BH24-14	N/A	2.71	6.38	7.00	6.60	N/A	N/A	N/A	0.22	0.54	Second NET extraction. Gear 10 for 8 minutes.
18/02/2026	14:58	BH24-14	N/A	2.71	6.60	7.00	6.92	0.08	N/A	N/A	0.32	0.32	NET system stopped.
18/02/2026	15:11	BH24-14	N/A	2.71	6.70	7.00	6.92	0.08	N/A	N/A	0.22	0.22	NET removed. Approx 1.3L of liquid extracted (1.0L of DNAPL and 0.3L of water). Monitoring.
18/02/2026	16:10	BH24-14	N/A	2.67	6.70	7.00	6.92	0.08	N/A	N/A	0.22	0.22	Monitoring
19/02/2026	09:25	BH24-14	N/A	2.82	6.54	7.00	6.92	0.08	N/A	N/A	0.38	0.38	Monitoring
19/02/2026	14:26	BH24-14	N/A	2.82	6.47	7.00	6.92	0.08	N/A	N/A	0.45	0.45	Monitoring
20/02/2026	09:21	BH24-14	N/A	2.89	6.44	7.00	6.92	0.08	N/A	N/A	0.48	0.48	Monitoring
20/02/2026	14:26	BH24-14	N/A	2.89	6.43	7.00	6.92	0.08	N/A	N/A	0.49	0.49	Monitoring
23/02/2026	10:10	BH24-14	N/A	2.92	6.31	7.00	6.92	0.08	N/A	N/A	0.61	0.61	Monitoring pre-extraction
23/02/2026	10:28	BH24-14	N/A	2.92	6.31	7.00	6.60	N/A	N/A	N/A	0.29	0.61	NET system start at Gear 10.
23/02/2026	10:35	BH24-14	N/A	2.92	6.60	7.00	6.92	0.08	N/A	N/A	0.32	0.32	NET system stopped.
23/02/2026	10:48	BH24-14	N/A	2.92	6.92	7.00	6.92	0.08	N/A	N/A	0.00	0.00	NET removed. Approx 1.5 L of liquid removed (1.4 L of DNAPL and 0.1 L of water); did not separate well. Monitoring. No measurable DNAPL.
23/02/2026	14:52	BH24-14	N/A	2.92	6.67	7.00	6.92	0.08	N/A	N/A	0.25	0.25	Monitoring - although 0.25 m of DNAPL according to interface probe, 0.35 measured on tape.
23/02/2026	16:22	BH24-14	N/A	2.92	6.73	7.00	6.92	0.08	N/A	N/A	0.19	0.19	Monitoring
24/02/2026	09:10	BH24-14	N/A	2.96	6.54	7.00	6.92	0.08	N/A	N/A	0.38	0.38	Monitoring.
24/02/2026	10:58	BH24-14	N/A	2.94	6.53	7.00	6.92	0.08	N/A	N/A	0.39	0.39	Monitoring.
24/02/2026	14:30	BH24-14	N/A	2.93	6.49	7.00	6.92	0.08	N/A	N/A	0.43	0.43	Monitoring.
24/02/2026	16:06	BH24-14	N/A	2.93	6.58	7.00	6.92	0.08	N/A	N/A	0.34	0.34	Monitoring.
25/02/2026	09:25	BH24-14	N/A	2.97	6.58	7.00	6.92	0.08	N/A	N/A	0.34	0.34	Monitoring.
25/02/2026	12:05	BH24-14	N/A	2.97	6.55	7.00	6.92	0.08	N/A	N/A	0.37	0.37	Monitoring.
25/02/2026	16:00	BH24-14	N/A	2.97	6.52	7.00	6.92	0.08	N/A	N/A	0.40	0.40	Monitoring.
26/02/2026	09:58	BH24-14	N/A	3.00	6.44	7.00	6.92	0.08	N/A	N/A	0.48	0.48	Pre-extraction dip - approximately last 55 cm of tape was covered
26/02/2026	10:25	BH24-14	N/A	3.00	6.44	7.00	6.60	N/A	N/A	N/A	0.16	0.48	NET start at Gear 6 to try assess extraction vs recharge.
26/02/2026	10:45	BH24-14	N/A	3.00	6.92	7.00	6.92	0.08	N/A	N/A	0.00	0.00	NET removed. Approximately 1.9 L of liquid extracted (1 L of water and 0.9L of DNAPL).
26/02/2026	10:50	BH24-14	N/A	3.00	6.92	7.00	6.92	0.08	N/A	N/A	0.00	0.00	Monitoring.
26/02/2026	11:15	BH24-14	N/A	3.00	6.78	7.00	6.92	0.08	N/A	N/A	0.14	0.14	Monitoring.
26/02/2026	11:30	BH24-14	N/A	3.00	6.74	7.00	6.92	0.08	N/A	N/A	0.18	0.18	Monitoring.
26/02/2026	11:45	BH24-14	N/A	3.00	6.74	7.00	6.92	0.08	N/A	N/A	0.18	0.18	Monitoring.
26/02/2026	13:48	BH24-14	N/A	3.00	6.70	7.00	6.92	0.08	N/A	N/A	0.22	0.22	Monitoring.
26/02/2026	14:15	BH24-14	N/A	3.00	6.69	7.00	6.92	0.08	N/A	N/A	0.23	0.23	Monitoring.
26/02/2026	14:45	BH24-14	N/A	3.00	6.68	7.00	6.92	0.08	N/A	N/A	0.24	0.24	Monitoring.
26/02/2026	15:15	BH24-14	N/A	3.00	6.66	7.00	6.92	0.08	N/A	N/A	0.26	0.26	Monitoring.
26/02/2026	15:40	BH24-14	N/A	3.00	6.66	7.00	6.92	0.08	N/A	N/A	0.26	0.26	Monitoring.
27/02/2026	09:07	BH24-14	N/A	3.01	6.57	7.00	6.92	0.08	N/A	N/A	0.35	0.35	Monitoring.
02/03/2026	11:23	BH24-14	N/A	3.02	6.39	7.00	6.92	0.08	N/A	N/A	0.53	0.53	Monitoring.
02/03/2026	16:35	BH24-14	N/A	3.02	6.49	7.00	6.92	0.08	N/A	N/A	0.43	0.43	Monitoring.
03/03/2026	12:21	BH24-14	N/A	3.06	6.37	7.00	6.92	0.08	N/A	N/A	0.55	0.55	Monitoring.
03/03/2026	15:20	BH24-14	N/A	3.06	6.36	7.00	6.92	0.08	N/A	N/A	0.56	0.56	Monitoring.
04/03/2026	09:43	BH24-14	N/A	3.09	6.43	7.00	6.92	0.08	N/A	N/A	0.49	0.49	Monitoring - around 41 cm covered
04/03/2026	16:06	BH24-14	N/A	3.09	6.38	7.00	6.92	0.08	N/A	N/A	0.54	0.54	Monitoring.

Atkins – Tottenham Former Bus Depot – Daily Borehole Dip Data - **BH11**

BH11 installed on 10/04/13

*Measurements taken from Ground Level

Note 1 - LNAPL not expected to be present, although it is good practice to measure for it

Date	Time	Borehole ID	Depth to LNAPL* (mbgl)	Depth to Water* (mbgl)	Depth to DNAPL* (mbgl)	Depth to Base* (when drilled) (mbgl)	Current Depth to Base or pulley* (mbgl)	Silting Up (m)	Sump Depth (m)	LNAPL Thickness (m)	Effective DNAPL Thickness (above pulley if present)	Total DNAPL Thickness (incl sump) (m)	Notes
19/02/2026	14:50	BH11	N/A	2.41	6.10	6.50	6.60	-0.10	N/A	N/A	0.50	0.50	Monitoring
04/03/2026	09:47	BH11	N/A	2.93	5.99	6.50	6.60	-0.10	N/A	N/A	0.61	0.61	Monitoring - last 55 cm tape covered.
05/03/2026	09:10	BH11	N/A	2.97	5.92	6.50	6.57	-0.07	N/A	N/A	0.65	0.65	Monitoring - 76 cm of tape patchy.
05/03/2026	09:30	BH11	N/A	2.97	5.92	6.50	6.24	N/A	N/A	N/A	0.32	0.65	NET system start. Gear 10.
05/03/2026	09:36	BH11	N/A	2.97	6.24	6.50	6.57	-0.07	N/A	N/A	0.33	0.33	NET system stopped. Approximately 2.1 L of liquid removed - 1.8 L DNAPL and 0.3 L of water.
05/03/2026	09:43	BH11	N/A	2.97	6.57	6.50	6.57	-0.07	N/A	N/A	0.00	0.00	Monitoring - no IP reading.
05/03/2026	10:04	BH11	N/A	2.97	6.33	6.50	6.57	-0.07	N/A	N/A	0.24	0.24	Monitoring.
05/03/2026	10:20	BH11	N/A	2.97	6.32	6.50	6.57	-0.07	N/A	N/A	0.25	0.25	Monitoring.
05/03/2026	10:33	BH11	N/A	2.97	6.26	6.50	6.57	-0.07	N/A	N/A	0.31	0.31	Monitoring.
05/03/2026	10:47	BH11	N/A	2.97	6.24	6.50	6.57	-0.07	N/A	N/A	0.33	0.33	Monitoring.
05/03/2026	11:06	BH11	N/A	2.97	6.23	6.50	6.57	-0.07	N/A	N/A	0.34	0.34	Monitoring.
05/03/2026	11:33	BH11	N/A	2.97	6.18	6.50	6.57	-0.07	N/A	N/A	0.39	0.39	Monitoring.
05/03/2026	12:08	BH11	N/A	2.97	6.17	6.50	6.57	-0.07	N/A	N/A	0.40	0.40	Monitoring.
05/03/2026	12:36	BH11	N/A	2.97	6.15	6.50	6.57	-0.07	N/A	N/A	0.42	0.42	Monitoring.
05/03/2026	14:30	BH11	N/A	2.97	6.09	6.50	6.57	-0.07	N/A	N/A	0.48	0.48	Monitoring.
05/03/2026	15:30	BH11	N/A	2.97	6.10	6.50	6.57	-0.07	N/A	N/A	0.47	0.47	Monitoring.

Atkins – Tottenham Former Bus Depot – Daily Borehole Dip Data - **BH12-01**

BH12-01 installed on 09/01/2013

*Measurements taken from Ground Level

Note 1 - LNAPL not expected to be present, although it is good practice to measure for it

Date	Time	Borehole ID	Depth to LNAPL* (mbgl)	Depth to Water* (mbgl)	Depth to DNAPL* (mbgl)	Depth to Base* (when drilled) (mbgl)	Current Depth to Base or pulley* (mbgl)	Silting Up (m)	Sump Depth (m)	LNAPL Thickness (m)	Effective DNAPL Thickness (above pulley if present)	Total DNAPL Thickness (incl sump) (m)	Notes
18/02/2026	16:16	BH12-01	N/A	2.32	5.38	6.50	6.21	0.29	N/A	N/A	0.83	0.83	Broken lid
05/03/2026	15:10	BH12-01	N/A	1.92	4.94	6.50	6.15	0.35	N/A	N/A	1.21	1.21	DNAPL thick - slow sinking of probe
06/03/2026	11:45	BH12-01	N/A	1.95	4.94	6.50	6.15	0.35	N/A	N/A	1.21	1.21	Pre-extraction dip
06/03/2026	11:53	BH12-01	N/A	1.95	4.94	6.50	5.70	N/A	N/A	N/A	0.76	1.21	NET system start (Gear 10). 5.70 was dip to the top of pulley.
06/03/2026	12:07	BH12-01	N/A	1.95	5.70	6.50	6.15	0.35	N/A	N/A	0.45	0.35	NET system stopped after 14 mins. Approximately 3.8 L of liquid extracted. Water and DNAPL did not separate seemed to be pure DNAPL.
09/03/2026	11:15	BH12-01	N/A	2.10	5.39	6.50	6.15	0.35	N/A	N/A	0.76	0.76	Pre-extraction dip
09/03/2026	11:37	BH12-01	N/A	N/A	N/A	6.50	5.70	N/A	N/A	N/A	0.31	0.76	NET system start (Gear 10).
09/03/2026	11:53	BH12-01	N/A	N/A	5.70	6.50	6.15	0.35	N/A	N/A	0.45	0.45	NET system stopped. Approximately 3.3 L of liquid extracted - 2.1 L DNAPL and 1.2 L water.
09/03/2026	12:15	BH12-01	N/A	3.10	3.57	6.50	6.15	0.35	N/A	N/A	2.58	2.58	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
09/03/2026	12:23	BH12-01	N/A	N/A	5.19	6.50	6.15	0.35	N/A	N/A	0.96	0.96	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
09/03/2026	15:00	BH12-01	N/A	2.47	5.45	6.50	6.15	0.35	N/A	N/A	0.70	0.70	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
09/03/2026	15:12	BH12-01	N/A	N/A	5.45	6.50	5.70	N/A	N/A	N/A	0.25	0.70	NET system start (Gear 10).
09/03/2026	15:22	BH12-01	N/A	N/A	N/A	6.50	6.15	0.35	N/A	N/A	0.45	0.45	NET system stopped. 1.4L of liquid extracted - did not separate.
09/03/2026	15:38	BH12-01	N/A	N/A	5.38	6.50	6.15	0.35	N/A	N/A	0.77	0.77	Monitoring.
09/03/2026	16:25	BH12-01	N/A	N/A	3.64	6.50	6.15	0.35	N/A	N/A	2.51	2.51	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
10/03/2026	09:55	BH12-01	N/A	2.37	4.19	6.50	5.72	N/A	N/A	N/A	1.53	1.53	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
10/03/2026	13:11	BH12-01	N/A	2.29	4.31	6.50	6.15	0.35	N/A	N/A	1.84	1.84	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
10/03/2026	13:22	BH12-01	N/A	N/A	5.59	6.50	6.15	0.35	N/A	N/A	0.56	0.56	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
10/03/2026	13:40	BH12-01	N/A	N/A	5.59	6.50	5.70	N/A	N/A	N/A	0.11	0.56	NET system start (Gear 10).
10/03/2026	13:54	BH12-01	N/A	N/A	5.70	6.50	6.15	0.35	N/A	N/A	0.45	0.45	NET system stopped. Approximately 2.5 L of liquid - 1.3 L DNAPL.
10/03/2026	13:59	BH12-01	N/A	N/A	5.84	6.50	6.15	0.35	N/A	N/A	0.31	0.31	Monitoring.
10/03/2026	15:38	BH12-01	N/A	2.56	5.80	6.50	6.15	0.35	N/A	N/A	0.35	0.35	Monitoring.
10/03/2026	15:45	BH12-01	N/A	N/A	5.80	6.50	6.15	0.35	N/A	N/A	0.35	0.35	Monitoring.
11/03/2026	10:32	BH12-01	N/A	2.27	4.27	6.50	6.15	0.35	N/A	N/A	1.88	1.88	Pre-extraction dip. Obstruction was present at 5.75 m.
11/03/2026	10:48	BH12-01	N/A	N/A	4.27	6.50	5.70	N/A	N/A	N/A	1.43	1.88	NET system start (Gear 4) for 35 minutes. NET system moved to Gear 10 for 2 minutes. 2.1 L of liquid. Approximately 1 L of DNAPL and 1.1 L of water
11/03/2026	11:25	BH12-01	N/A	N/A	5.70	6.50	6.15	0.35	N/A	N/A	0.45	0.45	NET system stopped.
11/03/2026	11:32	BH12-01	N/A	3.10	5.42	6.50	6.15	0.35	N/A	N/A	0.73	0.73	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
11/03/2026	14:15	BH12-01	N/A	2.52	4.87	6.50	6.15	0.35	N/A	N/A	1.28	1.28	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
11/03/2026	14:47	BH12-01	N/A	2.51	4.69	6.50	6.15	0.35	N/A	N/A	1.46	1.46	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
11/03/2026	15:28	BH12-01	N/A	2.46	5.65	6.50	6.15	0.35	N/A	N/A	0.50	0.50	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
11/03/2026	16:00	BH12-01	N/A	2.44	5.65	6.50	6.15	0.35	N/A	N/A	0.50	0.50	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
12/03/2026	09:02	BH12-01	N/A	2.31	5.75	6.50	6.15	0.35	N/A	N/A	0.40	0.40	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
12/03/2026	09:31	BH12-01	N/A	N/A	5.75	6.50	5.70	N/A	N/A	N/A	-0.05	0.40	NET system start (Gear 10).
12/03/2026	09:55	BH12-01	N/A	N/A	5.70	6.50	6.15	0.35	N/A	N/A	0.45	0.45	NET system stopped. 3.7 L of liquid extracted - 1 L DNAPL and 2.7 L water.
12/03/2026	10:02	BH12-01	N/A	N/A	5.70	6.50	6.15	0.35	N/A	N/A	0.45	0.45	No reliable reading. Tape relatively clean - last 30 cm were patchy.
12/03/2026	11:02	BH12-01	N/A	3.06	4.62	6.50	6.15	0.35	N/A	N/A	1.53	1.53	Monitoring. Unable to obtain reliable dip due to NAPL patches in water column.
12/03/2026	14:30	BH12-01	N/A	2.41	5.75	6.50	6.15	0.35	N/A	N/A	0.40	0.40	Monitoring - last 40 cm of tape was covered
12/03/2026	15:00	BH12-01	N/A	2.40	5.73	6.50	6.15	0.35	N/A	N/A	0.42	0.42	Monitoring - last 40 cm of tape was covered
12/03/2026	15:30	BH12-01	N/A	2.39	5.67	6.50	6.15	0.35	N/A	N/A	0.48	0.48	Monitoring - last 40 cm of tape was covered

Appendix D. Laboratory results





SGS United Kingdom Ltd
Ellesmere Port
CH65 3EN
United Kingdom
Tel: 0151 3506669

Make:		Sample No:		8124538	
Model:		Location:		ELEMENT ENVIRONMENTAL LABS DEESIDE	
Serial No:		26/3819-3		Client: ELEMENT ENVIRONMENTAL LABS DEESIDE	
System:		OTHER		Kit Ref/Bottle No:	
Brand:		NOT GIVEN		Job No.: GB05113771PO	
Grade:				Sampled:	
Unique No.:		6769392		Received: 16/03/26	
Diagnosis		Key:	Normal	Caution	Serious
Diagnostician: Sean George					

Unable to perform viscosity test as sample is non-homogeneous.

Results	Current Sample	Historical Samples
Sample No	8124538	
Status		
Sampled		
Fluid Age		
Unit Age		
Received	16/03/26	
Fluid Condition		
Appearance	- LM-12	N/A



SGS United Kingdom Ltd
Ellesmere Port
CH65 3EN
United Kingdom
Tel: 0151 3506669

Make:		Sample No:		8124539	
Model:		Location:		ELEMENT ENVIRONMENTAL LABS DEESIDE	
Serial No:		26/3819-6		Client: ELEMENT ENVIRONMENTAL LABS DEESIDE	
System:		OTHER		Kit Ref/Bottle No:	
Brand:		NOT GIVEN		Job No.: GB05113771PO	
Grade:				Sampled:	
Unique No.:		6769394		Received: 16/03/26	
Diagnosis		Key:	Normal	Caution	Serious
Diagnostician: Sean George					

Unable to perform viscosity test as sample is non-homogeneous.

Results	Current Sample	Historical Samples
Sample No	8124539	
Status		
Sampled		
Fluid Age		
Unit Age		
Received	16/03/26	
Fluid Condition		
Appearance	- LM-12	N/A

AtkinsRéalis UK Limited
Ashley Avenue
Epsom
United Kingdom
KT18 5AL



4225



Attention : Lauren Ilyas
Date : 23rd March, 2026
Your reference : 100128383
Our reference : Test Report 26/3819 Batch 1
Location : Tottenham Leaside Road
Date samples received : 11th March, 2026
Status : Final Report
Issue : 202603231008

Two samples were received for analysis on 11th March, 2026 of which two were scheduled for analysis. Please find attached our Test Report which should be read with notes at the end of the report and should include all sections if reproduced. Interpretations and opinions are outside the scope of any accreditation, and all results relate only to samples supplied.

All analysis is carried out on as received samples and reported on a dry weight basis unless stated otherwise. Results are not surrogate corrected.

The greenhouse gas emissions generated (in Carbon – Co2e) to obtain the results in this report are estimated as:

Scope 1&2 emissions - 1.303 kg of CO2

Scope 1&2&3 emissions - 3.08 kg of CO2

Authorised By:



Simon Gomery BSc

Senior Technical Account Manager

Please include all sections of this report if it is reproduced

Element Materials Technology

Client Name: AtkinsRéalis UK Limited
Reference: 100128383
Location: Tottenham Leaside Road
Contact: Lauren Ilyas
EMT Job No: 26/3819

Report : Product

Liquids/products: V=40ml vial, G=glass bottle, P=plastic bottle
 H=H₂SO₄, Z=ZnAc, N=NaOH, HN=HNO₃

EMT Sample No.	1-3	4-6										
Sample ID	BH24-09	BH12-014										
Depth	6.00	5.50										
COC No / misc												
Containers	V	V										
Sample Date	06/03/2026 10:00	09/03/2026 15:30										
Sample Type	Product	Product										
Batch Number	1	1										
Date of Receipt	11/03/2026	11/03/2026										
Whole Oil Trace #	See Attached	See Attached										
Density @20°C	1.0275	1.0259								<0.0000	g/cm3	TM11/PM0
TPH CWG												
Aliphatics												
>C5-C6 (EH_CU_1D_AL) #	<0.1	<0.1								<0.1	%	TM1/PM0
>C6-C8 (EH_CU_1D_AL) #	<0.1	0.2								<0.1	%	TM1/PM0
>C8-C10 (EH_CU_1D_AL) #	0.2	0.6								<0.1	%	TM1/PM0
>C10-C12 (EH_CU_1D_AL) #	0.3	0.6								<0.1	%	TM1/PM0
>C12-C16 (EH_CU_1D_AL) #	0.8	1.6								<0.1	%	TM1/PM0
>C16-C21 (EH_CU_1D_AL) #	0.8	1.6								<0.1	%	TM1/PM0
>C21-C35 (EH_CU_1D_AL) #	0.2	0.5								<0.1	%	TM1/PM0
Aromatics												
>EC6-EC8 (EH_CU_1D_AR) #	0.2	0.9								<0.1	%	TM1/PM0
>EC8-EC10 (EH_CU_1D_AR) #	3.1	4.2								<0.1	%	TM1/PM0
>EC10-EC12 (EH_CU_1D_AR) #	14.7	13.0								<0.1	%	TM1/PM0
>EC12-EC16 (EH_CU_1D_AR) #	23.7	24.0								<0.1	%	TM1/PM0
>EC16-EC21 (EH_CU_1D_AR) #	20.5	20.7								<0.1	%	TM1/PM0
>EC21-EC35 (EH_CU_1D_AR) #	26.7	23.4								<0.1	%	TM1/PM0
PAH MS												
Naphthalene	15.04	10.66								<0.01	%	TM16/PM0
Acenaphthylene	2.15	2.13								<0.01	%	TM16/PM0
Acenaphthene	0.27	0.28								<0.01	%	TM16/PM0
Fluorene	1.40	0.94								<0.01	%	TM16/PM0
Phenanthrene	3.64	2.54								<0.01	%	TM16/PM0
Anthracene	1.09	0.69								<0.01	%	TM16/PM0
Fluoranthene	1.18	0.71								<0.01	%	TM16/PM0
Pyrene	1.69	1.03								<0.01	%	TM16/PM0
Benzo(a)anthracene	0.69	0.31								<0.01	%	TM16/PM0
Chrysene	0.49	0.23								<0.01	%	TM16/PM0
Benzo(bk)fluoranthene	0.69	0.12								<0.01	%	TM16/PM0
Benzo(a)pyrene	0.43	0.11								<0.01	%	TM16/PM0
Indeno(123cd)pyrene	0.04	<0.01								<0.01	%	TM16/PM0
Dibenzo(ah)anthracene	0.03	<0.01								<0.01	%	TM16/PM0
Benzo(ghi)perylene	0.06	0.07								<0.01	%	TM16/PM0
PAH 16 Total	28.89	19.82								<0.01	%	TM16/PM0
Viscosity at 10C*	NDP	NDP									cSt	Subcontracted

Please see attached notes for all abbreviations and acronyms

[illegible]

Client Name: AtkinsRéalis UK Limited
Reference: 100128383
Location: Tottenham Leaside Road
Contact: Lauren Ilyas

EMT Job No.: 26/3819
EMT Sample No.: 1
Sample Identity: BH24-09
Depth: 6.00

Description: Dark brown coloured product (DCM added)
Carbon Range: 6-40+
Boiling Point Range (°C): 69-525+


Pristane/Phytane Ratio: N/A
nC₁₇/Pristane Ratio: N/A

Age of Diesel (+/- 2 years)*: Not possible as relevant markers are either not present or values are above the permitted range

% Diesel: -
% Petrol: -
Estimated % Weathering of Petrol: -
Toluene/nC₈ ratio of Petrol: -
Age of Petrol (years) (schmidt et al 2002): -

Interpretation: Coal Tar

Chromatogram:

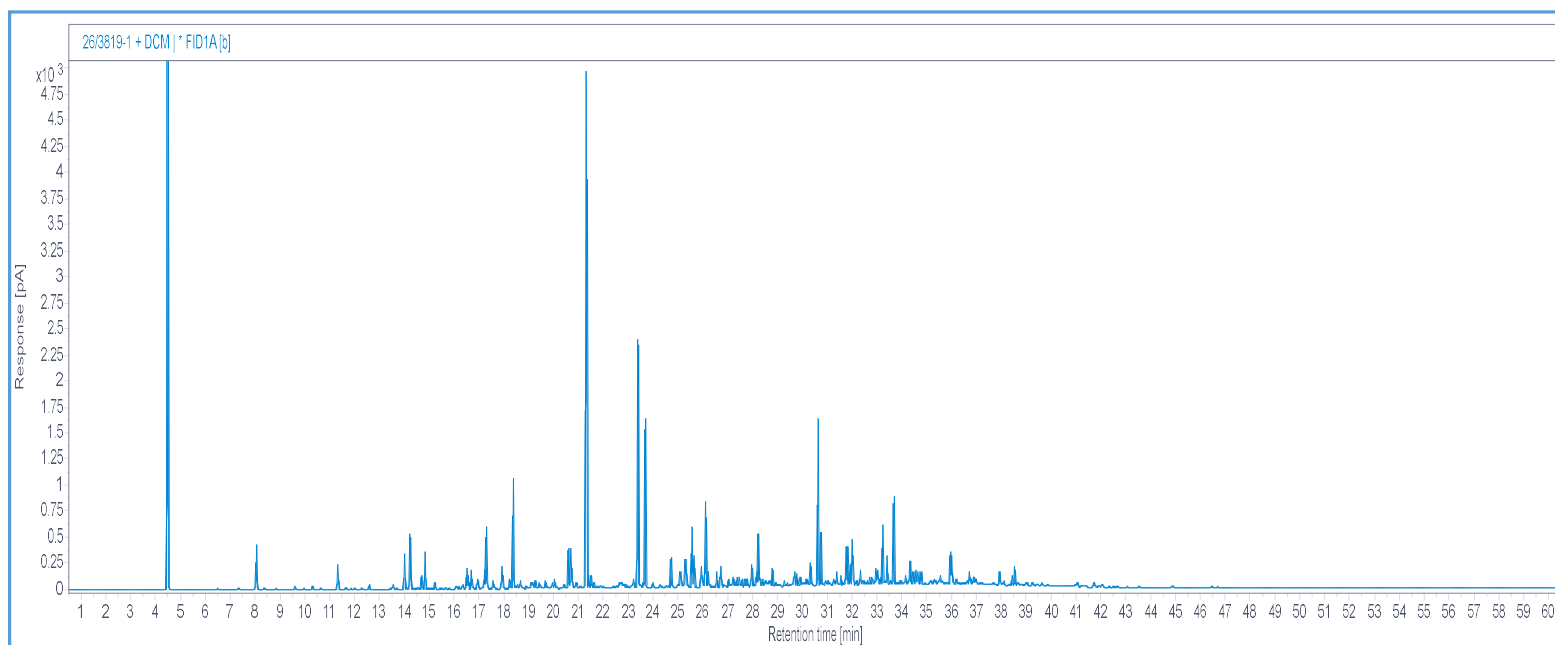

*The age of release estimated in this report is based on the nC₁₇/pristane ratio only as prescribed by Christensen and Larsen (1993) and Kaplan, Galperin, Alimi et al., (1996). Age estimation should be treated with caution as it can be influenced by site specific factors of which the laboratory is not aware.

Client Name: AtkinsRéalis UK Limited
Reference: 100128383
Location: Tottenham Leaside Road
Contact: Lauren Ilyas

EMT Job No.: 26/3819
EMT Sample No.: 4
Sample Identity: BH12-014
Depth: 5.50

Description: Dark brown coloured product (DCM added)
Carbon Range: 6-40+
Boiling Point Range (°C): 69-525+

% Diesel: -
% Petrol: -
Estimated % Weathering of Petrol: -


Pristane/Phytane Ratio: N/A
nC₁₇/Pristane Ratio: N/A

Toluene/nC₈ ratio of Petrol: -
Age of Petrol (years) (schmidt et al 2002): -

Age of Diesel (+/- 2 years)*: Not possible as relevant markers are either not present or values are above the permitted range

Interpretation: Coal Tar

Chromatogram:

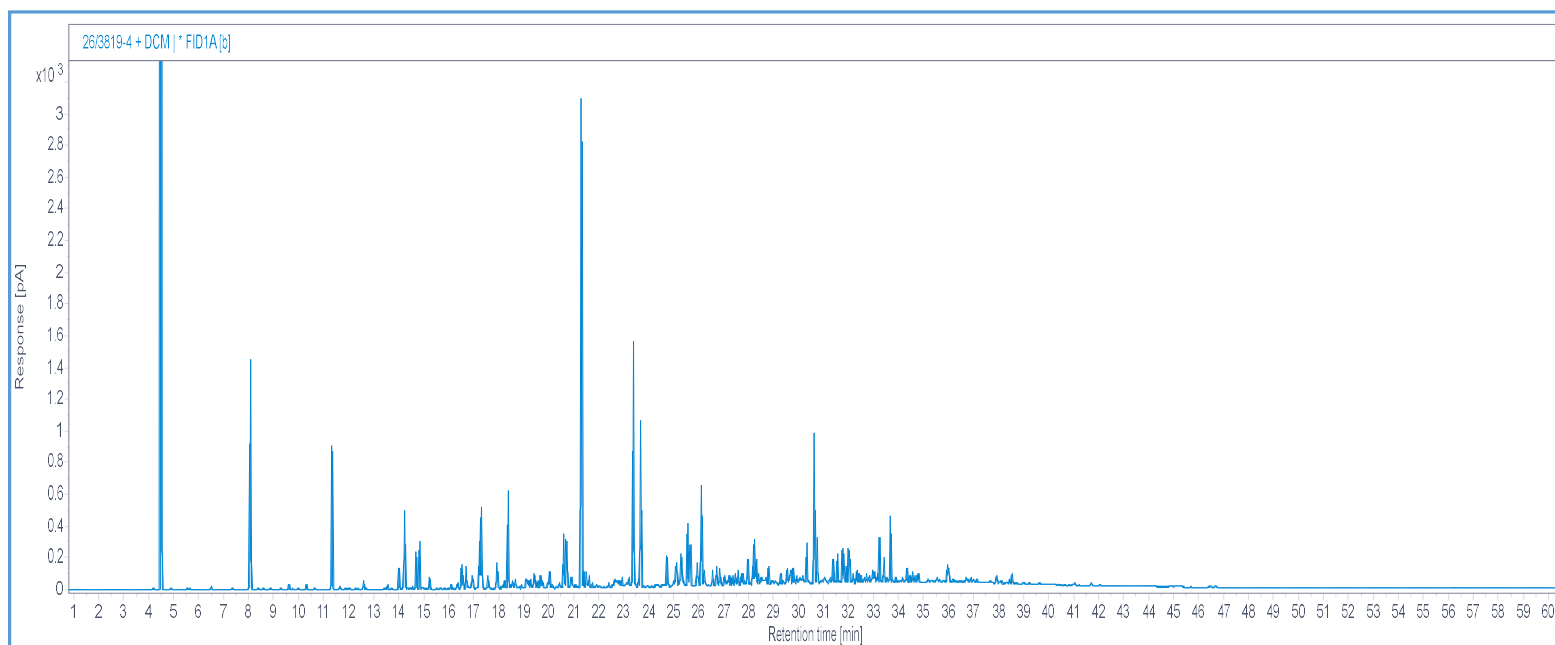

*The age of release estimated in this report is based on the nC₁₇/pristane ratio only as prescribed by Christensen and Larsen (1993) and Kaplan, Galperin, Alimi et al., (1996). Age estimation should be treated with caution as it can be influenced by site specific factors of which the laboratory is not aware.

Matrix : Product

[illegible]

Client Name: AtkinsRéalis UK Limited

Reference: 100128383

Location: Tottenham Leaside Road

Contact: Lauren Ilyas

[illegible]

Please note that only samples that are deviating are mentioned in this report. If no samples are listed it is because none were deviating. Only analyses which are accredited are recorded as deviating if set criteria are not met.

It is a requirement under ISO 17025 that we inform clients if samples are deviating i.e. outside what is expected. A deviating sample indicates that the sample 'may' be compromised but not necessarily will be compromised. The result is still accredited and our analytical reports will still show accreditation on the relevant analytes.

NOTES TO ACCOMPANY ALL SCHEDULES AND REPORTS

EMT Job No.: 26/3819

SOILS and ASH

Please note we are only MCERTS accredited (UK soils only) for sand, loam and clay and any other matrix is outside our scope of accreditation.

Where an MCERTS report has been requested, you will be notified within 48 hours of any samples that have been identified as being outside our MCERTS scope. As validation has been performed on clay, sand and loam, only samples that are predominantly these matrices, or combinations of them will be within our MCERTS scope. If samples are not one of a combination of the above matrices they will not be marked as MCERTS accredited.

It is assumed that you have taken representative samples on site and require analysis on a representative subsample. Stones will generally be included unless we are requested to remove them.

All samples will be discarded one month after the date of reporting, unless we are instructed to the contrary. Asbestos samples are retained for 6 months.

If you have not already done so, please send us a purchase order if this is required by your company.

Where appropriate please make sure that our detection limits are suitable for your needs, if they are not, please notify us immediately.

All analysis is reported on a dry weight basis unless stated otherwise. Limits of detection for analyses carried out on as received samples are not moisture content corrected. Results are not surrogate corrected. Samples are dried at 35°C ±5°C unless otherwise stated. Moisture content for CEN Leachate tests are dried at 105°C ±5°C. Ash samples are dried at 35°C ±5°C.

Where Mineral Oil is quoted, this refers to Total Aliphatics C10-C40.

Where a CEN 10:1 ZERO Headspace VOC test has been carried out, a 10:1 ratio of water to wet (as received) soil has been used.

% Asbestos in Asbestos Containing Materials (ACMs) is determined by reference to HSG 264 The Survey Guide - Appendix 2 : ACMs in buildings listed in order of ease of fibre release.

Sufficient amount of sample must be received to carry out the testing specified. Where an insufficient amount of sample has been received the testing may not meet the requirements of our accredited methods, as such accreditation may be removed.

Negative Neutralization Potential (NP) values are obtained when the volume of NaOH (0.1N) titrated (pH 8.3) is greater than the volume of HCl (1N) to reduce the pH of the sample to 2.0 - 2.5. Any negative NP values are corrected to 0.

The calculation of Pyrite content assumes that all oxidisable sulphides present in the sample are pyrite. This may not be the case. The calculation may be an overestimate when other sulphides such as Barite (Barium Sulphate) are present.

WATERS

Please note we are not a UK Drinking Water Inspectorate (DWI) Approved Laboratory .

ISO17025 accreditation applies to surface water and groundwater and usually one other matrix which is analysis specific, any other liquids are outside our scope of accreditation.

As surface waters require different sample preparation to groundwaters the laboratory must be informed of the water type when submitting samples.

Where Mineral Oil is quoted, this refers to Total Aliphatics C10-C40.

STACK EMISSIONS

Where an MCERTS report has been requested, you will be notified within 48 hours of any samples that have been identified as being outside our MCERTS scope. As validation for Dioxins and Furans and Dioxin like PCBs has been performed on XAD-2 Resin, only samples which use this resin will be within our MCERTS scope.

Where appropriate please make sure that our detection limits are suitable for your needs, if they are not, please notify us immediately.

DEVIATING SAMPLES

All samples should be submitted to the laboratory in suitable containers with sufficient ice packs to sustain an appropriate temperature for the requested analysis. The temperature of sample receipt is recorded on the confirmation schedules in order that the client can make an informed decision as to whether testing should still be undertaken.

SURROGATES

Surrogate compounds are added during the preparation process to monitor recovery of analytes. However low recovery in soils is often due to peat, clay or other organic rich matrices. For waters this can be due to oxidants, surfactants, organic rich sediments or remediation fluids. Acceptable limits for most organic methods are 70 - 130% and for VOCs are 50 - 150%. When surrogate recoveries are outside the performance criteria but the associated AQC passes this is assumed to be due to matrix effect. Results are not surrogate corrected.

DILUTIONS

A dilution suffix indicates a dilution has been performed and the reported result takes this into account. No further calculation is required.

BLANKS

Where analytes have been found in the blank, the sample will be treated in accordance with our laboratory procedure for dealing with contaminated blanks.

NOTE

Data is only reported if the laboratory is confident that the data is a true reflection of the samples analysed. Data is only reported as accredited when all the requirements of our Quality System have been met. In certain circumstances where all the requirements of the Quality System have not been met, for instance if the associated AQC has failed, the reason is fully investigated and documented. The sample data is then evaluated alongside the other quality control checks performed during analysis to determine its suitability. Following this evaluation, provided the sample results have not been effected, the data is reported but accreditation is removed. It is a requirement of our Accreditation Body for data not reported as accredited to be considered indicative only, but this does not mean the data is not valid.

Where possible, and if requested, samples will be re-extracted and a revised report issued with accredited results. Please do not hesitate to contact the laboratory if further details are required of the circumstances which have led to the removal of accreditation.

Laboratory records are kept for a period of no less than 6 years.

REPORTS FROM THE SOUTH AFRICA LABORATORY

Any method number not prefixed with SA has been undertaken in our UK laboratory unless reported as subcontracted.

Measurement Uncertainty

Measurement uncertainty defines the range of values that could reasonably be attributed to the measured quantity. This range of values has not been included within the reported results. Uncertainty expressed as a percentage can be provided upon request.

Customer Provided Information

Sample ID and depth is information provided by the customer.

Age of Diesel

The age of release estimation is based on the nC17/pristane ratio only as prescribed by Christensen and Larsen (1993) and Kaplan, Galperin, Alimi et al., (1996).

Age estimation should be treated with caution as it can be influenced by site specific factors of which the laboratory are not aware.

Tentatively Identified Compounds (TICs)

Where Tentatively Identified Compounds (TICs) are reported, up to 10 Tentatively Identified Compounds will be listed where there is found to be a greater than 80% match with the NIST library. The reported concentration is determined semi-quantitatively, with a matrix specific limit of detection.

Note, other compounds may be present but are not reported.

ABBREVIATIONS and ACRONYMS USED

#	ISO17025 (UKAS Ref No. 4225) accredited - UK.
SA	ISO17025 (SANAS Ref No.T0729) accredited - South Africa
B	Indicates analyte found in associated method blank.
DR	Dilution required.
M	MCERTS accredited.
NA	Not applicable
NAD	No Asbestos Detected.
ND	None Detected (usually refers to VOC and/SVOC TICs).
NDP	No Determination Possible
SS	Calibrated against a single substance
SV	Surrogate recovery outside performance criteria. This may be due to a matrix effect.
W	Results expressed on as received basis.
+	AQC failure, accreditation has been removed from this result, if appropriate, see 'Note' on previous page.
>>	Results above quantitative calibration range. The result should be considered the minimum value and is indicative only. The actual result could be significantly higher.
*	Analysis subcontracted to an Element Materials Technology approved laboratory.
CO	Suspected carry over
LOD/LOR	Limit of Detection (Limit of Reporting) in line with ISO 17025 and MCERTS
ME	Matrix Effect
NFD	No Fibres Detected
BS	AQC Sample
LB	Blank Sample
N	Client Sample
TB	Trip Blank Sample
OC	Outside Calibration Range

HWOL ACRONYMS AND OPERATORS USED

HS	Headspace Analysis.
EH	Extractable Hydrocarbons - i.e. everything extracted by the solvent.
CU	Clean-up - e.g. by florisil, silica gel.
1D	GC - Single coil gas chromatography.
Total	Aliphatics & Aromatics.
AL	Aliphatics only.
AR	Aromatics only.
2D	GC-GC - Double coil gas chromatography.
#1	EH_Total but with humics mathematically subtracted
#2	EU_Total but with fatty acids mathematically subtracted
_	Operator - underscore to separate acronyms (exception for +).
+	Operator to indicate cumulative e.g. EH+HS_Total or EH_CU+HS_Total
MS	Mass Spectrometry.

EMT Job No: 26/3819

Test Method No.	Description	Prep Method No. (if appropriate)	Description	ISO 17025 (UKAS/S ANAS)	MCERTS (UK soils only)	Analysis done on As Received (AR) or Dried (AD)	Reported on dry weight basis
TM1	Modified USEPA 8015B v2:1996 method for the determination of carbon banding in oil and product samples by GC-FID.	PM0	No preparation is required.			AR	
TM1	Modified USEPA 8015B v2:1996 method for the determination of carbon banding in oil and product samples by GC-FID.	PM0	No preparation is required.	Yes		AR	
TM11	Determination of density by a meter.	PM0	No preparation is required.			AR	
TM16	Modified USEPA 8270D v5:2014. Quantitative determination of Semi-Volatile Organic compounds (SVOCs) by GC-MS.	PM0	No preparation is required.			AR	
TM124	Modified USEPA 8260B v2:1996. Semi- Quantitative Determination of Volatile Organic Compounds (VOCs) by Headspace GC-MS.	PM0	No preparation is required.			AR	
Subcontracted	See attached subcontractor report for accreditation status and provider.						

Appendix E. Pre-trial groundwater and ground gas monitoring



Borehole ID	Date	Time	Ground level (m AOD)	Depth to GW (m bgl)	Depth to GW (m AOD)	Depth to base (m bgl)	Depth to base (m AOD)	NAPL detected/depth (m bgl)	NAPL detected/depth (m AOD)	Comments
BH11	19/02/2026	14:50:00	10.44	2.41	8.03	6.6	3.84	6.10	4.34	-
BH12-01	18/02/2026	16:16:00	10.79	2.32	8.47	6.21	4.58	5.38	5.41	-
BH24-09	17/02/2026	09:35:00	10.56	2.67	7.89	6.54	4.02	5.72	4.84	-
BH24-14	18/02/2026	09:25:00	10.57	2.67	7.90	6.92	3.65	6.10	4.47	-
BH24-13	17/06/2026	11:40:00	10.70	2.33	8.37	7.11	3.59	6.88	3.82	-
BH24-02	17/02/2026	16:07:00	10.40	2.5	7.90	6.59	3.81	Base of well	-	Visible but not picked up by interphase probe.
BH24-04	18/02/2026	11:57:00	10.38	2.53	7.85	6.45	3.93	No	-	-
BH12-02D	18/02/2026	09:47:00	10.63	2.41	8.22	5.88	4.75	Yes	-	Patchy, inconsistent - unable to get clear reading
	26/02/2026	09:25:00	10.63	2.46	8.17	5.86	4.77	5.86	4.77	20mm of tape covered, patchy for 0.3 m
BH12-05	18/02/2026	12:22:00	10.44	2.58	7.86	6.57	3.87	No	-	-
WS12-08	18/02/2026	15:36:00	10.43	1.34	9.09	2.13	8.30	No	-	-
BH24-03	18/02/2026	14:41:00	11.06	1.11	9.95	3.97	7.09	No	-	-
WS12-02	17/02/2026	13:02:00	10.57	1.05	9.52	2.99	7.58	Base of well	-	-
	26/02/2026	09:18:00	10.57	1.24	9.33	2.99	7.58	No	-	-
WS12-01	19/02/2026	N/A	10.51	0.61	9.90	3.05	7.46	No	-	-
	26/02/2026	09:10	10.51	0.71	9.80	3.05	7.46	No	-	0.5 cm visually detected on interphase probe.
BH24-12	19/02/2026	N/A	10.63	1.54	9.09	6.25	4.38	Base of well	-	-

Borehole ID	Date	Time	Relative Pressure (mb)	Barometric Pressure (mb)	Stable Flow (L/hr)	Peak Flow (L/hr)	Stable CH4 (% vol in air)	Peak CH4 (% vol in air)	Stable CO2 (% vol in air)	Peak CO2 (% vol in air)	Stable O2 (% vol in air)	Peak O2 (% vol in air)	Stable CO (ppm)	Peak CO (ppm)	Stable H2S (ppm)	Stable H2S (ppm)	Analyser Run (sec)	PID (ppm)	Comments
BH11	19/02/2026	14:50:00	-0.02	993	N/A	N/A	0	0	0.7	1.5	21.8	18.8	0	0	0	0	120		No gas tap, therefore unable to measure flow.
BH12-01	18/02/2026	16:16:00	0.03	993	N/A	N/A	0.3	0.5	0.2	0.3	21.5	21.3	0	0	0	0	120	260.9	No gas tap, therefore unable to measure flow. Lid broken. Needed to repeat gas readings due to data loss
BH24-09	17/02/2026	09:35:00	1	1012	0	0	0	15.9	0	14.5	21.8	0.3	0	8	>1000	>1000	120	85.7	Hydrogen sulphide measured over 1000 but it's out of calibration limit
BH24-14	18/02/2026	09:25:00	0	1001	0	-0.1	1.3	1.4	2.2	2.2	19.1	19.1	1	1	1	2	120	282.5	Needed to repeat gas readings due to data loss
BH24-13	17/06/2026	11:40:00	0.1	994	1.8	1.9	6.9	6.9	0.7	0.7	19.7	19.7	6	6	2	2	120	252.8	Needed to repeat gas readings due to data loss
BH24-02	17/02/2026	16:07:00	-0.05	1012	N/A	N/A	0.2	0.8	0.3	1.5	21.4	21.1	0	0	0	0	120	14.5	No gas tap, therefore unable to measure flow
BH24-04	18/02/2026	11:57:00	-0.03	999	N/A	N/A	0.3	0.3	0.5	1	20.9	20.5	0		0	0	120	2.5	No gas tap, therefore unable to measure flow
BH12-02D	18/02/2026	09:47:00	-0.07	1001	N/A	N/A	2.1	8.2	0.6	1.6	20.7	20.4	1	1	1	1	120	363.9	No gas tap, therefore unable to measure flow
BH12-05	18/02/2026	12:22:00	0.03	999	N/A	N/A	0.3	0.3	0.2	0.2	21.2	21.1	0	1	0	0	120	0	No gas tap, therefore unable to measure flow
WS12-08	18/02/2026	15:36:00	-0.02	994	0.1	0.1	0.5	0.5	12.7	13.3	0.7	0.7	0	0	0	0	120	0.1	N/A
BH24-03	18/02/2026	14:41:00	-0.05	995	N/A	N/A	0.3	0.3	0.2	0.2	21.3	21.3	0	0	0	0	120	17.6	No gas tap, therefore unable to measure flow. No bung or secure lid
WS12-02	17/02/2026	13:02:00	0.03	1012	N/A	N/A	0	0	0	0	21.6	21.6	0	1	0	0	120	5.7	No gas tap, therefore unable to measure flow. No bung or secure lid
WS12-01	19/02/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	9.8	Gas analyser was faulty - would only give measurements for fresh air
BH24-12	19/02/2026	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	317.9	Gas analyser was faulty - would only give measurements for fresh air

Appendix F. Post works groundwater monitoring



Location	Date	Time	Ground level (m AOD)	Groundwater level (mAOD)	Groundwater level (m AOD)	DNAPL level (m bgl)	DNAPL level (m AOD)	Base of well (m bgl)	Base of well (m AOD)	Comments
BH24-02	18/03/2026	10:30:00	10.40	2.91	7.49	N/A	N/A	6.60	3.80	Slight hydrocarbon odour
BH24-03	18/03/2026	10:35:00	11.06	1.40	9.66	N/A	N/A	3.99	7.07	
BH24-04	18/03/2026	10:39:00	10.38	2.90	7.48	N/A	N/A	6.45	3.93	
WS12-08	18/03/2026	10:50:00	10.43	1.71	8.72	N/A	N/A	2.13	8.30	
BH12-05	18/03/2026	10:53:00	10.44	2.94	7.50	N/A	N/A	6.55	3.89	
BH11	18/03/2026	10:56:00	10.44	3.02	7.42	5.93	4.51	6.57	3.87	
BH24-14	18/03/2026	11:02:00	10.57	3.12	7.45	6.24	4.33	6.91	3.66	
BH24-09	18/03/2026	11:09:00	10.56	3.12	7.44	5.73	4.83	6.54	4.02	
BH24-12	18/03/2026	11:16:00	10.63	1.53	9.10	At base	N/A	6.20	4.43	
WS12-01	18/03/2026	11:20:00	10.51	0.72	9.79	At base	N/A	3.03	7.48	
WS12-02	18/03/2026	11:25:00	10.57	1.32	9.25	At base	N/A	2.99	7.58	
BH12-02D	18/03/2026	11:27:00	10.63	2.57	8.06	Patchy for 5 cm	N/A	5.87	4.76	
BH24-13	18/03/2026	11:31:00	10.70	2.45	8.25	6.88	3.82	7.11	3.59	
BH12-01	18/03/2026	11:38:00	10.79	2.12	8.67	5.44	5.35	6.16	4.63	Obstruction at 5.75m
BH24-02	23/03/2026	11:28	10.40	2.94	7.46	N/A	N/A	6.60	3.80	Potential LNAPL - light brown colour on cloth and hydrocarbon odour was present
BH24-03	23/03/2026	11:32	11.06	1.43	9.63	N/A	N/A	3.99	7.07	
BH24-04	23/03/2026	11:35	10.38	2.94	7.44	N/A	N/A	6.42	3.96	
WS12-08	23/03/2026	11:39	10.43	1.77	8.66	N/A	N/A	2.13	8.30	
BH12-05	23/03/2026	11:44	10.44	3.03	7.41	N/A	N/A	6.65	3.79	
BH11	23/03/2026	11:50	10.44	3.10	7.34	5.94	4.50	6.55	3.89	IP tape covered - 69 cm but patchy for last 10
BH24-14	23/03/2026	11:54	10.57	3.17	7.40	6.22	4.35	6.91	3.66	IP tape covered - 80 cm
BH24-09	23/03/2026	11:59	10.56	3.17	7.39	5.72	4.84	6.54	4.02	IP tape covered - 86 cm
BH24-12	23/03/2026	12:08	10.63	1.63	9.00	Base	N/A	6.20	4.43	
WS12-01	23/03/2026	12:11	10.51	0.74	9.77	Base	N/A	3.05	7.46	
WS12-02	23/03/2026	12:15	10.57	1.39	9.18	Base	N/A	2.98	7.59	
BH12-02D	23/03/2026	12:18	10.63	2.59	8.04	Patchy for 10 cm	N/A	5.87	4.76	
BH24-13	23/03/2026	12:27	10.70	2.50	8.20	Pathy for 30 cm	N/A	7.11	3.59	DNAPL not detected by IP
BH12-01	23/03/2026	12:31	10.79	2.05	8.74	5.44	5.35	6.15	4.64	No obstruction felt
BH24-02	01/04/2026	09:37	10.40	3.00	7.40	N/A	N/A	6.60	3.80	Hydrocarbon odour; dipped to top of water, 48 cm LNAPL visually on IP tape
BH24-03	01/04/2026	09:55	11.06	1.51	9.55	N/A	N/A	3.99	7.07	
BH24-04	01/04/2026	09:47	10.38	2.98	7.40	N/A	N/A	6.44	3.94	Silty
WS12-08	01/04/2026	10:10	10.43	1.83	8.60	N/A	N/A	2.13	8.30	
BH12-05	01/04/2026	10:18	10.44	3.02	7.42	N/A	N/A	6.64	3.80	
BH11	01/04/2026	10:34	10.44	3.10	7.34	5.90	4.54	6.52	3.92	IP tape covered - 70cm
BH24-14	01/04/2026	10:54	10.57	3.19	7.38	6.16	4.41	6.92	3.65	IP tape covered - 85 cm
BH24-09	01/04/2026	11:09	10.56	3.18	7.38	5.72	4.84	6.54	4.02	IP tape covered - 90 cm
BH24-12	01/04/2026	11:23	10.63	1.62	9.01	N/A	N/A	6.19	4.44	Last 26 cm patchy - no IP beep
WS12-01	01/04/2026	11:30	10.51	0.78	9.73	Base	N/A	3.02	7.49	
WS12-02	01/04/2026	11:40	10.57	1.52	9.05	Base	N/A	2.97	7.60	
BH12-02D	01/04/2026	11:45	10.63	2.69	7.94	N/A	N/A	5.88	4.75	Last 26 cm patchy - no IP beep
BH24-13	01/04/2026	11:52	10.70	2.57	8.13	6.86	3.84	7.11	3.59	Last 26 cm patchy
BH12-01	01/04/2026	12:00	10.79	1.99	8.80	5.68	5.11	6.17	4.62	IP tape covered - 78 cm
BH24-02	08/04/2026	10:07	10.40	3.02	7.38	N/A	N/A	6.6	3.80	Hydrocarbon odour - 3.01 LNAPL
BH24-03	08/04/2026	10:16	11.06	1.58	9.48	N/A	N/A	3.99	7.07	
BH24-04	08/04/2026	10:22	10.38	3.04	7.34	N/A	N/A	6.43	3.95	
WS12-08	08/04/2026	10:27	10.43	1.86	8.57	N/A	N/A	2.13	8.30	
BH12-05	08/04/2026	10:30	10.44	3.1	7.34	N/A	N/A	6.64	3.80	
BH11	08/04/2026	10:37	10.44	3.17	7.27	5.92	3.90	6.54	4.52	70 cm IP tape visually covered
BH24-14	08/04/2026	10:41	10.57	3.27	7.30	6.16	3.63	6.94	4.41	85 cm IP tape visually covered
BH24-09	08/04/2026	10:46	10.56	3.26	7.30	5.7	4.04	6.52	4.86	87 cm IP tape visually covered
BH24-12	08/04/2026	10:54	10.63	1.66	8.97	Base	N/A	6.18	4.45	
WS12-01	08/04/2026	10:59	10.51	0.81	9.70	Base	N/A	3.04	7.47	
WS12-02	08/04/2026	11:02	10.57	1.56	9.01	N/A	N/A	2.98	7.59	
BH12-02D	08/04/2026	11:06	10.63	2.72	7.91	N/A	N/A	5.88	4.75	Patchy
BH24-13	08/04/2026	11:10	10.70	2.64	8.06	6.96	3.59	7.11	3.74	27 cm tape visually covered
BH12-01	08/04/2026	11:24	10.79	2.03	8.76	5.33	4.65	6.14	5.46	84 cm tape visually covered; obstruction at 5.75m

AtkinsRéalis



AtkinsRealis
AtkinsRéalis UK Limited
Nova North
11 Bressenden Place
Westminster
London
SW1E 5BY

Tel: +44 (0)20 7121 2000
Fax: +44 (0)20 7121 2111

© AtkinsRéalis UK Limited except where stated otherwise

AtkinsRéalis

