




1 **Second Floor**
Scale: 1:50

- Masonry: taken back to brick
- Masonry: lime plaster retained - re-skim
- Stud wall: taken back to stud
- Stud wall: laths retained
- Stud wall: lime plaster retained - re-skim

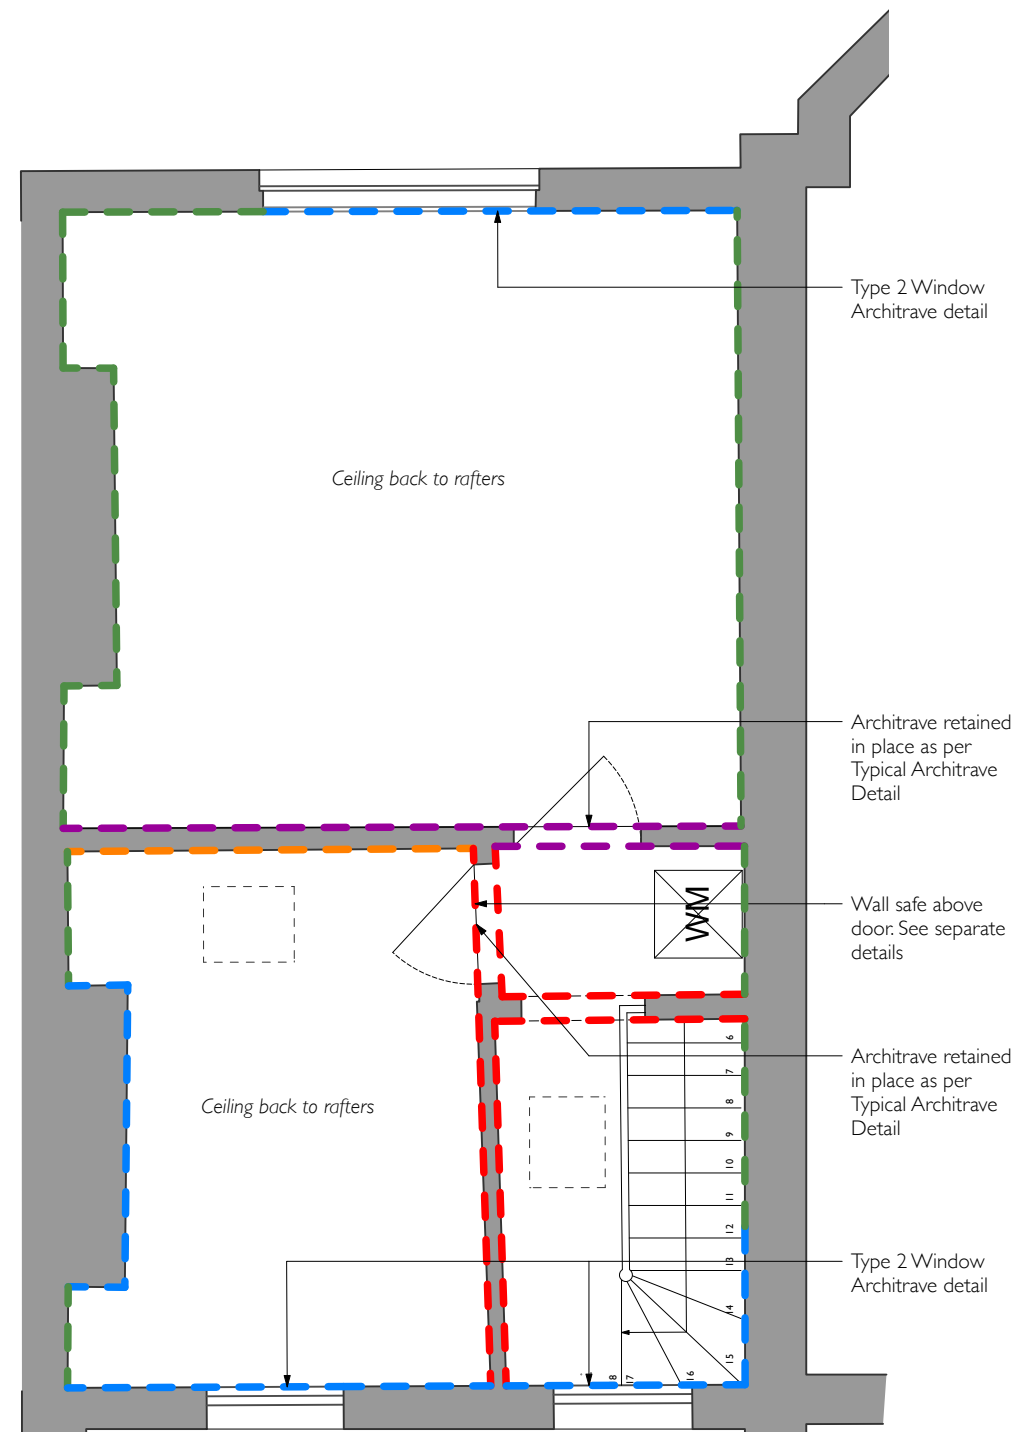

Second Floor Rear Room



Second Floor Rear Room

- Cornice retained in place for specialist to confirm historic sections to be retained and reproduced as per previously agreed methodology statement
- Rear masonry wall with areas taken back to brick where plaster blown or crumbling to be infilled with lime plaster
- Masonry wall with retained areas of lime plaster to have new lime plaster finish coat



Second Floor Rear Room



Second Floor Rear Room

- Existing architrave retained in place as per Typical Internal Door Architrave detail
- Area of damaged lime plaster removed to be patched in using existing laths



Second Floor Hallway



- Plasterboarded walls stripped back to stud (no existing lath and plaster behind)
- Area of lime plaster to party wall retained with new lime plaster finish coat
- Areas of old gypsum plaster taken back to brick to be finished with new lime plaster



Second Floor Hallway