

16. The Likelihood of UXO Encounter

16.1. Introduction

For UXO to pose a risk at a site, there should be a means by which any potential UXO might be encountered on that site.

The likelihood of encountering UXO on the site of proposed works would depend on various factors, such as the type of UXO that might be present and the intrusive works planned on site. In most cases, UXO is more likely to be present below surface (buried) than on surface.

In general, the greater the extent and depth of intrusive works, the greater the risk of encountering. The most likely scenarios under which items of UXO could be encountered during construction works is during piling, drilling operations or bulk excavations for basement levels. The overall risk will depend on the extent of the works, such as the numbers of boreholes/piles (if required) and the volume of the excavations.

Generally speaking, the risk of encountering any type of UXO will be minimal for any works planned within the footprint and down to the depth of post-war foundations and excavations.

16.2. Encountering Air Delivered Ordnance

Since an air delivered bomb may come to rest at any depth between just below ground level and its maximum penetration depth, there is a chance that such an item (if present) could be encountered during shallow excavations (for services or site investigations) into the original WWII ground level as well as at depth.

17. The Likelihood of UXO Initiation

17.1. Introduction

UXO does not spontaneously explode. Older UXO devices will require an external event/energy to create the conditions for detonation to occur. The likelihood that a device will function can depend on a number of factors including the type of weaponry, its age and the amount of energy it is struck with.

17.2. Initiating Air Delivered Ordnance

Unexploded bombs do not spontaneously explode. All high explosive filling requires significant energy to create the conditions for detonation to occur.

In recent decades, there have been a number of incidents in Europe where Allied UXBs have detonated, and incidents where fatalities have resulted. There have been several hypotheses as to the reason why the issue is more prevalent in mainland Europe – reasons could include the significantly greater number of bombs dropped by the Allied forces on occupied Europe, the preferred use by the Allies of mechanical rather than electrical fuzes, and perhaps just good fortune. The risk from UXO in the UK is also being treated very seriously in many sectors of the construction industry, and proactive risk mitigation efforts will also have affected the lack of detonations in the UK.

There are certain construction activities which make initiation more likely, and several potential initiation mechanisms must be considered:

UXB Initiation	
Direct Impact	Unless the fuze or fuze pocket is struck, there needs to be a significant impact e.g. from piling or large and violent mechanical excavation, onto the main body of the weapon to initiate a buried iron bomb. Such violent action can cause the bomb to detonate.
Re- starting the Clock	A small proportion of German WWII bombs employed clockwork fuzes. It is probable that significant corrosion would have taken place within the fuze mechanism over the last 70+ years that would prevent clockwork mechanisms from functioning. Nevertheless, it was reported that the clockwork fuze in a UXB dealt with by 33 EOD Regiment in Surrey in 2002 did re-start.
Friction Impact	The most likely scenario resulting in the detonation of a UXB is friction impact initiating the shock-sensitive fuze explosive. The combined effects of seasonal changes in temperature and general degradation over time can cause explosive compounds to crystallise and extrude out from the main body of the bomb. It may only require a limited amount of energy to initiate the extruded explosive which could detonate the main charge.

18. Consequences of Initiation/Encounter

18.1. Introduction

The repercussions of the inadvertent detonation of UXO during intrusive ground works, or if an item or ordnance is interfered with or disturbed, are potentially profound, both in terms of human and financial cost. A serious risk to life and limb, damage to plant and total site shutdown during follow-up investigations are potential outcomes. However, if appropriate risk mitigation measures are put in place, the chances of initiating an item of UXO during ground works is comparatively low.

The consequences of encountering UXO can be particularly notable in the case of high-profile sites (such as airports and train stations) where it is necessary to evacuate the public from the surrounding area. A site may be closed for anything from a few hours to a week with potentially significant cost in lost time. It should be noted that even the discovery of suspected or possible item of UXO during intrusive works (if handled solely through the authorities), may also involve significant loss of production.

18.2. Consequences of Detonation

When considering the potential consequences of a detonation, it is necessary to identify the significant receptors that may be affected. The receptors that may potentially be at risk from a UXO detonation on a construction site will vary depending on the site specific conditions but can be summarised as follows:

- People – site workers, local residents and general public.
- Plant and equipment – construction plant on site.
- Services – subsurface gas, electricity, telecommunications.
- Structures – not only visible damage to above ground buildings, but potentially damage to foundations and the weakening of support structures.
- Environment – introduction of potentially contaminating materials.

19. 1st Line Defence Risk Assessment

19.1. Risk Assessment Stages

Taking into account the quality of the historical evidence, the assessment of the overall risk from unexploded ordnance is based on the following five considerations:

1. That the site was contaminated with unexploded ordnance.
2. That unexploded ordnance remains on site.
3. That such items will be encountered during the proposed works.
4. That ordnance may be initiated by the works operations.
5. The consequences of encountering or initiating ordnance.

19.2. Assessed Risk Level

1st Line Defence has assessed that there is an overall **Medium Risk** from German and anti-aircraft unexploded ordnance at the site of proposed works. There is an assessed **Negligible Risk** from Allied unexploded ordnance.

Ordnance Type	Risk Level			
	Negligible	Low	Medium	High
German Unexploded HE Bombs			✓	
German 1kg Incendiary Bombs			✓	
Anti-Aircraft Artillery Projectiles			✓	
Allied Land Service and Small Arms Ammunition	✓			

This report has been undertaken with due diligence, and all reasonable care has been taken to access and analyse relevant historical information. By necessity, when dealing historical evidence, and when making assessments of UXO risk, various assumptions have to be made which we have discussed and justified throughout this report. Our reports take a common-sense and practical approach to the assessment of risk, and we strive to be reasonable and pragmatic in our conclusions.

It should however be stressed that if any suspect items are encountered during the proposed works, 1st Line Defence should be contacted for advice/assistance, and to re-assess the risk where necessary. The mitigation measures outlined in the next section are recommended as a minimum precaution to alert ground personnel to the history of the site, what to look out for, and what measures to take in the event that a suspect item is encountered. It should also be noted that the conclusions of this report are based on the scope of works outlined in the 'Proposed Works' section of this report. Should the scope of works change or additional works be proposed, 1st Line Defence should be contacted to re-evaluate the risk.

20. Proposed Risk Mitigation Methodology

20.1. General

The following risk mitigation measures are recommended to support the proposed works at YLCAN – Crouch End.

Recommended Risk Mitigation Measures	
Activity	Recommended Risk Mitigation Measure
All Works	UXO Risk Management Plan It is recommended that a site-specific plan for the management of UXO risk be written for this site. This plan should be kept on site and be referred to in the event that a suspect item of UXO is encountered at any stage of the project. It should detail the steps to be taken in the event of such a discovery, considering elements such as communication, raising the alarm, nominated responsible persons etc. Contact 1st Line Defence for help/more information. Site Specific UXO Awareness Briefings to all personnel conducting intrusive works. As a minimum precaution, all personnel working on the site should be briefed on the basic identification of UXO and what to do in the event of encountering a suspect item. This should in the first instance be undertaken by a UXO Specialist. Posters and information on the risk of UXO can be held in the site office for reference.
Open Excavations (trial pits, service pits, bulk excavations, strip foundations etc.)	Unexploded Ordnance (UXO) Specialist Presence on Site to support open excavations When on site the role of the UXO Specialist would include: - Monitoring works using visual recognition and instrumentation, including immediate response to reports of suspicious objects or suspected items of ordnance that have been recovered by the ground workers on site. - Providing UXO awareness briefings to any uninformed staff and advise staff of the need to modify working practices to take account of the ordnance risk. - To aid incident management which would involve liaison with the local authorities and police should ordnance be identified and present an explosive hazard.
Boreholes and Piled Foundations	Intrusive Magnetometer Survey of all borehole and pile locations down to a maximum bomb penetration depth: 1st Line Defence can deploy a range of intrusive magnetometer techniques to clear pile locations. The appropriate technique is influenced by a number of factors, but most importantly the site's ground conditions. The appropriate survey methodology would be confirmed once the enabling works have been completed.

In making this assessment and recommending these risk mitigation measures, if known, the works outlined in the 'Scope of the Proposed Works' section were considered. Should the planned works be modified or additional intrusive engineering works be considered, 1st Line Defence should be consulted to see if a re-assessment of the risk or mitigation recommendations is necessary.

1st Line Defence Limited

13th August 2025



This Report has been produced in compliance with the Construction Industry Research and Information Association (CIRIA) C681 guidelines for the writing of Detailed UXO Risk Assessments.

Bibliography

- Bates, H. E., Flying Bombs over England, Frogletts Publications Ltd., 1994
- Castle, I., London 1914-17: The Zeppelin Menace, Osprey Publications Ltd., 2008
- Castle, I., London 1917-18: The Bomber Blitz, Osprey Publications Ltd., 2010
- Clarke, N. J., Adolf Hitler's Holiday Snaps: German Aerial Reconnaissance Photography of London and the Home Counties 1939 – 1943, N. J. Clarke Publications., 1996
- Clarke, N. J., Adolf Hitler's Holiday Snaps: German Aerial Reconnaissance Photography of Southern England 1939 – 1943, N. J. Clarke Publications., 1995
- Clarke, N. J., Adolf's British Holiday Snaps: Luftwaffe Aerial Reconnaissance Photographs of England, Scotland and Wales, Fonthill Media Ltd., 2012
- Dobinson, C., AA Command: Britain's Anti-Aircraft Defences of the Second World War, Methuen., 2001
- Fegan, T., The 'Baby Killers': German Air raids on Britain in the First World War, Leo Cooper Ltd., 2002
- Fleischer, W., German Air-Dropped Weapons to 1945, Midland Publishing., 2004
- Jappy, M. J., Danger UXB: The Remarkable Story of the Disposal of Unexploded Bombs during the Second World War, Channel 4 Books., 2001
- Morris, J., German Air Raids on Britain: 1914 – 1918, The Naval & Military Press., 1993
- Price, A., Blitz on Britain, The Bomber Attacks on the United Kingdom 1939 – 1945, Purnell Book Services Ltd., 1977
- Ramsey, W., The Blitz Then and Now, Volumes 1,2 & 3, Battle of Britain Prints International Ltd., 1987, 1988 & 1990
- Scofield, J., Modern Military Matters., Council for British Archaeology., 2004
- Stone, K., et al., Unexploded Ordnance (UXO) A Guide For The Construction Industry (C681), CIRIA, 2009
- Whiting, C., Britain Under Fire: The Bombing of Britain's Cities 1940-1945, Pen & Sword Books Ltd., 1999


This report has been prepared by 1st Line Defence Limited with all reasonable care and skill. The report contains historical data and information from third party sources. 1st Line Defence Limited has sought to verify the accuracy and comprehensiveness of this information where possible but cannot be held accountable for any inherent errors. Furthermore, whilst every reasonable effort has been made to locate and access all relevant historical information, 1st Line Defence cannot be held responsible for any changes to risk level or mitigation recommendations resulting from documentation or other information which may come to light at a later date.


This report was written by, is owned by and is copyrighted to 1st Line Defence Limited. It contains important 1st Line Defence information which is disclosed only for the purposes of the client's evaluation and assessment of the project to which the report is about. The contents of this report shall not, in whole or in part be used for any other purpose apart from the assessment and evaluation of the project; be relied upon in any way by the person other than the client, be disclosed to any affiliate of the client's company who is not required to know such information, nor to any third party person, organisation or government, be copied or stored in any retrieval system, be reproduced or transmitted in any form by photocopying or any optical, electronic, mechanical or other means, without prior written consent of the Managing Director, 1st Line Defence Limited, Unit 3, Maple Park, Essex Road, Hoddesdon EN11 0EX. Accordingly, no responsibility or liability is accepted by 1st Line Defence towards any other person in respect of the use of this report or reliance on the information contained within it, except as may be designated by law for any matter outside the scope of this report.

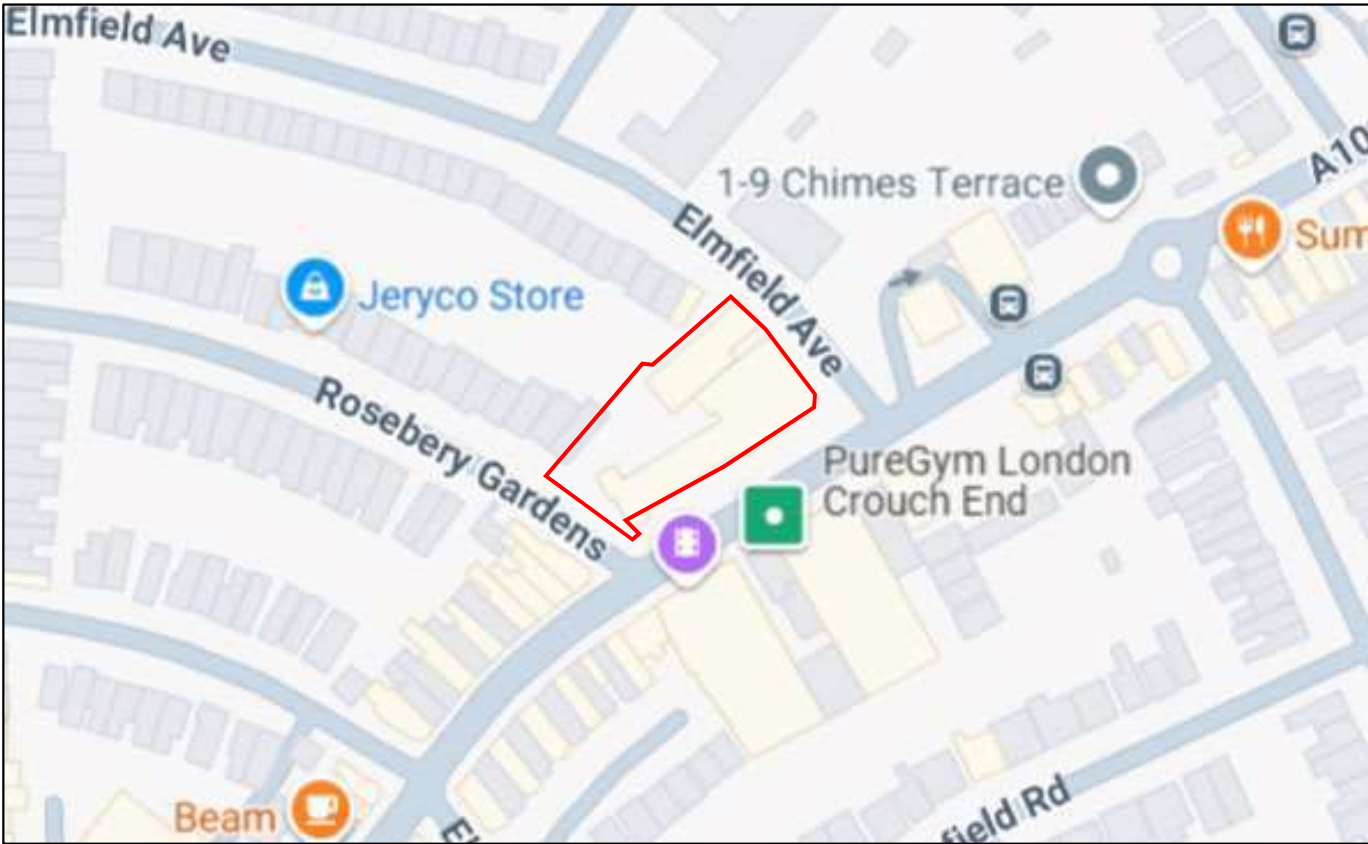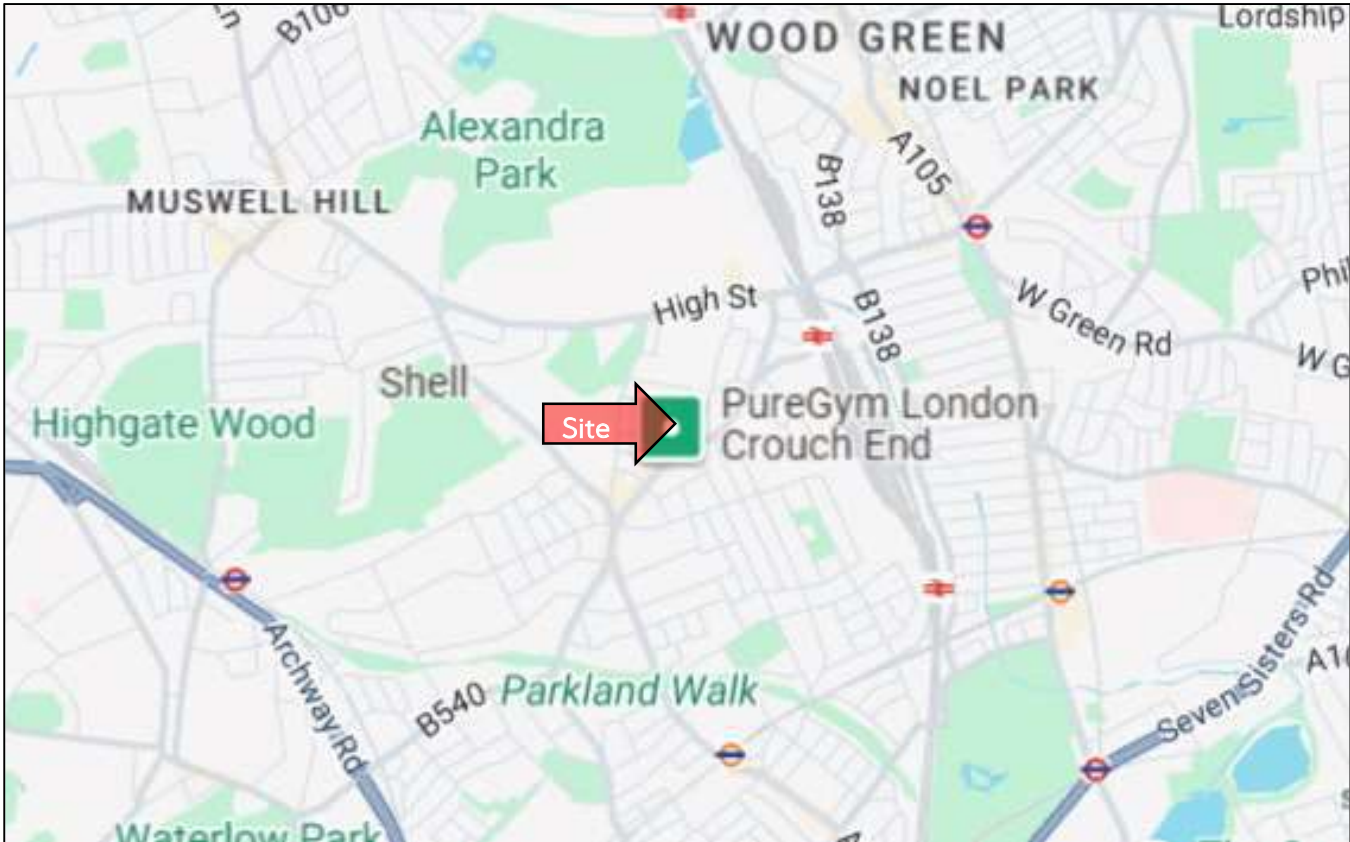






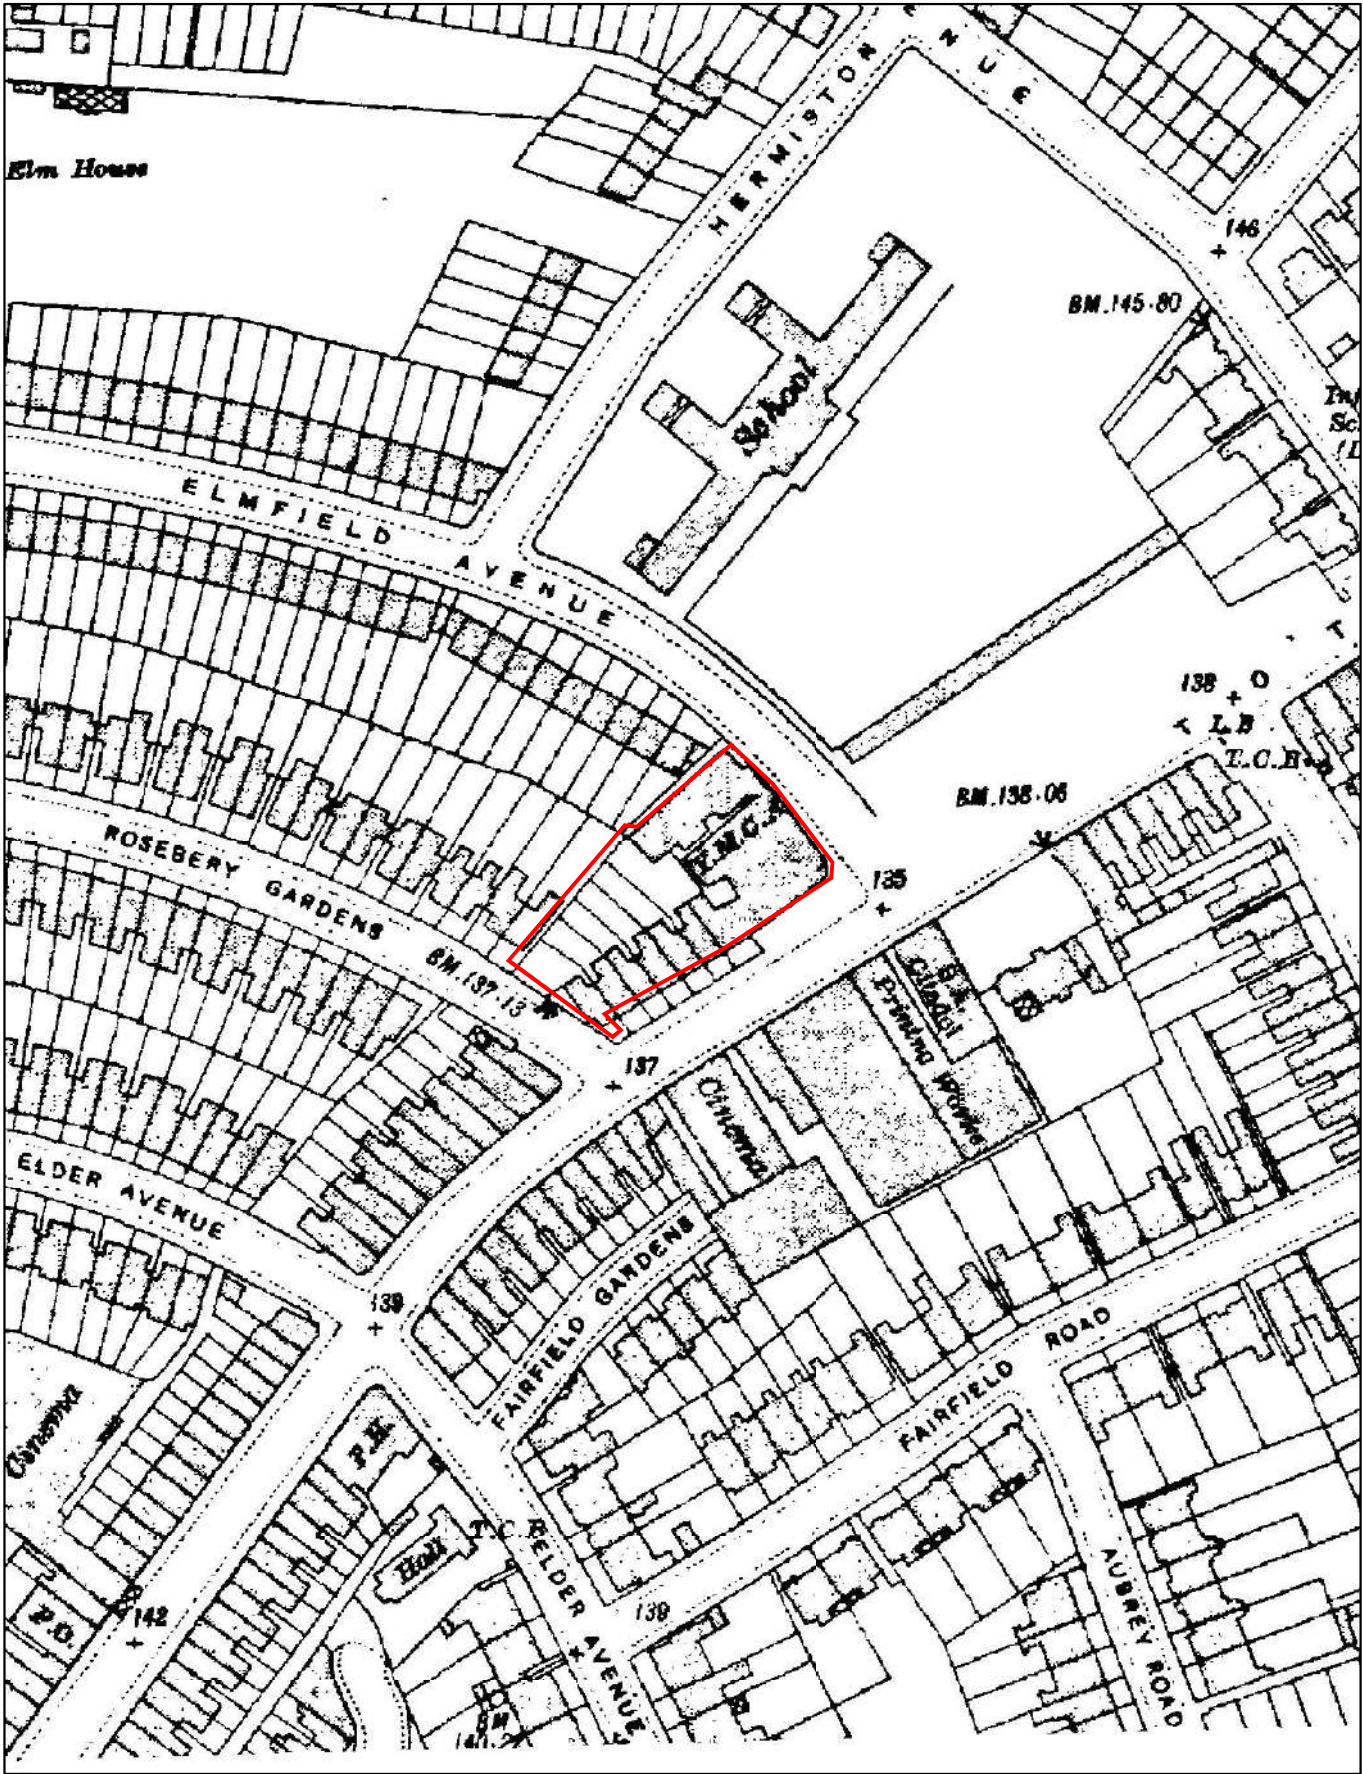

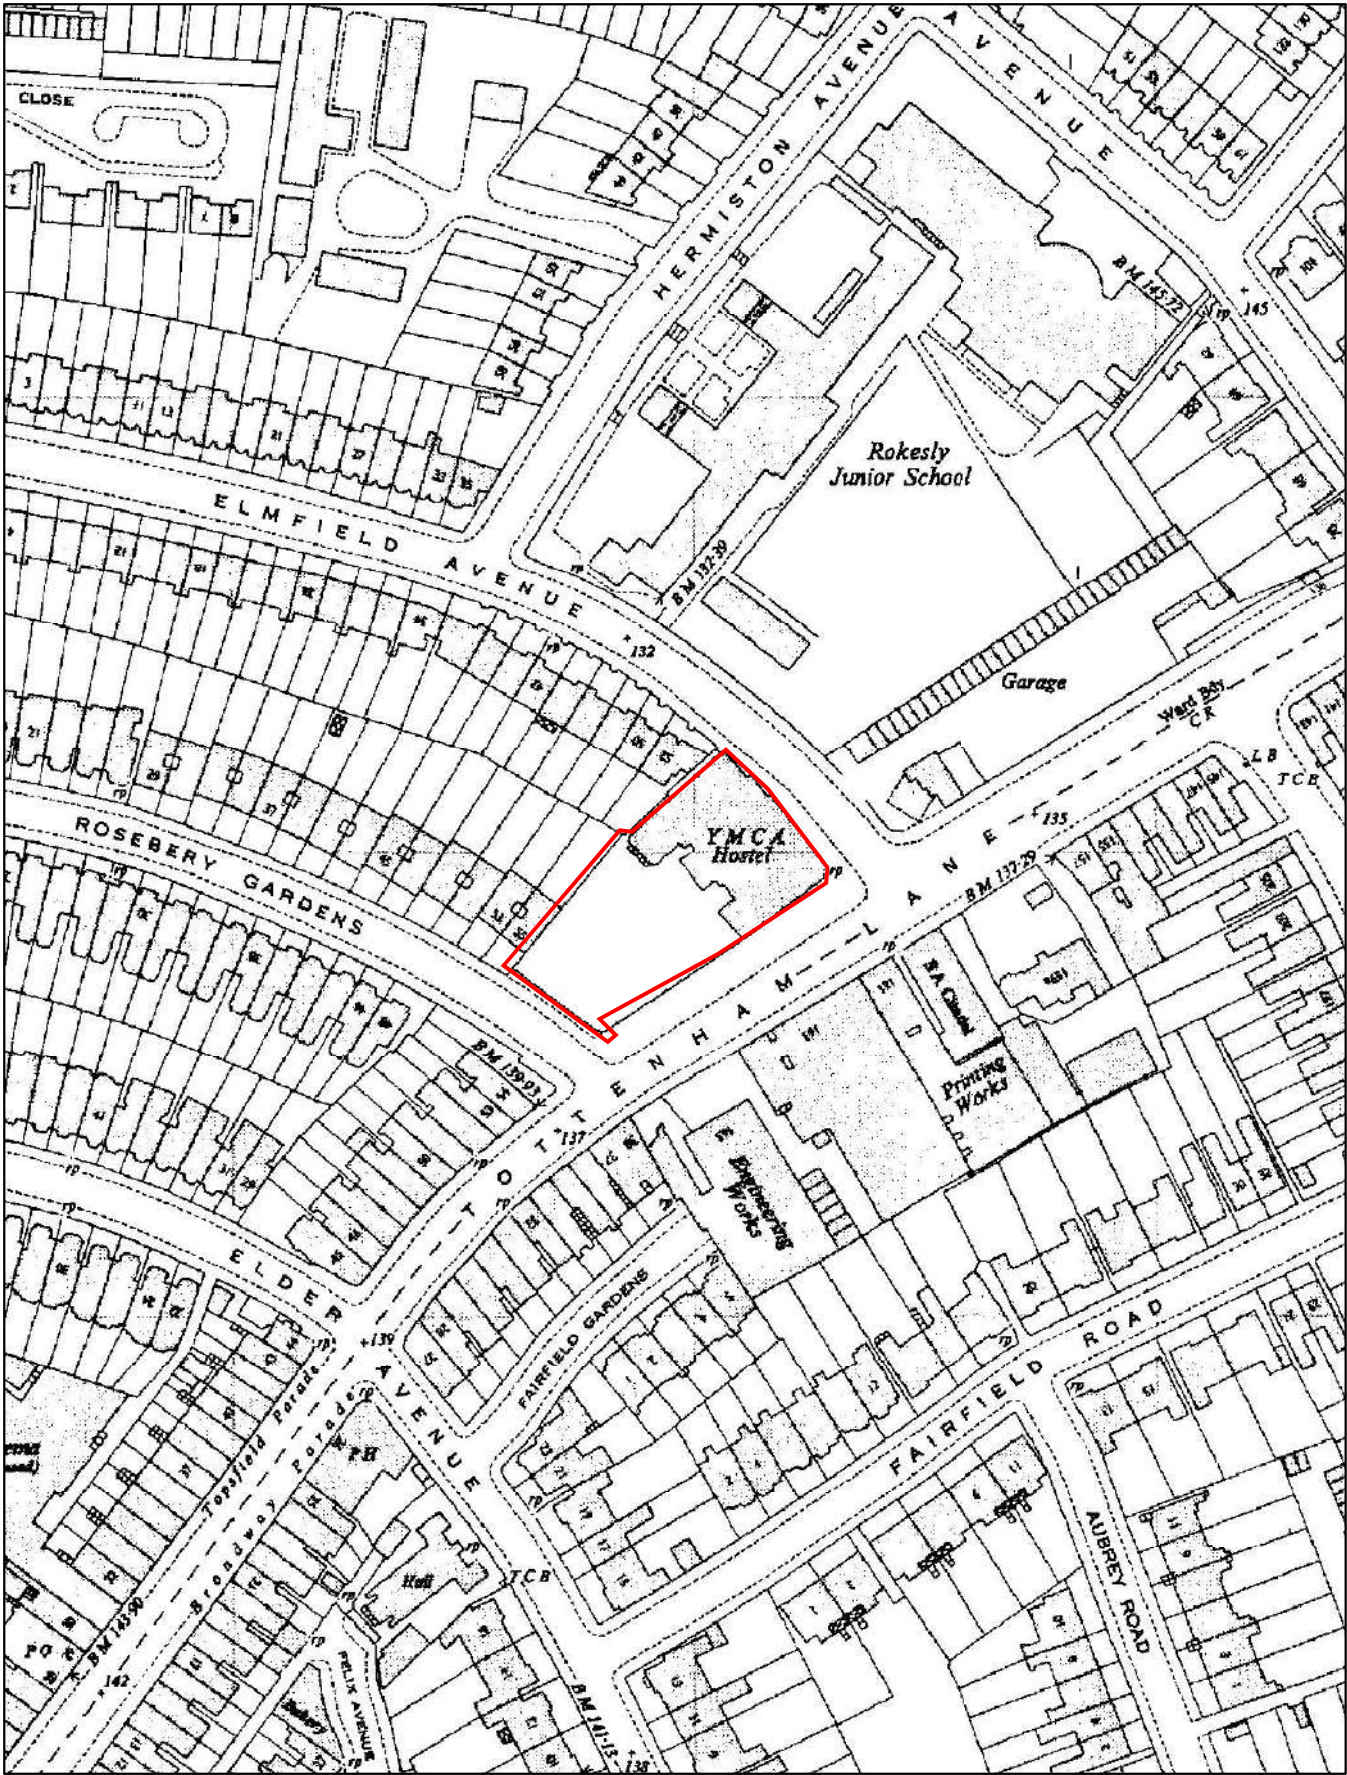

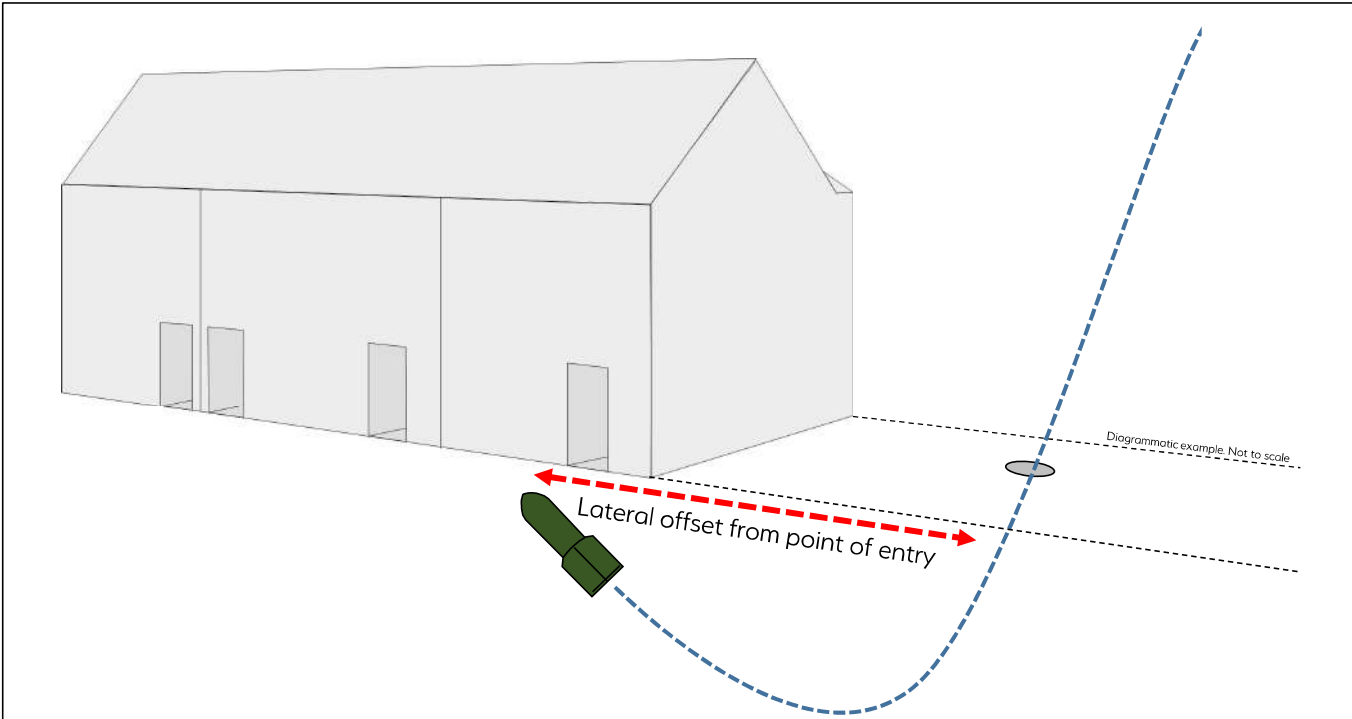

Top: J-curve Effect - Due to angle of entry, unexploded bombs would often end their trajectory at a lateral offset from point of entry, often ending up beneath adjacent extant structures/sites.



The photograph **above** shows a 250kg unexploded bomb found in Bermondsey in 2015, pointing upwards, demonstrating 'J-curve'.

One of the most common scenarios for UXO going unnoticed was when a UXB fell into a 'bomb site' (such as the area shown **Top Left**), the entry hole of the bomb obscured by any debris and rubble present. Note that the entry hole of a 50kg UXB could be as little as 20cm in diameter (**Left**).

BBC

NEWS

WW2 bomb found near London City Airport blown up



An unexploded World War Two bomb found near London City Airport has been detonated.

The 500kg device was discovered at the King George V Dock on Sunday during planned work at the airport.

It was closed and all flights were cancelled on Monday after an exclusion zone was put in place.

The detonation, which took place off Shoeburyness, Essex, was postponed on Tuesday because of high winds and dangerous conditions for divers.

The 1.5m-long German bomb - which was found in a bed of silt, 15m underwater - was carefully removed from the Thames and placed in a secure location a mile away from the coast of Essex.

500kg German HE Bomb, February 2018

BBC

NEWS

Exeter WW2 bomb is detonated after homes evacuated



More than 2,600 households and 12 university halls of residence were cleared before the 2,200lb (1,000kg) device was destroyed on Saturday.

Police said the blast left a crater about the size of a double-decker bus.

Police have reported large pieces of metal debris hitting buildings and said some properties in the 100m (330ft) exclusion zone had sustained "structural damage".



1000kg German HE bomb, February 2021

BBC

NEWS

Great Yarmouth: Huge blast after unplanned WW2 bomb detonation



A World War Two bomb found in Great Yarmouth has detonated while work was being done to defuse it, causing a huge blast that was heard for miles.

Army specialists were attempting to disarm it when there was an unplanned detonation at about 17:00 GMT.

People on social media said they heard a loud bang and felt buildings shake 15 miles (24km) away.

There have been no reports of injuries among the Army, emergency services or the public, Norfolk Police said.

Cordons were put in place when the bomb was first discovered close to two gas pipes on Tuesday, and work began to make it safe.

250kg German HE Bomb, February 2023

BBC

NEWS

Plymouth unexploded WW2 bomb: Thousands of people displaced



A 500kg (1,102lb) German World War Two bomb that forced the evacuation of thousands of people in Plymouth has been detonated at sea.

The unexploded device was found in a garden on St Michael Avenue on Tuesday, sparking four days of disruption.

On Friday police closed roads and rail and bus services were stopped as the bomb was transported 1.4 miles (2.3km) through the city's streets.

The device was taken by boat beyond the breakwater and detonated at 21:51 GMT.



500kg German HE Bomb, February 2024

BASF has confirmed that an explosive device, most likely a World War II-era bomb, caused the blast that left one person injured Tuesday at a plant construction site in Germany.

The explosion was reported at BASF's Ludwigshafen toluene diisocyanate (TDI) plant, which recently broke ground for a 300,000 metric tons per year TDI production plant and other construction to expand its facilities.



BASF Provides Some Details

Responding to a request from *PaintSquare News* for more information on Wednesday (Feb. 27), BASF's manager of media relations and corporate communications Europe, Ursula von Stetten, wrote in an email, "So here [are] the facts: The detonation took place at 10:00 a.m. One person was injured; the injury is not serious. He will be kept in the hospital for some days.

"Cause of the detonation was an explosive device, presumably a bomb deriving from the Second World War. The device detonated when grounding work was done. No details on [a] delay [are] available. At the moment, the exact circumstances of the incident are [being] evaluated."

1st March 2013

SPIEGEL ONLINE

Blast Kills One

World War II Bomb Explodes on German Motorway

A highway construction worker in Germany accidentally struck an unexploded World War II bomb, causing an explosion which killed him and wrecked several passing cars.



A World War II bomb has exploded during construction work on a German highway, killing one worker and injuring several motorists who were driving past, police said.

The worker had been cutting through the road surface near the south-western town of Aschaffenburg when his machine struck the bomb and triggered it. Police said they weren't sure yet what type of bomb it was. "The explosion seems to have been too small for it to have been an aircraft bomb," a police spokesman said.

23rd October 2006

WWII bomb injures 17 at Hattingen construction site



Seventeen people were injured on Friday when a construction crew unwittingly detonated a buried World War II-era bomb in Hattingen.

An excavator apparently drove over a 250-kilogramme (550 pound) American bomb, damaging surrounding buildings. Most of the injured suffered auditory trauma from the blast, and the excavator operator suffered injuries to his hands, police in the German state of North Rhine-Westphalia said.

"The hole was astoundingly small for such a large bomb full of so many explosives," Armin Gebhard, head of the Arnsberg department for military ordnance removal, told The Local. "But of course it damaged all the surrounding buildings too. We are really happy it wasn't worse."

19th September 2013

BBC NEWS

World War II bomb kills three in Germany



A special commission is investigating the causes of the explosion, while prosecutors are considering whether the team leader should face charges of manslaughter through culpable negligence, the BBC's Oana Lungescu reports from Berlin.

The blast happened an hour before the defusing operation was due to start.

Officials said the three men who died were experienced sappers, or combat engineers, who over 20 years had defused up to 700 bombs.

More than 7,000 people were immediately evacuated when the 500kg bomb was found. Several schools, a kindergarten and local companies remain closed.

2nd June 2010



June 2006

Unexploded hand grenade found in Hampstead Heath pond

Detonation creates 'pantomime' puff of smoke on banks of Heath pond

Saturday, 12th December 2020 — By [Harry Taylor](#)



A cordon was put up by police while the bomb was detonated on Saturday lunchtime

PART of Hampstead Heath was sealed off by police on Saturday lunchtime after anglers hooked an unexploded Second World War hand grenade from a Heath pond.

Detectives and officers from the Metropolitan Police's bomb disposal squad were called to the Heath's number 2 pond just before 11:30am, after a fisherman using a magnet accidentally picked up the grenade. It is believed to be a type-36 "Mills Bomb" explosive from the Second World War.

Michele Martin was out shopping for a Christmas tree with her 19-year-old son near Hampstead Heath overground station, when she saw five police cars and two vans race up South Hill Park.


The 54-year-old said: "It was obviously something. Then we were walking back to the car park and noticed that they had started to cordon off the area with police tape all around the pond.

Robert Barta, who was fishing with friends near the path between Hampstead 1 and 2 ponds, said: "Police started to come down [From South Hill Park Gardens], and asked us if we had given them the call. We said no, and they went over to the two guys. I asked them what had happened, and they said they had pulled out a hand grenade."

As detectives sealed off the area while they dealt with the recently retrieved explosive, dozens of onlookers broke from their Christmas shopping and Saturday morning walks to see what was going on.

"There were two guys, both of them were in camouflage flack looking like fishermen," said Ms Martin. "They were two brothers from Watford who had come down for the day. The one had found two pennies and had pulled out this pineapple-shaped thing. He was a bit scared and they called the police and they came really quickly.

"There were a lot of people, a lot of families out for Christmas with babies, buying trees and stuff. Some people were stopping and saying: 'Oh we'd better get away if it's an unexploded bomb', and moving off quite quickly, some watching, some people saying to the fishermen: 'Thank you so much, that's such a dangerous thing to have around here, you're a hero'."

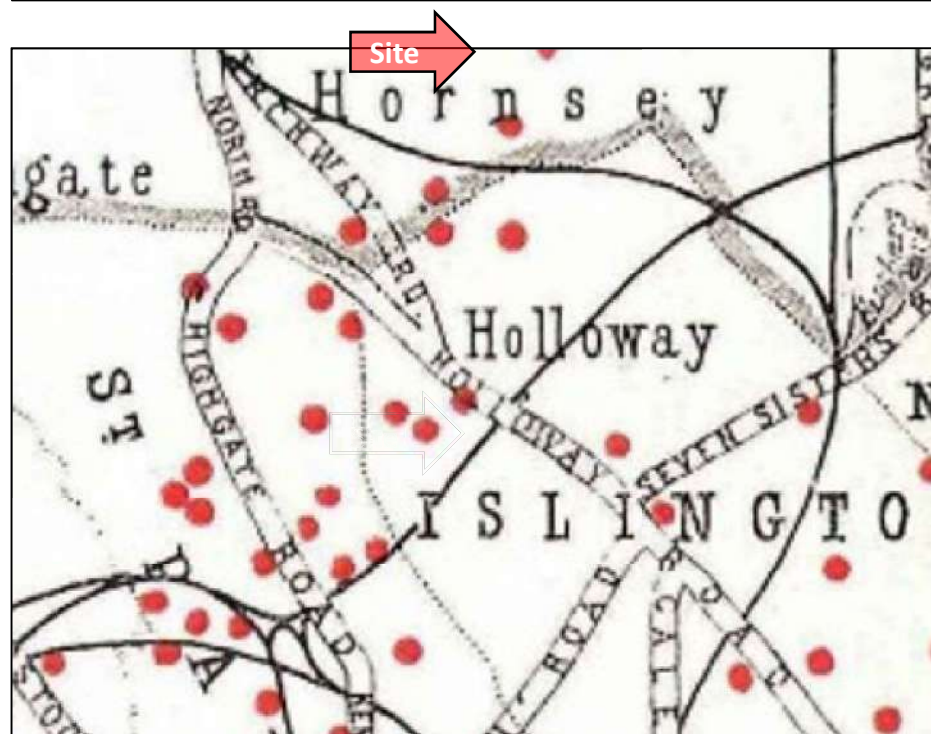


Examples of 50 and 100kg German WWI bombs



A zeppelin is recorded to have passed approximately 100m west of the site, though no bomb strikes are indicated nearby.



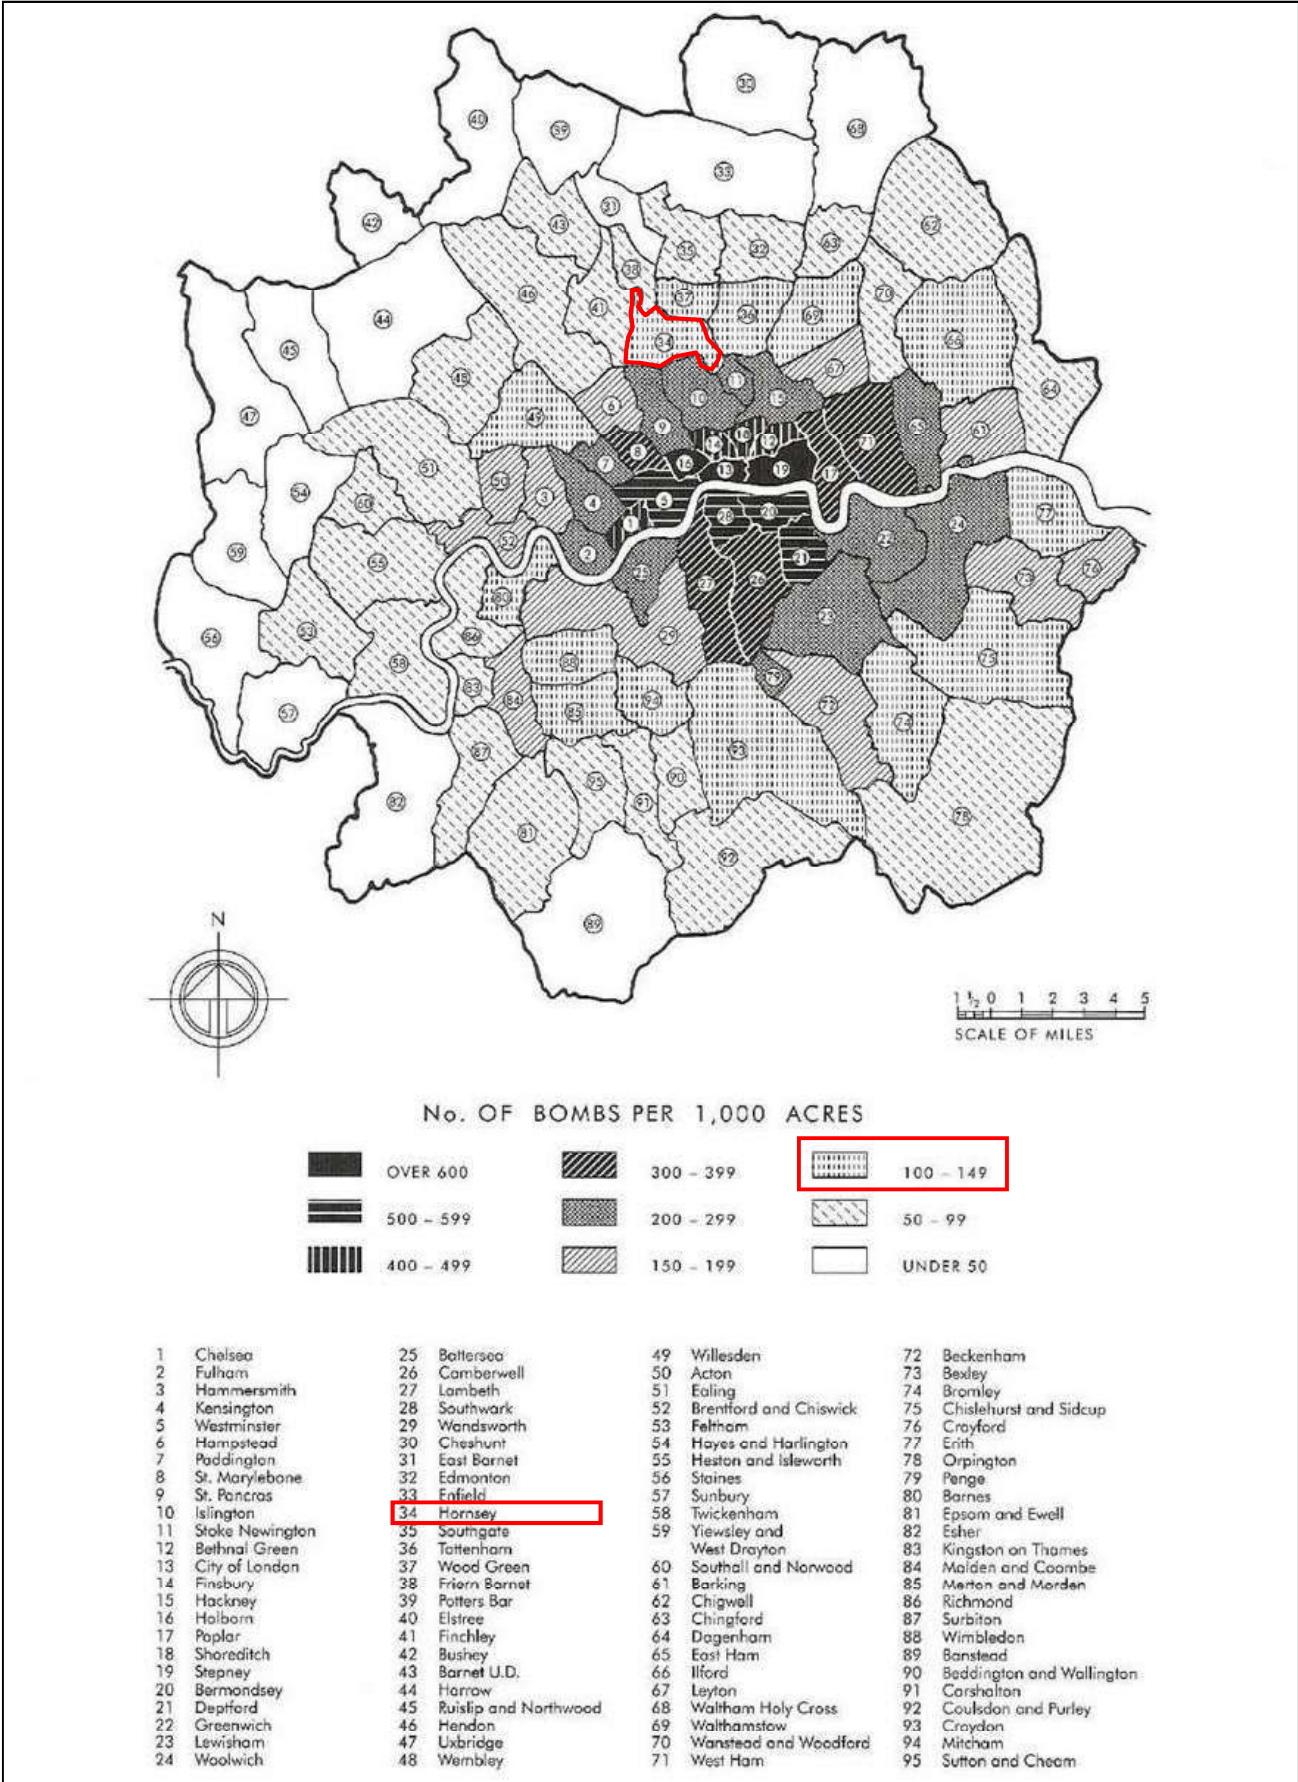

1ST LINE DEFENCE

Unit 3, Maple Park,
Essex Road, Hoddesdon,
Hertfordshire. EN11 0EX
Email: info@1stlinedefence.co.uk
Tel: +44 (0)1992 245 020

Client: YMCA London City and North

Project: YLCAN – Crouch End

Ref: DA22141-00

Source: The London Archives





London – Tottenham
A. Water Treatment Works and Reservoir

The site, outside of the scope of this photograph, is located approximately 4.4km west of the Tottenham water treatment works and reservoir.