

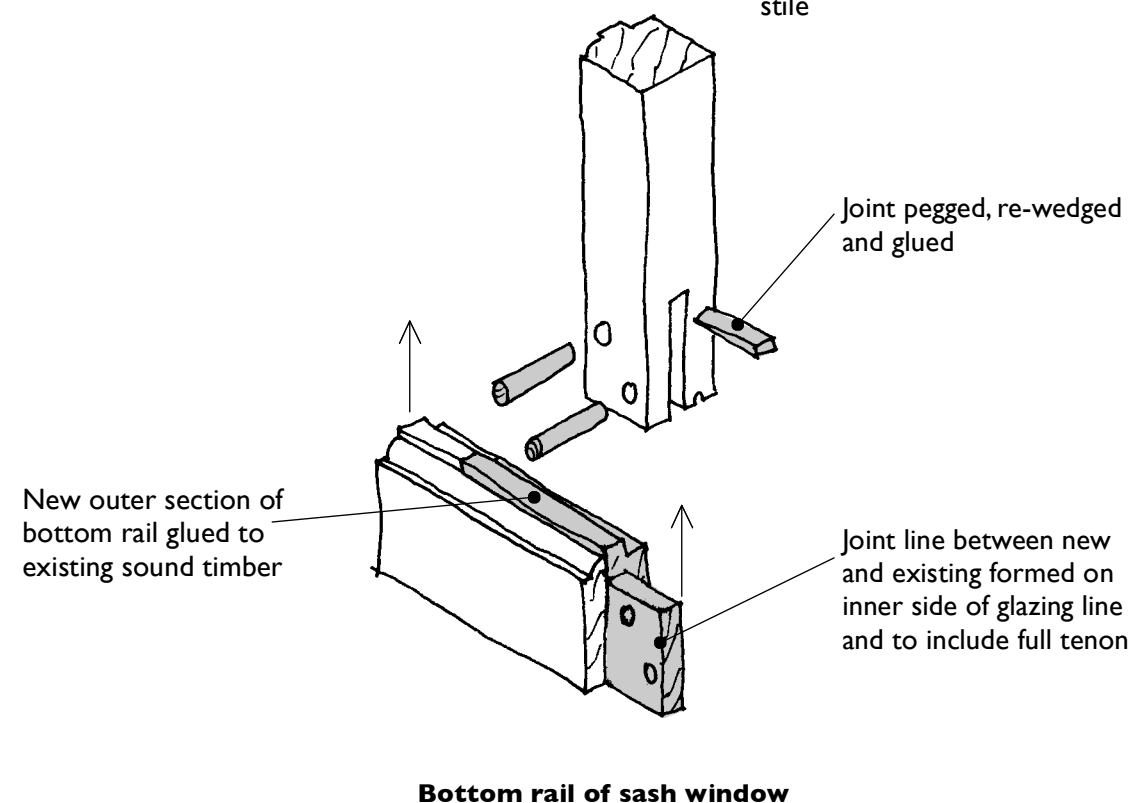
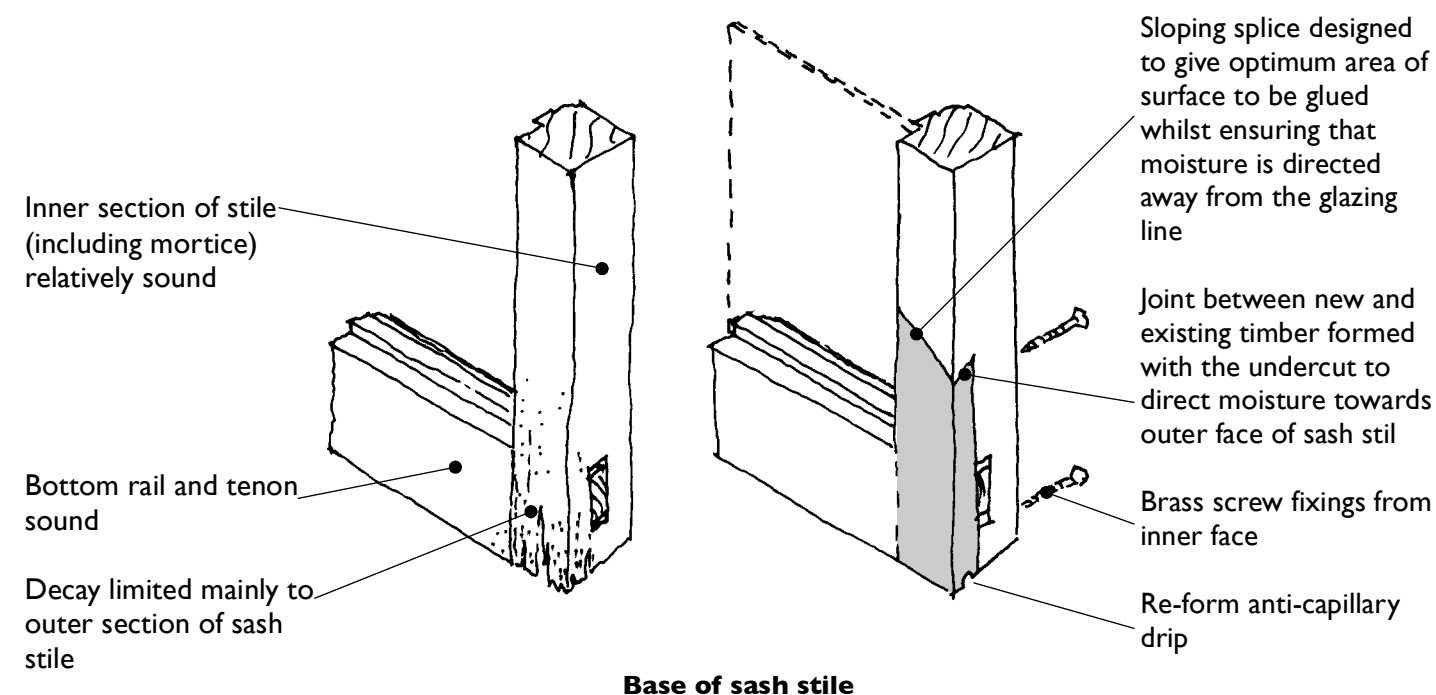


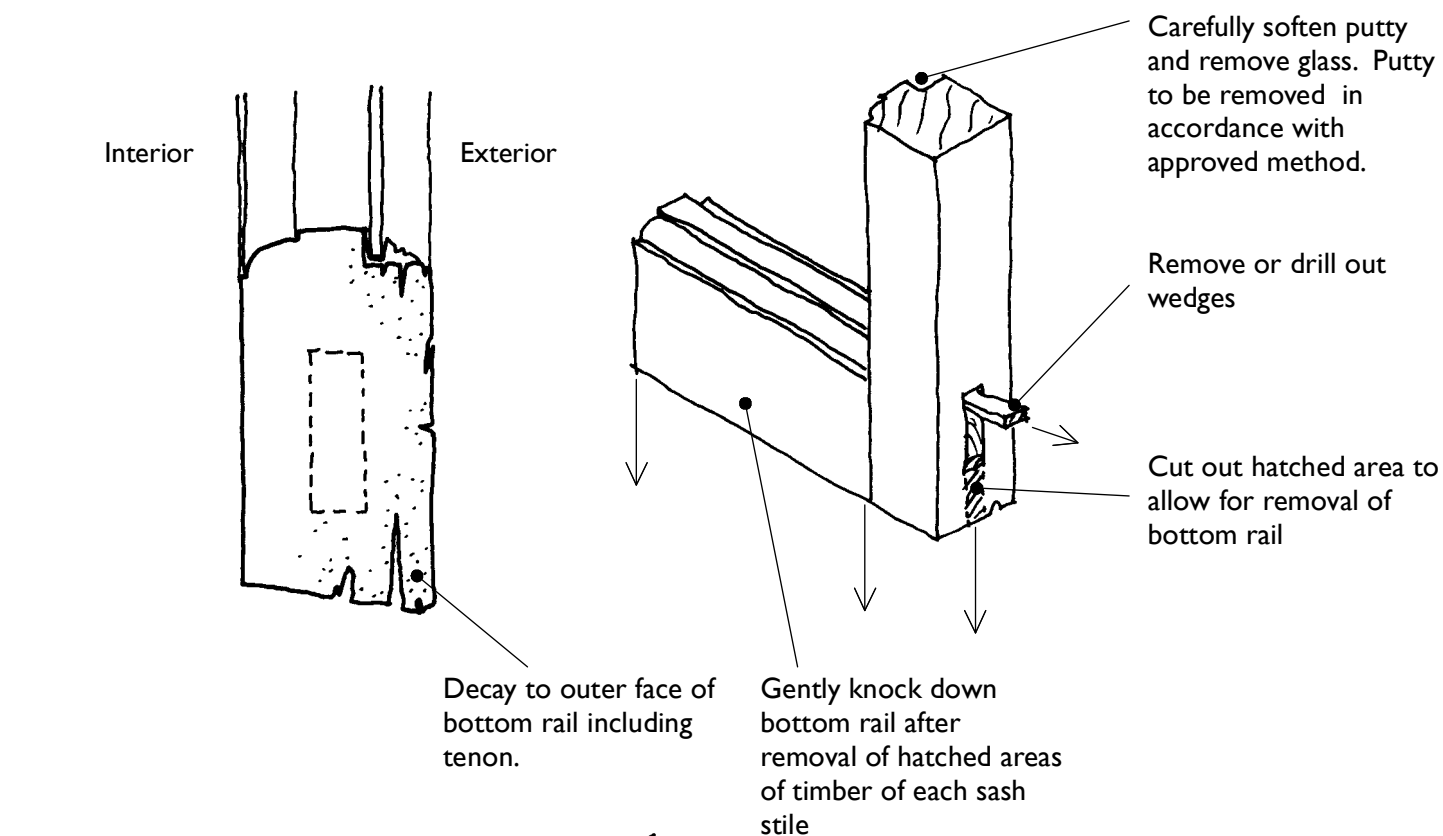

Note:
Method for repairing bottom rail with dismantling sash. Same technique may be used for replacement of entire bottom rail.

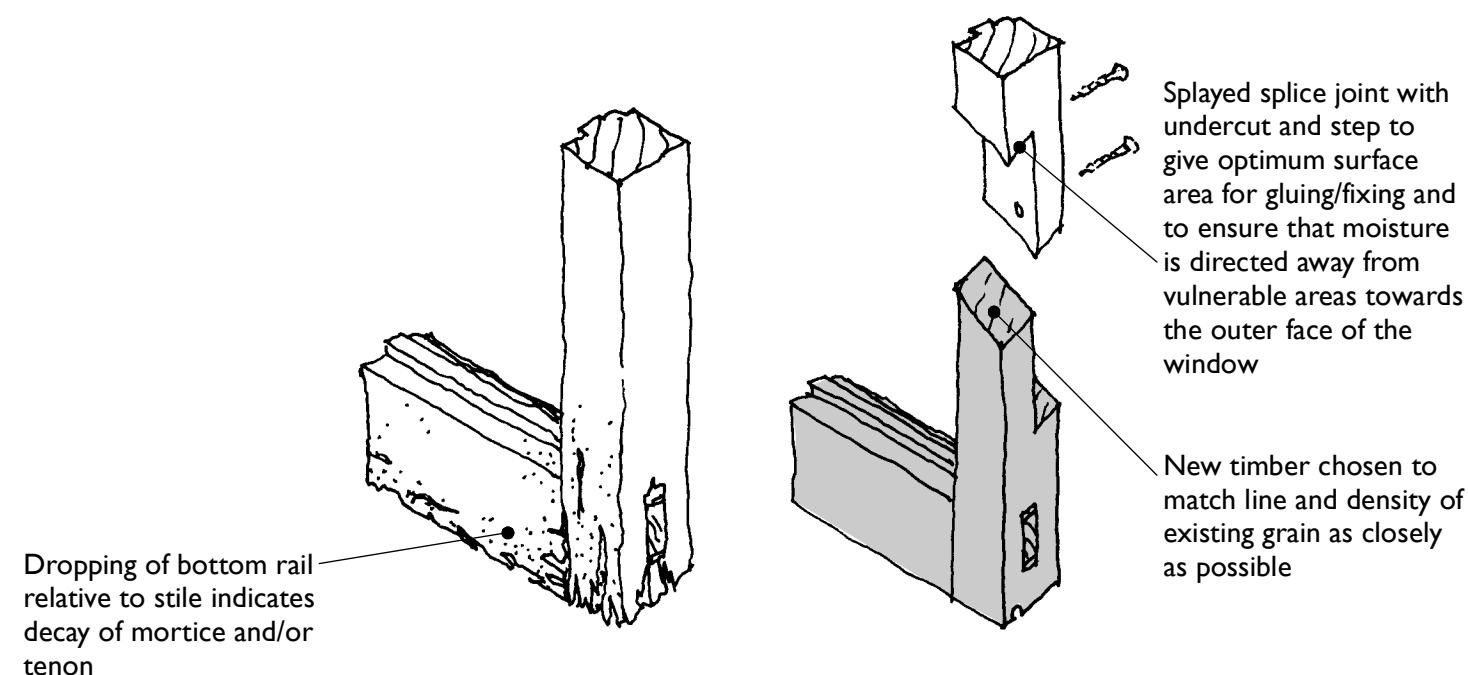

Acknowledgement
This drawing is based on drawings illustrating 'The Repair of Wood Windows', SPAB Technical Pamphlet 13, by Andrew Townsend and Martyn Clarke, published by SPAB

NOTE

1. This drawing is copyright.
2. All dimensions must be checked on site before proceeding.
3. Dimensions of new work are to be adjusted to suit the existing building where necessary. Do not assume that the existing structure or details are plumb, square or level.
4. The contractor must report any discrepancies to the architect before proceeding.

10 EUSTON PLACE
LEAMINGTON SPA
WARWICKSHIRE
CV32 4LJ
T 01926 881311
F 01926 451766
E architects@rmpuk.com

Rodney Melville + Partners
CHARTERED ARCHITECTS
HISTORIC BUILDING CONSULTANTS
www.rmpuk.com
Rodney Melville and Partners Limited

Project Bruce Castle

Drawing Sash Window Repair Detail - Sheet 3
Bottom Rail and Sash Repairs

Scale	NTS	Job No	7440
Date	Nov 2023	Drwg No	203
Drawn	RAH	Rev	—