


Highgate Spinney N8 8AR

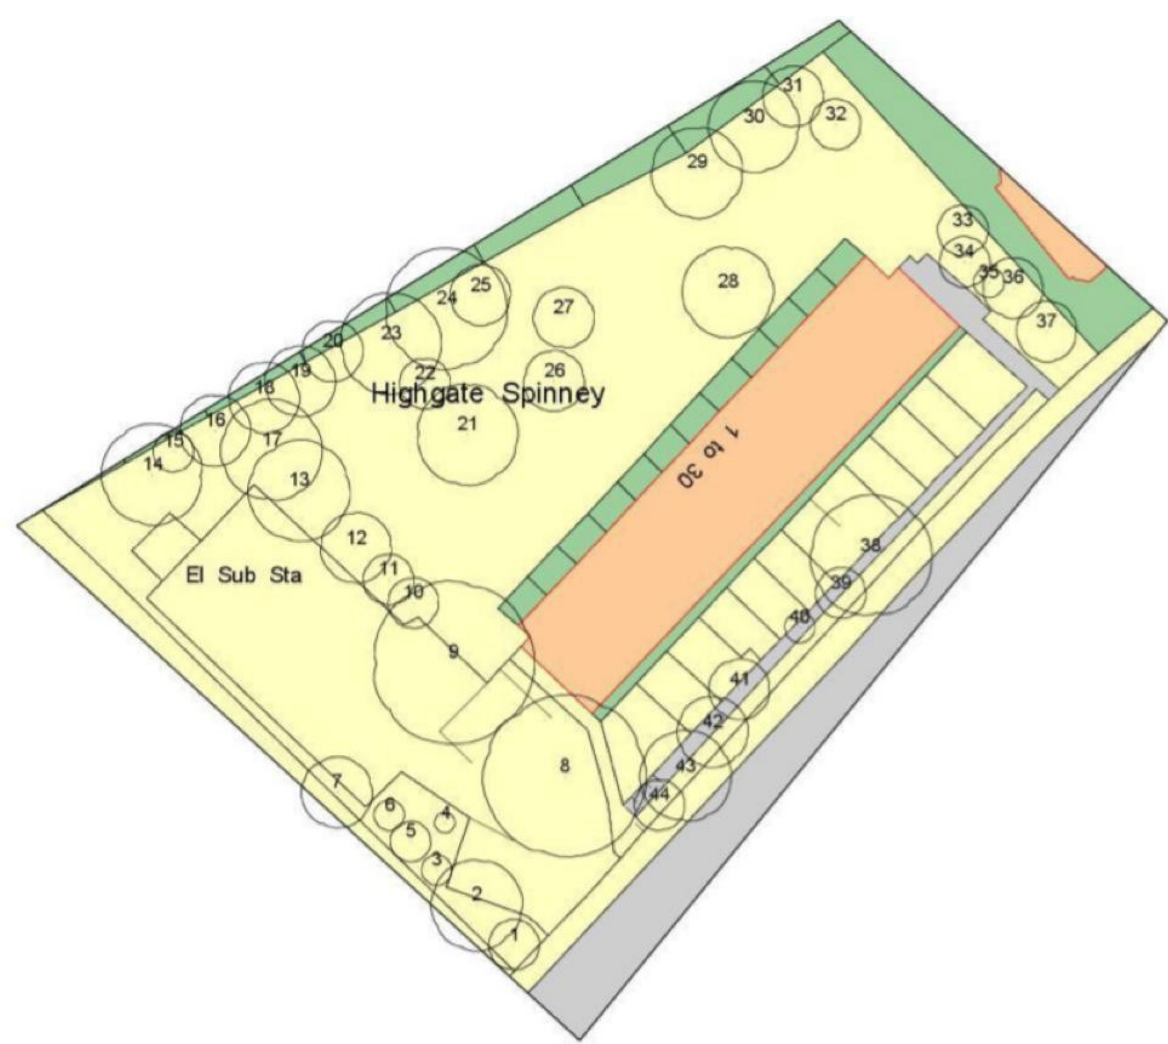

Tree ID	Common Name	Height (m)	DBH (mm)	Crown spread (m)	Age Class	Physiological Condition	Structural Condition	Observations	Recommendation	Priority	I f
1	Mimosa	8	220	5	MA	Good	Good	Co-dominant stem at 1.5m, leaning on fence post. Die back on main stem over road	Remove main stem over road	3	1

44	Rowan	7	230	5	M	Good	Good	Co-dominant stem at 2m, die back in crown	Fell	6	12
----	-------	---	-----	---	---	------	------	---	------	---	----

7	Sycamore	17	320	9	M	Good	Good	Base obscured by pyracantha, co-dominant stem at base. Recently reduced to south west over neighbouring property. Encroaching neighbouring property	Crown reduce by 2m due to close proximity to neighbouring property	6	1
28	Sycamore	20	700	10	M	Good	Good	Recently reduced with moderate regrowth. Old pruning wounds on main stem, crown within 0.5m of building	Crown reduce by 2m on building side	6	12
38	Common Horse Chestnut	17	1000	12	M	Fair	Fair	Heavily reduced in past with dense crown, bleeding canker at base to 1.5m on trunk to south west. Co-dominant stem at 4m.	Re-pollard to previous points	6	12
17	Flowering Cherry	16	300	12	M	Good	Good	Co-dominant stem at 3m, small amounts of minor dead wood	Crown reduce by 2m due to co-dominant stem at 3m and to reduce risk of failure	6	



T1: Mimosa




T44: Rowan



T38: Horse Chestnut



T28: Sycamore

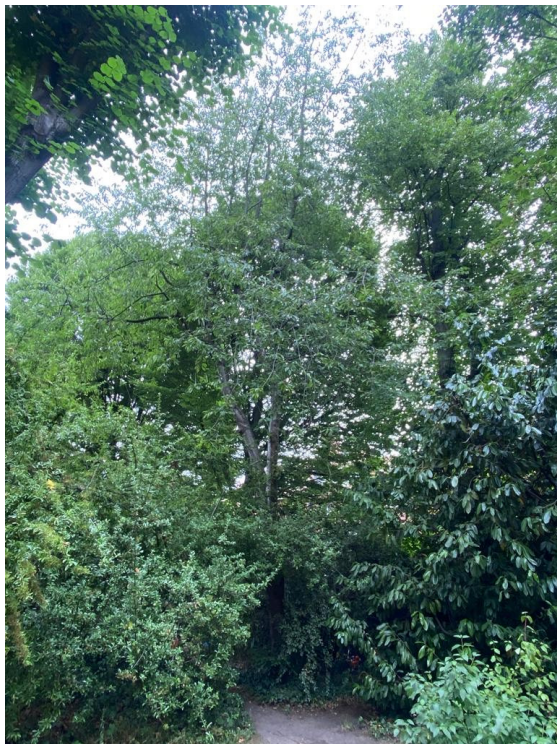

T17: Flowering Cherry



T7: Sycamore