

LEVEL MONITORING

for Subsidence Management Services

112 Mount View Road, London, N4 4JX

Client:	Subsidence Management Services
Client Contact:	Cyril Nazareth
Claim Number:	10312838
Client Reference:	IFS-AVI-SUB-20-0089882
Policy Holder:	Miss Nava Orstein
Report Date:	16 June 2022
Our Ref:	M16529


Level Monitoring Readings



The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8	9	10
15/02/2021	11.1381	11.3058	9.2142	9.2574	10.9080	10.8846	10.9104	10.8169	10.6384	10.4614
30/03/2021	11.1378	11.3057	9.2147	9.2580	10.9091	10.8865	10.9123	10.8192	10.6404	10.4640
14/05/2021	11.1370	11.3053	9.2147	9.2584	10.9088	10.8866	10.9127	10.8201	10.6422	10.4650
30/06/2021	11.1361	11.3047	9.2142	9.2578	10.9078	10.8864	10.9127	10.8204	10.6426	10.4657
16/08/2021	11.1377	11.3057	9.2148	9.2582	10.9087	10.8860	10.9120	10.8200	10.6414	10.4654
30/09/2021	11.1371	11.3045	9.2119	9.2567	10.9068	10.8839	10.9094	10.8166	10.6372	10.4623
18/11/2021	11.1362	11.3038	9.2109	9.2558	10.9059	10.8823	10.9078	10.8149	10.6349	10.4613
11/01/2022	11.1374	11.3042	9.2117	9.2564	10.9064	10.8829	10.9083	10.8157	10.6359	10.4622
01/03/2022	11.1376	11.3046	9.2118	9.2565	10.9073	10.8833	10.9089	10.8162	10.6367	10.4631
25/04/2022	11.1369	11.3043	9.2118	9.2568	10.9076	10.8839	10.9087	10.8167	10.6377	10.4646
14/06/2022	11.1368	11.3052	9.2131	9.2581	10.9082	10.8841	10.9098	10.8172	10.6381	10.4646
Date	11	12	13	14	15	16				
15/02/2021	10.1484	10.1160	10.1017	9.9978	10.0227	10.1299				
30/03/2021	10.1501	10.1164	10.1018	9.9977	10.0225	10.1301				
14/05/2021	10.1509	10.1167	10.1017	9.9976	10.0221	10.1300				
30/06/2021	10.1508	10.1167	10.1016	9.9974	10.0223	10.1296				
16/08/2021	10.1509	10.1169	10.1021	9.9981	10.0230	10.1297				
30/09/2021	10.1489	10.1155	10.1004	9.9964	10.0203	10.1293				
18/11/2021	10.1491	10.1162	10.1016	9.9982	10.0229	10.1305				
11/01/2022	10.1500	10.1169	10.1018	9.9979	10.0232	10.1298				
01/03/2022	10.1513	10.1171	10.1023	9.9985	10.0236	10.1280				
25/04/2022	10.1524	10.1177	10.1024	9.9979	10.0233	10.1269				
14/06/2022	10.1519	10.1174	10.1022	9.9978	10.0218	10.1304				

Level Monitoring Difference Graphs



The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

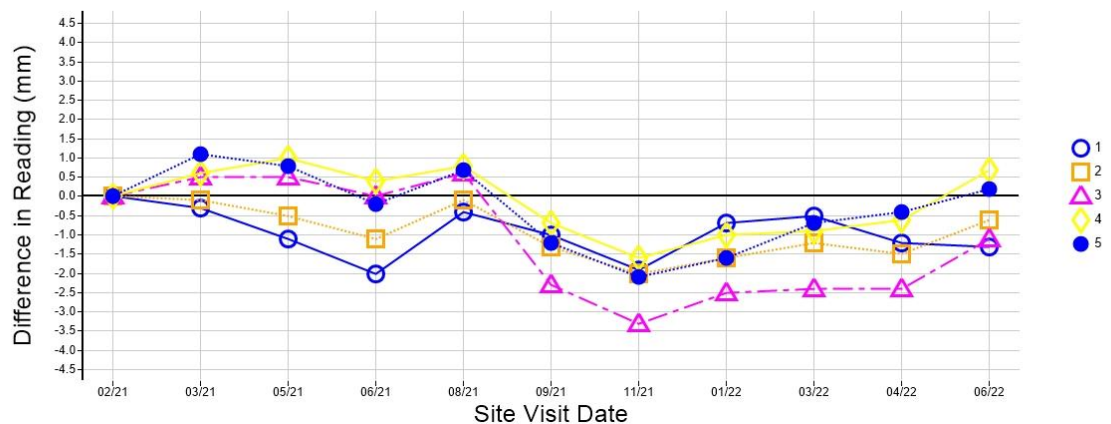

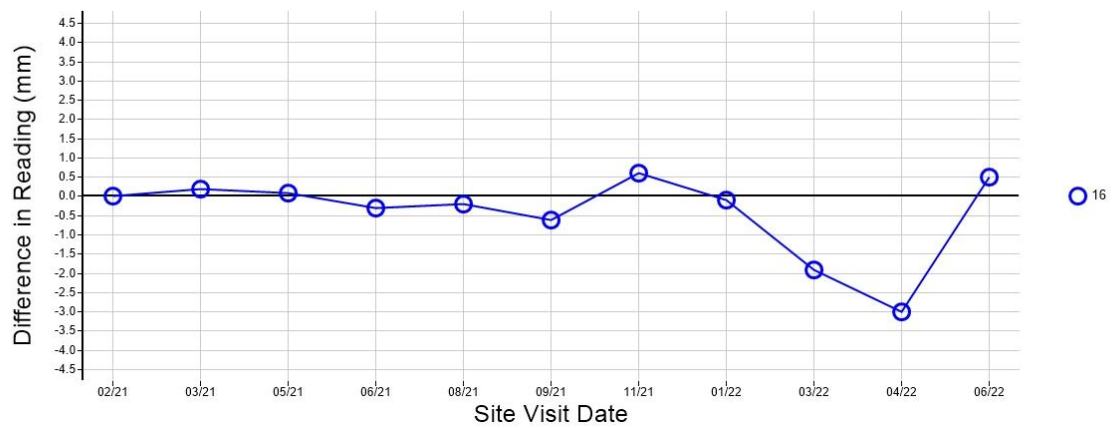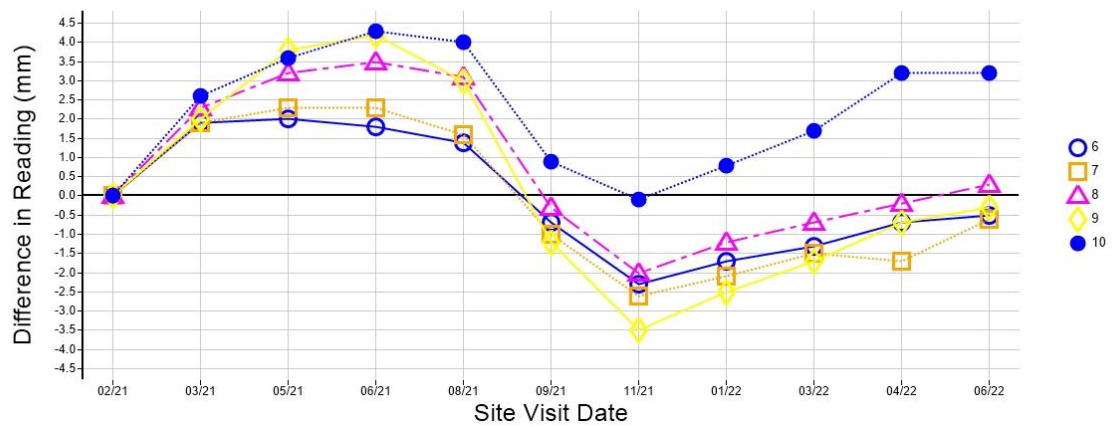

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

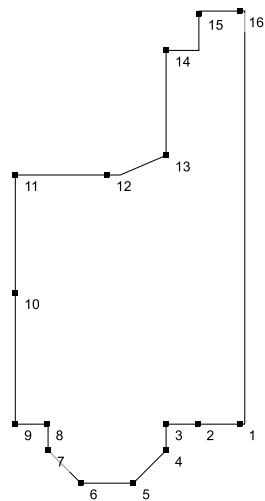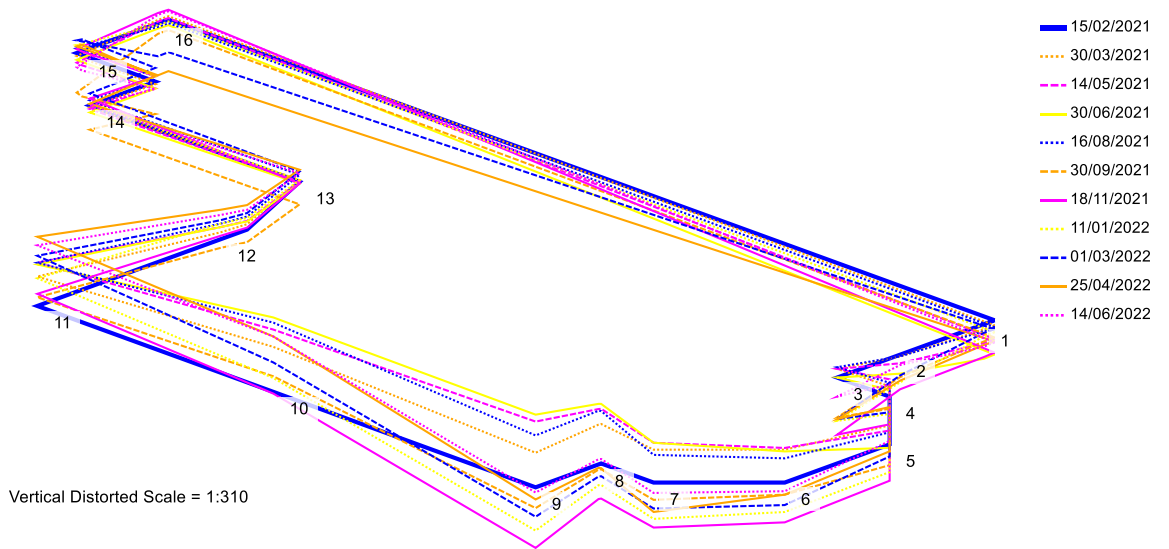

FRONT

Site Visit Notes

Readings are relative to the deep datum in the rear garden next to station eleven. It has an assumed value of 10.0000m.

Site Visit: 30 June 2021

C17 V off - refixed.