


|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-01     |
| HEIGHT    | 2.900     |
| WIDTH     | 2.750     |



|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 5     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-02     |
| HEIGHT    | 2.900     |
| WIDTH     | 3.525     |

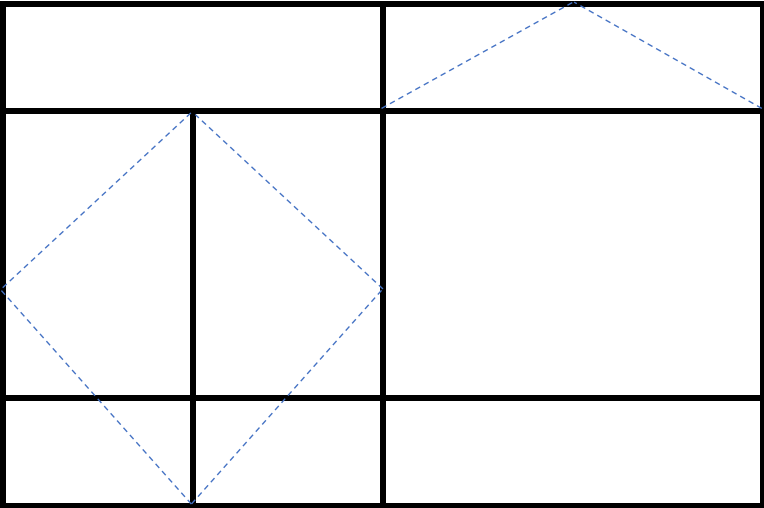

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      | 1 |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 2                    | 2           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE | 1                    | 1           |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-03     |
| HEIGHT    | 2.900     |
| WIDTH     | 3.525     |

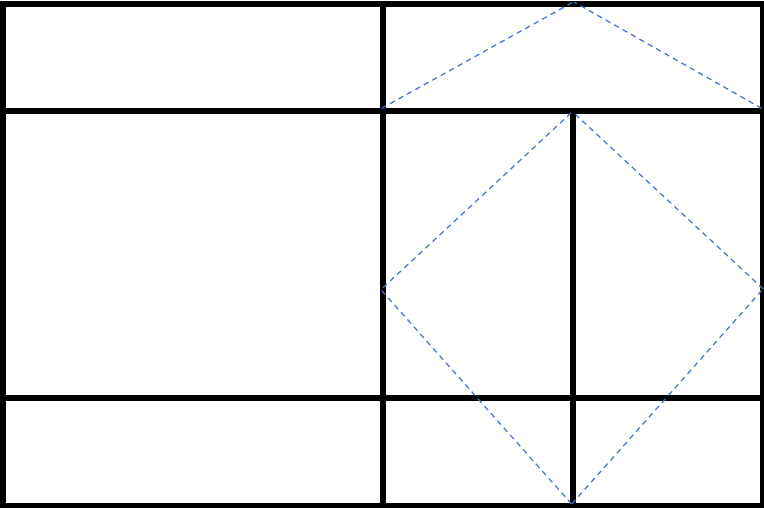

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      | 1 |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |         |
|----------------|----------------------|-------------|-------------------|-----|--|---------|
| IRONMONGERY    |                      |             |                   |     |  |         |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE    |
| TELEFLEX GEAR  |                      | 1           |                   |     |  | WINDING |
| HANDLE         |                      |             |                   |     |  |         |
| VENT LOCK      |                      |             |                   |     |  |         |
| FOLDING OPENER |                      |             |                   |     |  |         |
| CAM FOLLOWER   |                      |             |                   |     |  |         |
| SPRING CATCH   |                      |             |                   |     |  |         |
| DOOR FURNITURE | 1                    | 1           |                   |     |  |         |
|                |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-04     |
| HEIGHT    | 2.900     |
| WIDTH     | 3.525     |

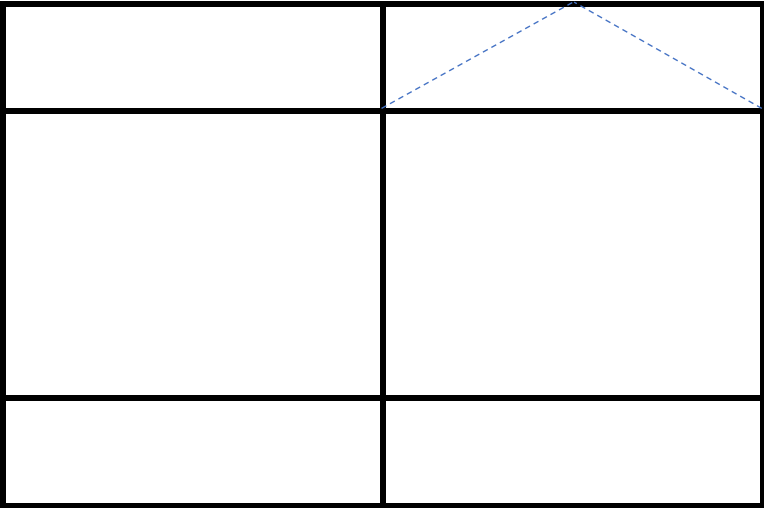

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |  |             |                                     |
|-------------|--|-------------|-------------------------------------|
| ACCESS      |  |             |                                     |
| GOOD ACCESS |  | POOR ACCESS | <input checked="" type="checkbox"/> |
| NO ACCESS   |  | SECONDARY   |                                     |
|             |  |             |                                     |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |         |
|----------------|----------------------|-------------|-------------------|-----|--|---------|
| IRONMONGERY    |                      |             |                   |     |  |         |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE    |
| TELEFLEX GEAR  |                      | 1           |                   |     |  | WINDING |
| HANDLE         |                      |             |                   |     |  |         |
| VENT LOCK      |                      |             |                   |     |  |         |
| FOLDING OPENER |                      |             |                   |     |  |         |
| CAM FOLLOWER   |                      |             |                   |     |  |         |
| SPRING CATCH   |                      |             |                   |     |  |         |
| DOOR FURNITURE |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-05     |
| HEIGHT    | 2.900     |
| WIDTH     | 3.525     |

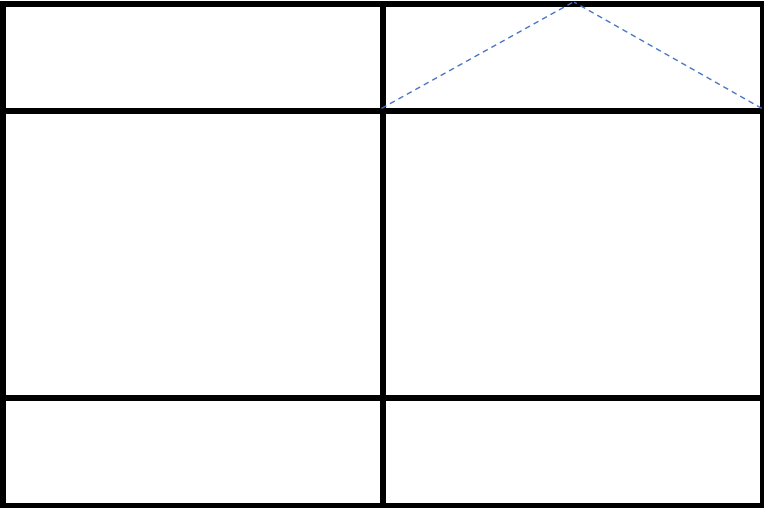

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |  |             |                                     |
|-------------|--|-------------|-------------------------------------|
| ACCESS      |  |             |                                     |
| GOOD ACCESS |  | POOR ACCESS | <input checked="" type="checkbox"/> |
| NO ACCESS   |  | SECONDARY   |                                     |
|             |  |             |                                     |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |         |
|----------------|----------------------|-------------|-------------------|-----|--|---------|
| IRONMONGERY    |                      |             |                   |     |  |         |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE    |
| TELEFLEX GEAR  |                      | 1           |                   |     |  | WINDING |
| HANDLE         |                      |             |                   |     |  |         |
| VENT LOCK      |                      |             |                   |     |  |         |
| FOLDING OPENER |                      |             |                   |     |  |         |
| CAM FOLLOWER   |                      |             |                   |     |  |         |
| SPRING CATCH   |                      |             |                   |     |  |         |
| DOOR FURNITURE |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-06     |
| HEIGHT    | 2.900     |
| WIDTH     | 3.525     |

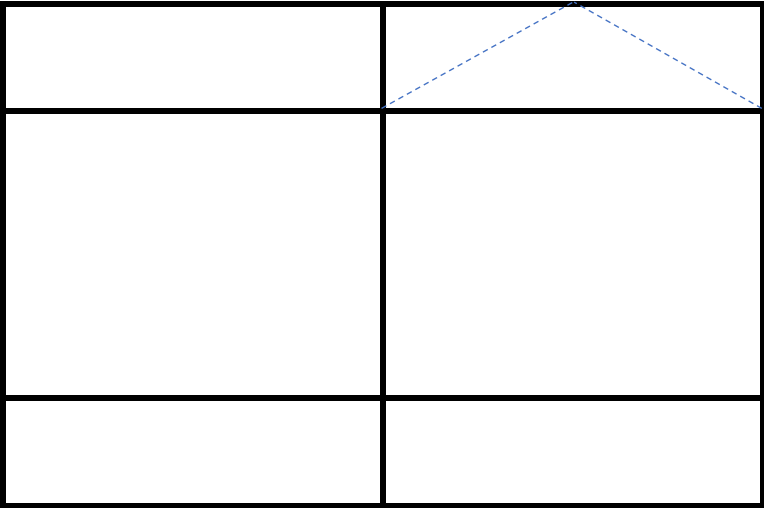

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |  |             |                                     |
|-------------|--|-------------|-------------------------------------|
| ACCESS      |  |             |                                     |
| GOOD ACCESS |  | POOR ACCESS | <input checked="" type="checkbox"/> |
| NO ACCESS   |  | SECONDARY   |                                     |
|             |  |             |                                     |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |         |
|----------------|----------------------|-------------|-------------------|-----|--|---------|
| IRONMONGERY    |                      |             |                   |     |  |         |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE    |
| TELEFLEX GEAR  |                      | 1           |                   |     |  | WINDING |
| HANDLE         |                      |             |                   |     |  |         |
| VENT LOCK      |                      |             |                   |     |  |         |
| FOLDING OPENER |                      |             |                   |     |  |         |
| CAM FOLLOWER   |                      |             |                   |     |  |         |
| SPRING CATCH   |                      |             |                   |     |  |         |
| DOOR FURNITURE |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-07     |
| HEIGHT    | 2.900     |
| WIDTH     | 3.525     |

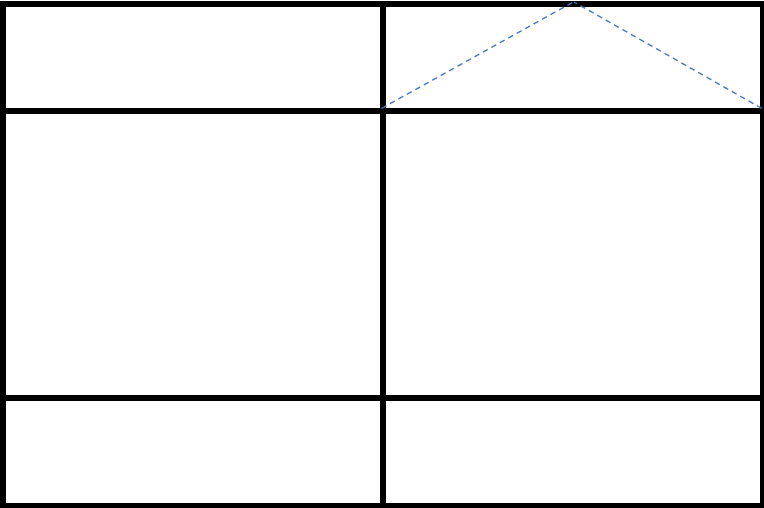

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |  |             |                                     |
|-------------|--|-------------|-------------------------------------|
| ACCESS      |  |             |                                     |
| GOOD ACCESS |  | POOR ACCESS | <input checked="" type="checkbox"/> |
| NO ACCESS   |  | SECONDARY   |                                     |
|             |  |             |                                     |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |         |
|----------------|----------------------|-------------|-------------------|-----|--|---------|
| IRONMONGERY    |                      |             |                   |     |  |         |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE    |
| TELEFLEX GEAR  |                      | 1           |                   |     |  | WINDING |
| HANDLE         |                      |             |                   |     |  |         |
| VENT LOCK      |                      |             |                   |     |  |         |
| FOLDING OPENER |                      |             |                   |     |  |         |
| CAM FOLLOWER   |                      |             |                   |     |  |         |
| SPRING CATCH   |                      |             |                   |     |  |         |
| DOOR FURNITURE |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |
|                |                      |             |                   |     |  |         |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-08     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

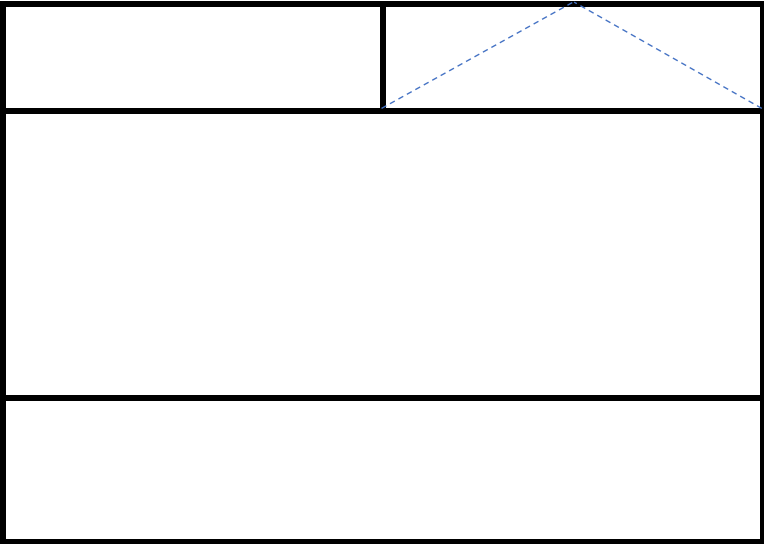

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 4     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   | Lower panel painted                 |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 1           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |




|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
| Painted panel below                         |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-09     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

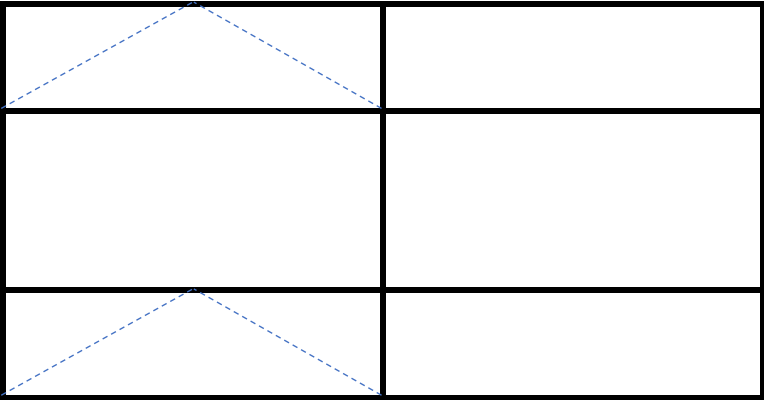

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    |             | 2                 |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    |             | 1                 |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-10     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

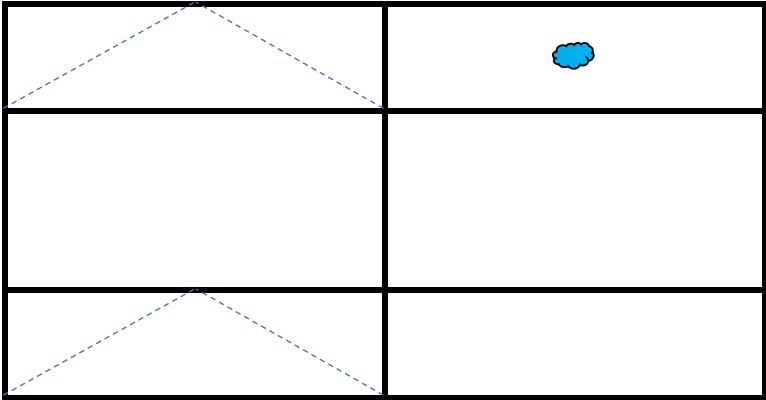

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    | 2           |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
| PEG STAY       |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-11     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

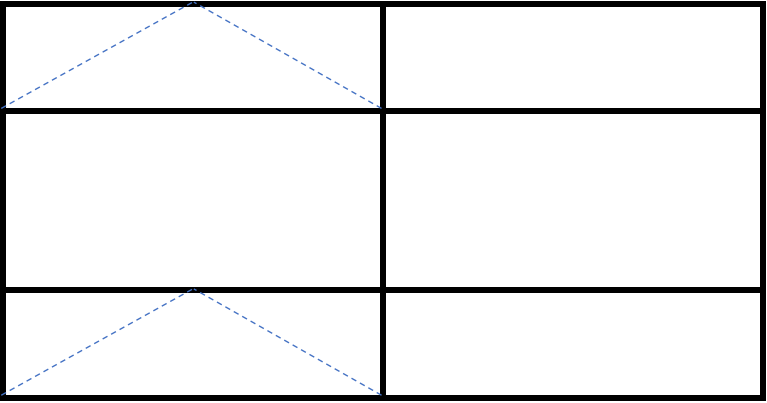

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    | 2           |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
| PEG STAY       |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-12     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

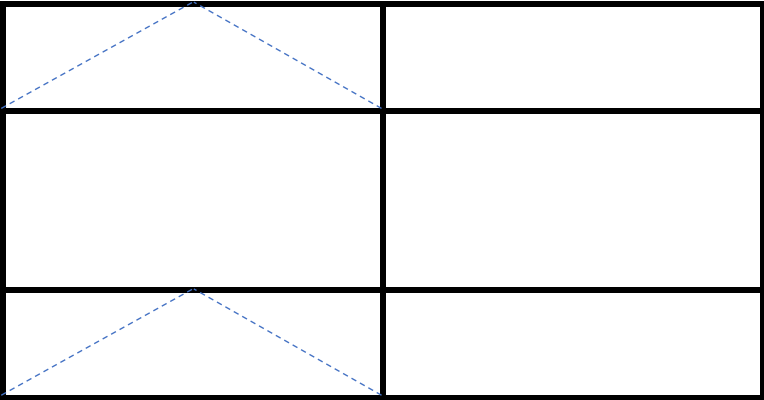

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    | 2           |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |




|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-13     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

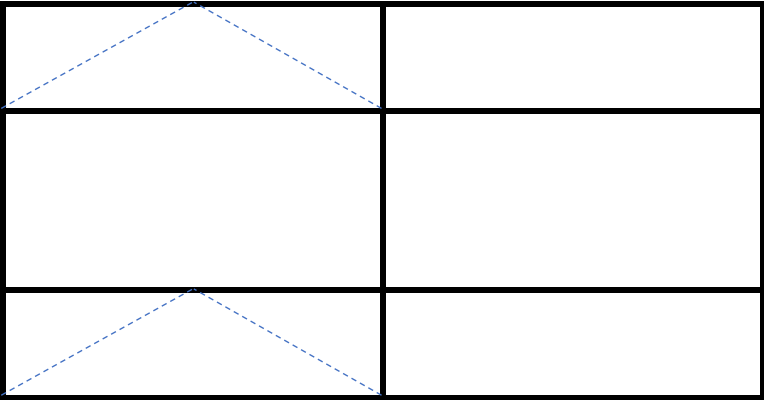

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS |                                     | POOR ACCESS |  |
| NO ACCESS   | <input checked="" type="checkbox"/> | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    | 2           |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|           |
|-----------|
| NOTES     |
| No access |
|           |
|           |
|           |
|           |
|           |
|           |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-14     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

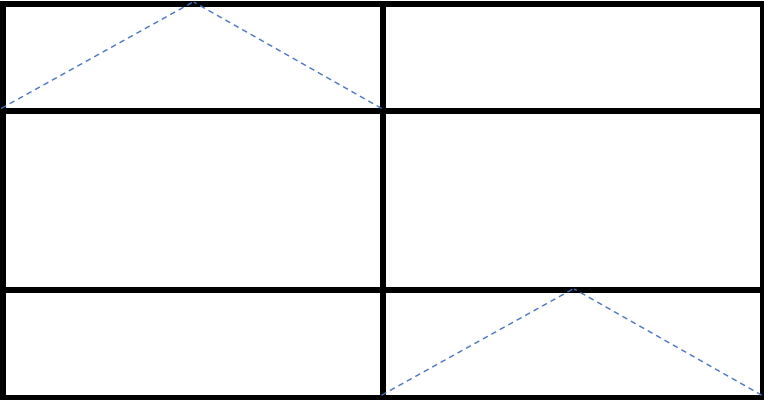

| MATERIAL  |                                     |
|-----------|-------------------------------------|
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

| ACCESS      |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

| OPENING VENTS    |   | FIXED |
|------------------|---|-------|
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

| IRONMONGERY    |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    | 2           |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


| KEY |                             |
|-----|-----------------------------|
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

| NOTES                                       |
|---------------------------------------------|
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

| PHOTOGRAPHIC RECORD |   |  |  |
|---------------------|---|--|--|
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-15     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

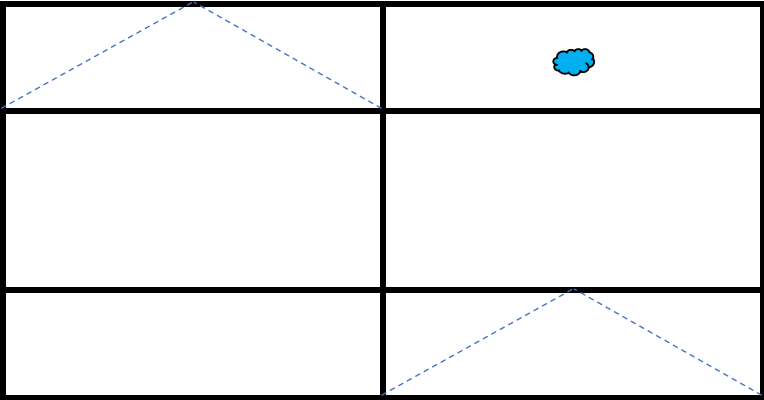

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    | 2           |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-16     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

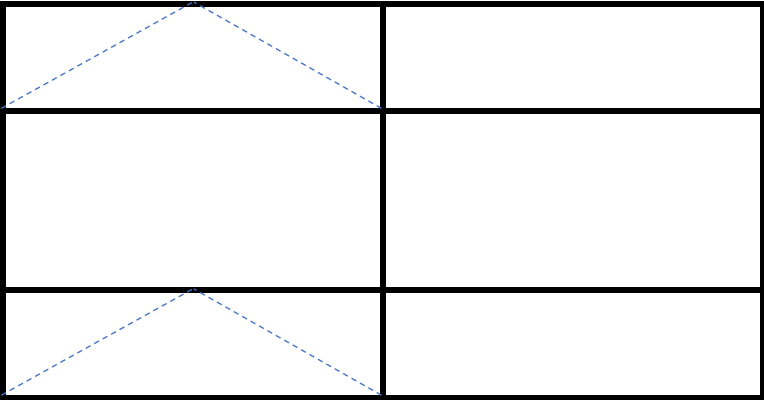

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    | 2           |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | EAST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-17     |
| HEIGHT    | 2.070     |
| WIDTH     | 3.524     |

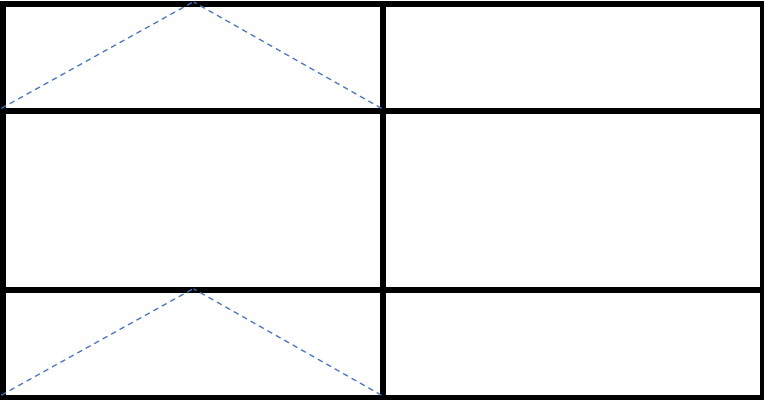

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 6     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         | 2                    | 2           |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | NORTH     |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-18     |
| HEIGHT    |           |
| WIDTH     |           |



|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                                                 |
|-----------------------------------------------------------------|
| NOTES                                                           |
| All surfaces showing signs of deterioration                     |
| Sections separating                                             |
| Centre pane boarded, could be missing for previous hoist access |
|                                                                 |
|                                                                 |
|                                                                 |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-19     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

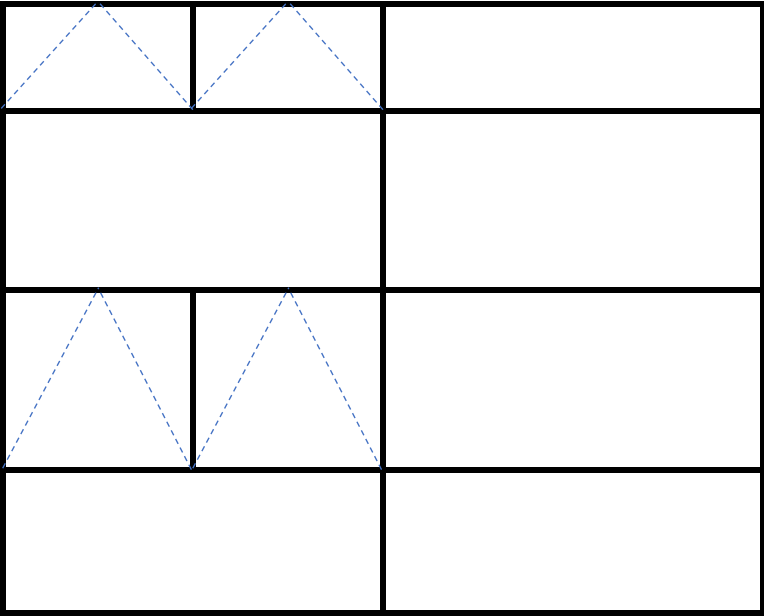

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 4 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 10    |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   | 2                    | 2           |                   |     |  |      |
| SPRING CATCH   | 2                    | 2           |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |




|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-20     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

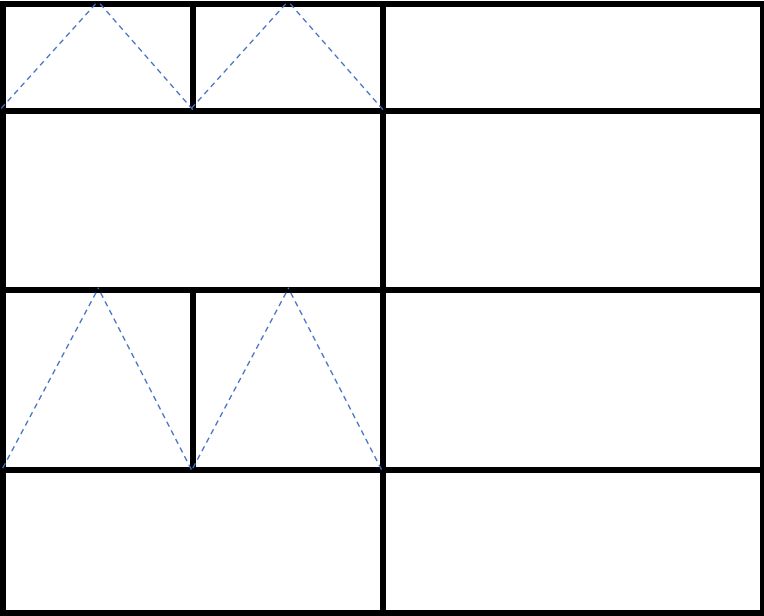

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 10    |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 2           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   | 2                    | 2           |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-21     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

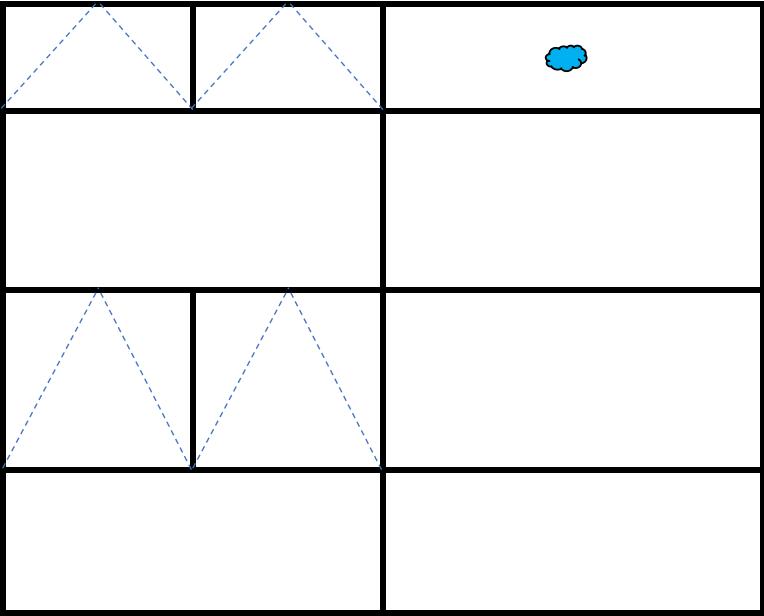

| MATERIAL  |                                     |
|-----------|-------------------------------------|
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

| ACCESS      |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

| OPENING VENTS    |   | FIXED |
|------------------|---|-------|
| TOP HUNG         | 4 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 10    |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

| IRONMONGERY    |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 2           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   | 2                    | 2           |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


| KEY |                             |
|-----|-----------------------------|
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

| NOTES                                       |
|---------------------------------------------|
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

| PHOTOGRAPHIC RECORD |   |  |  |
|---------------------|---|--|--|
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-22     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

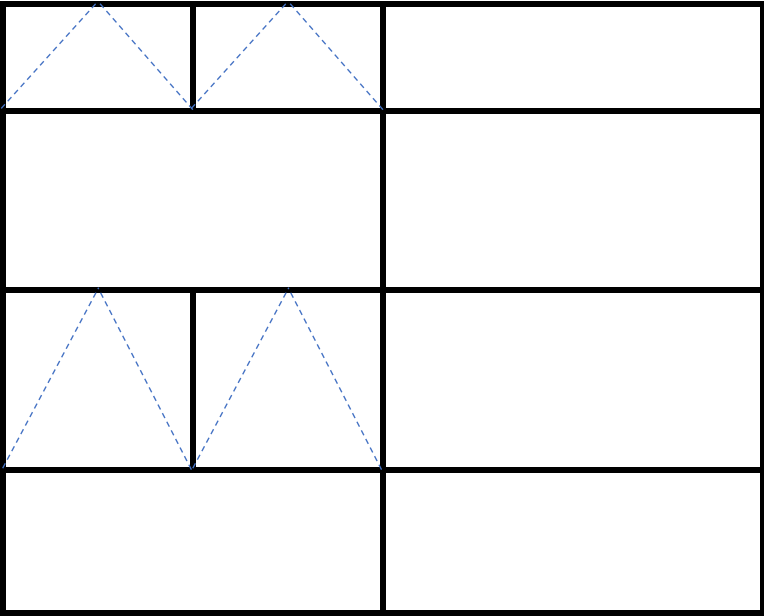

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 4 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 10    |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 2           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   | 2                    | 2           |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-23     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

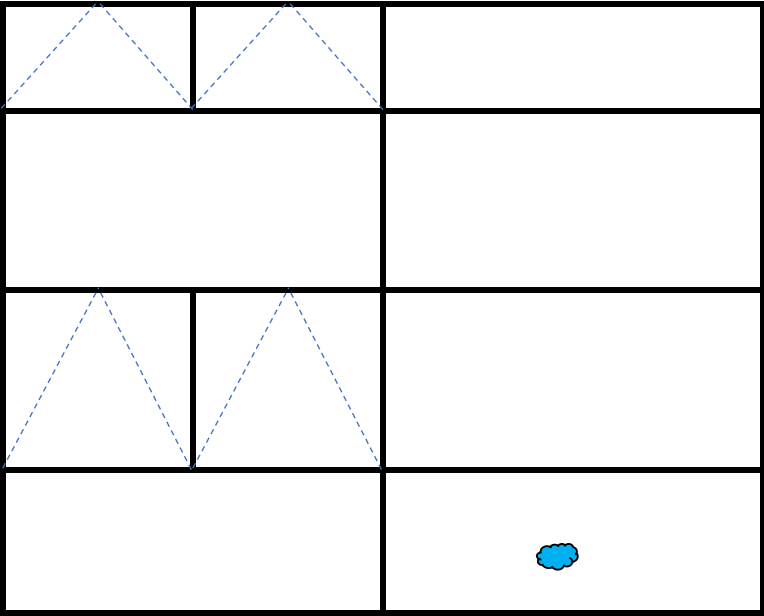

| MATERIAL  |                                     |
|-----------|-------------------------------------|
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

| ACCESS      |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

| OPENING VENTS    |   | FIXED |
|------------------|---|-------|
| TOP HUNG         | 4 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 10    |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

| IRONMONGERY    |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   | 2                    |             |                   |     |  |      |
| SPRING CATCH   | 2                    | 2           |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


| KEY |                             |
|-----|-----------------------------|
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

| NOTES                                       |
|---------------------------------------------|
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

| PHOTOGRAPHIC RECORD |   |  |  |
|---------------------|---|--|--|
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-24     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

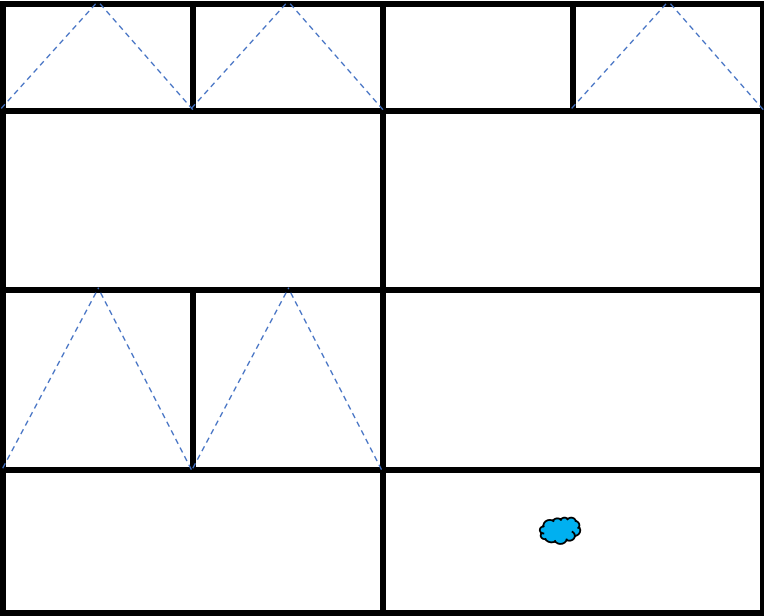

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 5 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 11    |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   | 3                    | 3           |                   |     |  |      |
| SPRING CATCH   | 2                    | 2           |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-25     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

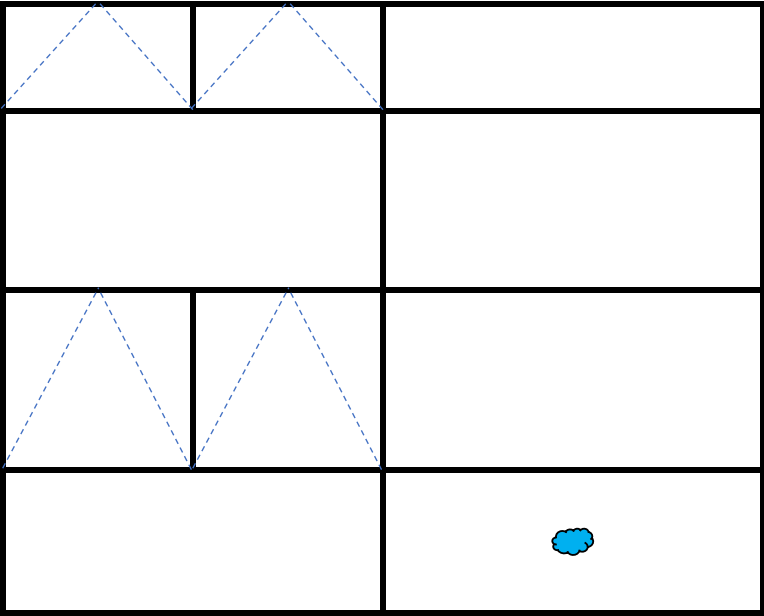

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 4 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 10    |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   | 2                    | 2           |                   |     |  |      |
| SPRING CATCH   | 2                    | 2           |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-26     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

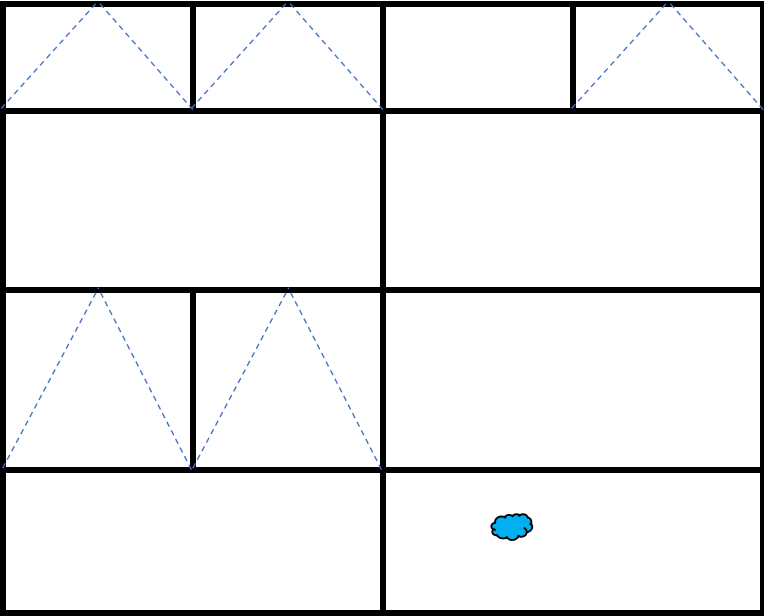

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 5 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 11    |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   | 3                    | 2           |                   |     |  |      |
| SPRING CATCH   | 2                    | 2           |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |

|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |



|  |  |
|--|--|
|  |  |
|  |  |
|  |  |
|  |  |

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> |                                     | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |

|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |



|  |  |
|--|--|
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> |                                     | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |




|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

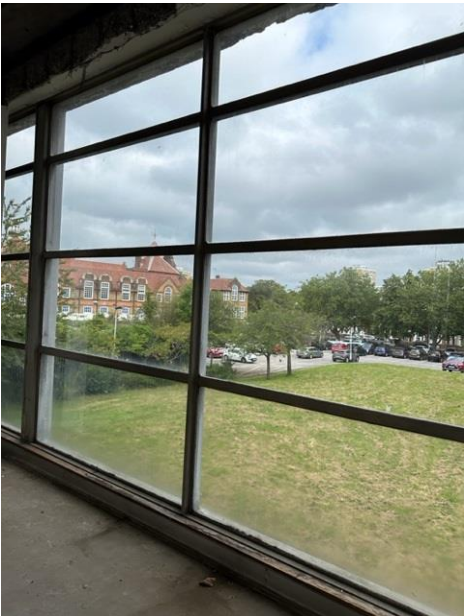

|  |  |
|--|--|
|  |  |
|  |  |
|  |  |
|  |  |

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> |                                     | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |

|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |



|                                                                                   |  |
|-----------------------------------------------------------------------------------|--|
|                                                                                   |  |
|                                                                                   |  |
|  |  |
|                                                                                   |  |

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> |                                     | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |

|                                                                                    |                             |
|------------------------------------------------------------------------------------|-----------------------------|
| KEY                                                                                |                             |
|  | BROKEN PANE                 |
|  | FILMED                      |
|  | CORROSION                   |
|  | AREA OF CONCERN (SEE NOTES) |
|                                                                                    |                             |
|                                                                                    |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |



|  |  |
|--|--|
|  |  |
|  |  |
|  |  |
|  |  |
|  |  |

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> |                                     | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |

|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |



|  |  |
|--|--|
|  |  |
|  |  |
|  |  |
|  |  |

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |  |       |
|------------------|--|-------|
| OPENING VENTS    |  | FIXED |
| TOP HUNG         |  |       |
| HORIZONTAL PIVOT |  |       |
|                  |  |       |
| SINGLE DOOR      |  |       |
| DOUBLE DOOR      |  |       |
|                  |  |       |
|                  |  |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> |                                     | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

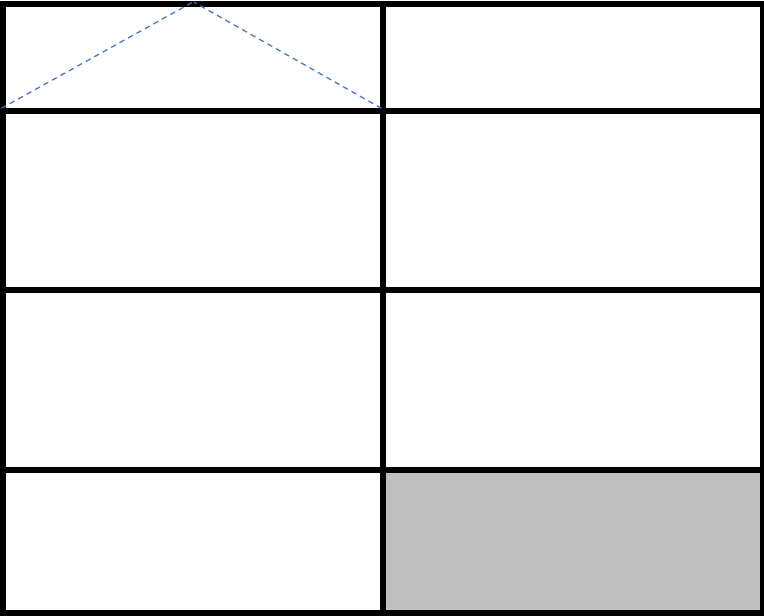

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 2 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 1           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
| Bottom right panel drop down chequer plate  |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

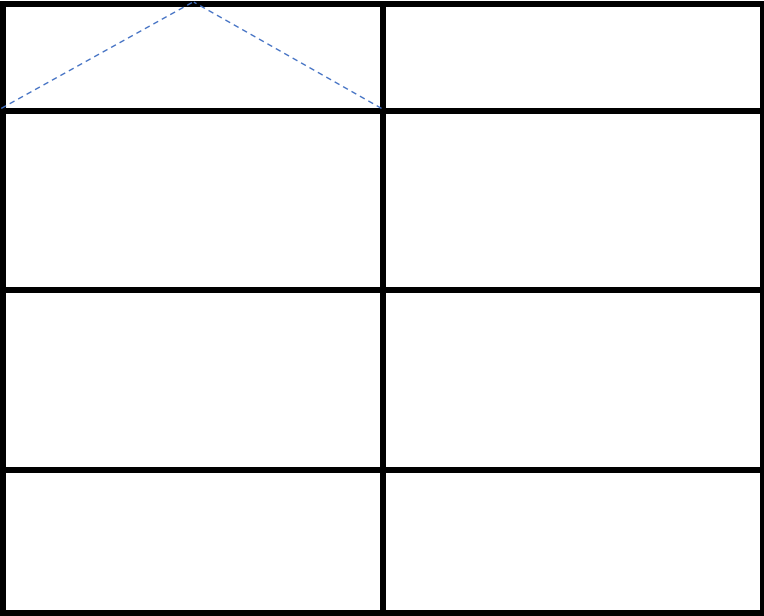

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 1           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

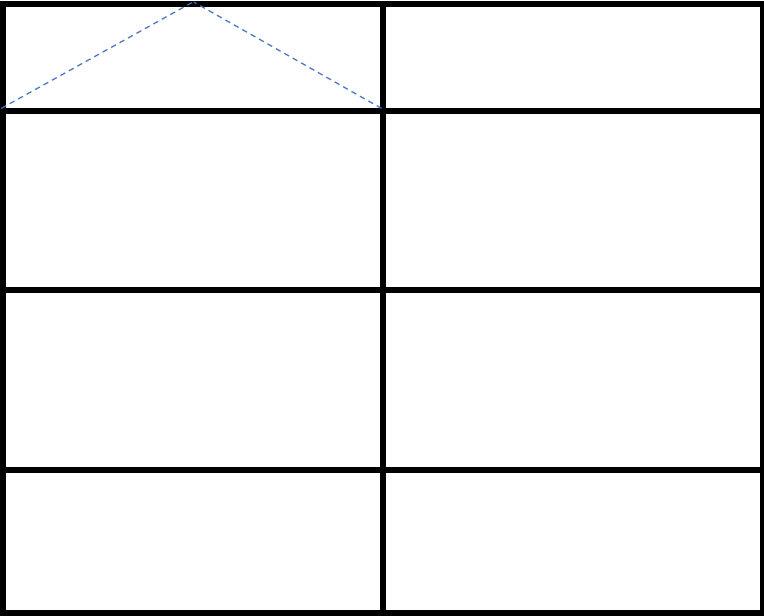

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 1           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

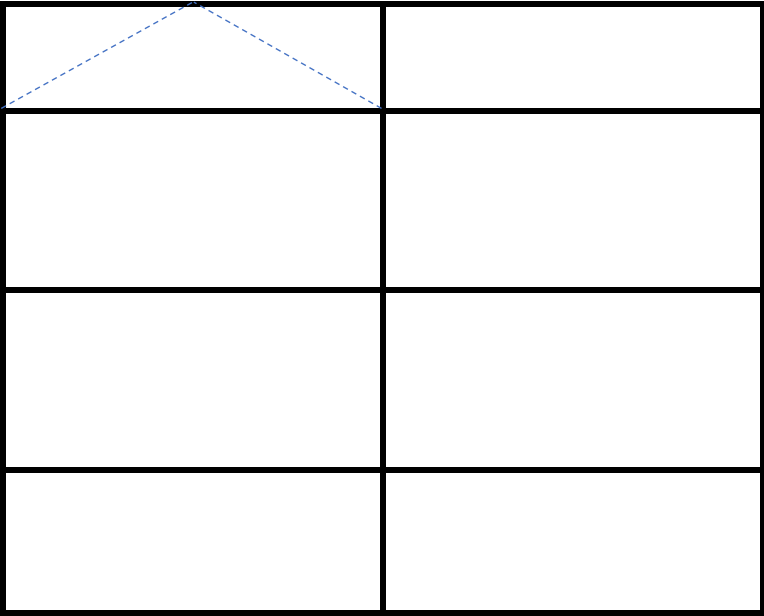

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 1           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

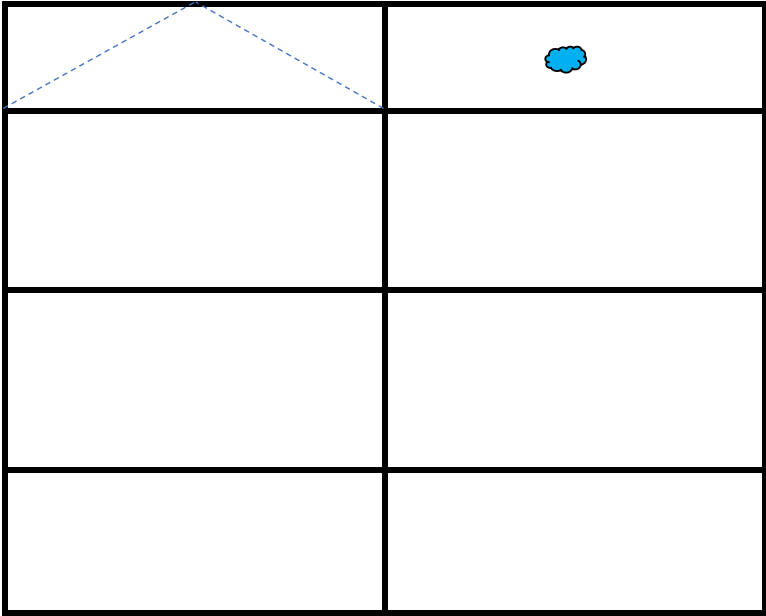

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 1           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |

|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |


|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |



|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

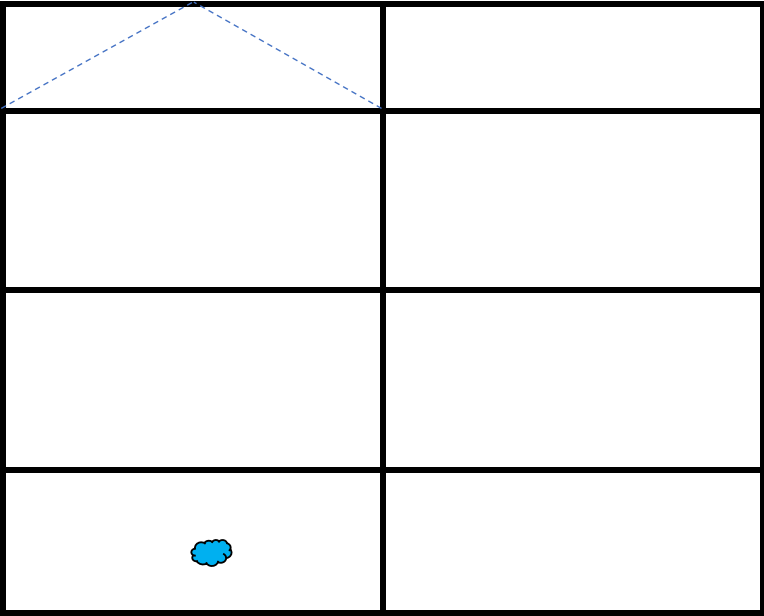

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      |             |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER | 1                    | 1           |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |




|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

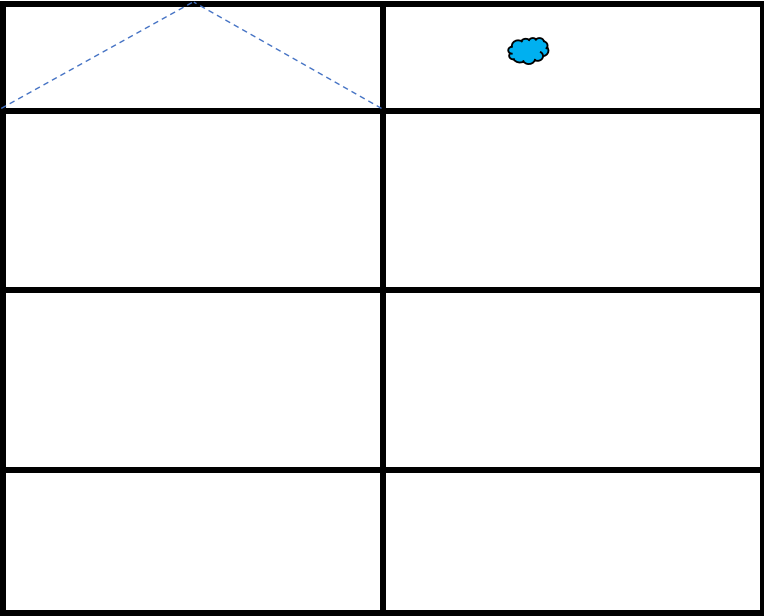

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCUR                              | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 1           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |


|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |

|         |        |                       |
|---------|--------|-----------------------|
| PROJECT | S-2310 | HARINGEY CIVIC CENTRE |
|---------|--------|-----------------------|

|           |           |
|-----------|-----------|
| ELEVATION | WEST      |
| FLOOR     | 1ST FLOOR |
| WIN NO    | W1-27     |
| HEIGHT    | 2.970     |
| WIDTH     | 3.524     |

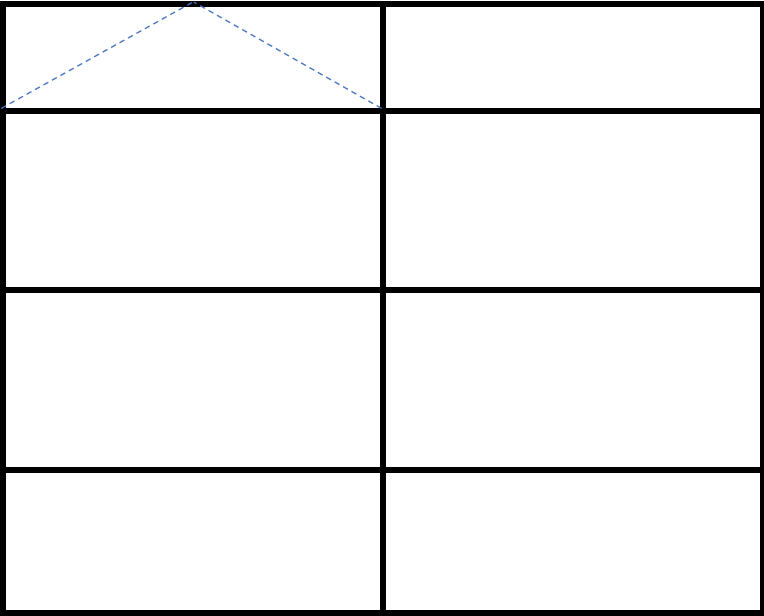

|           |                                     |
|-----------|-------------------------------------|
| MATERIAL  |                                     |
| ALUMINIUM | <input checked="" type="checkbox"/> |
| STEEL     |                                     |
|           |                                     |
| CONDITION |                                     |
| GOOD      |                                     |
| FAIR      |                                     |
| POOR      | <input checked="" type="checkbox"/> |

|             |                                     |             |  |
|-------------|-------------------------------------|-------------|--|
| ACCESS      |                                     |             |  |
| GOOD ACCESS | <input checked="" type="checkbox"/> | POOR ACCESS |  |
| NO ACCESS   |                                     | SECONDARY   |  |
|             |                                     |             |  |

|                  |   |       |
|------------------|---|-------|
| OPENING VENTS    |   | FIXED |
| TOP HUNG         | 1 |       |
| HORIZONTAL PIVOT |   |       |
|                  |   |       |
| SINGLE DOOR      |   |       |
| DOUBLE DOOR      |   |       |
|                  |   |       |
|                  |   |       |

|         |                                     |                                     |                                     |                                     |       |
|---------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------|
| GLAZING |                                     | FILM                                | <input checked="" type="checkbox"/> | PANES                               | 8     |
| SINGLE  | <input checked="" type="checkbox"/> | DOUBLE                              |                                     | UNGLAZED                            |       |
|         | CLEAR                               | OBSCURE                             | WIRED                               | SAFETY                              | MIXED |
| TYPE    | <input checked="" type="checkbox"/> |                                     |                                     |                                     |       |
|         | PUTTY                               | BEAD                                | INTERNAL                            | EXTERNAL                            | MIXED |
| GLAZING |                                     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> |       |
| NOTES   |                                     |                                     |                                     |                                     |       |

|                |                      |             |                   |     |  |      |
|----------------|----------------------|-------------|-------------------|-----|--|------|
| IRONMONGERY    |                      |             |                   |     |  |      |
|                | ORIGINAL REQUIREMENT | NOW PRESENT | MISSING OR BROKEN | ODD |  | TYPE |
| TELEFLEX GEAR  |                      | 1           |                   |     |  |      |
| HANDLE         |                      |             |                   |     |  |      |
| VENT LOCK      |                      |             |                   |     |  |      |
| FOLDING OPENER |                      |             |                   |     |  |      |
| CAM FOLLOWER   |                      |             |                   |     |  |      |
| SPRING CATCH   |                      |             |                   |     |  |      |
| DOOR FURNITURE |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |
|                |                      |             |                   |     |  |      |

|     |                             |
|-----|-----------------------------|
| KEY |                             |
|     | BROKEN PANE                 |
|     | FILMED                      |
|     | CORROSION                   |
|     | AREA OF CONCERN (SEE NOTES) |
|     |                             |
|     |                             |

|                                             |
|---------------------------------------------|
| NOTES                                       |
| All surfaces showing signs of deterioration |
| Sections separating                         |
|                                             |
|                                             |
|                                             |
|                                             |
|                                             |

|                     |   |  |  |
|---------------------|---|--|--|
| PHOTOGRAPHIC RECORD |   |  |  |
| ELEVATION           | 1 |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |
|                     |   |  |  |