

LEVEL MONITORING

for Subsidence Management Services

2 Elms Avenue, Muswell Hill, London, N10 2JP

Client:	Subsidence Management Services
Client Contact:	Chris Sherwin
Claim Number:	4501396609
Client Reference:	IFS-AVI-SUB-21-0093348
Policy Holder:	Mr and Mrs Richard and Maria Corrigan
Report Date:	8 August 2023
Our Ref:	M18000

Level Monitoring Readings


The following table shows the reading levels of the various Level Monitoring Station points.



Date	1	2	3	4	5	6	7	8	9	10
11/10/2021	10.4974	10.5053	10.4960	10.0929	10.0000	9.8414	9.9439	9.9605	9.8382	9.9358
20/12/2021	10.4997	10.5064	10.4964	10.0937	10.0000	9.8409	9.9442	9.9614	9.8393	9.9364
21/02/2022	10.4996	10.5067	10.4963	10.0938	10.0000	9.8399	9.9433	9.9620	9.8404	9.9382
22/04/2022	10.4992	10.5051	10.4960	10.0936	10.0000	9.8404	9.9448	9.9648	9.8422	9.9418
20/06/2022	10.5001	10.5062	10.4962	10.0937	10.0000	9.8409	9.9437	9.9632	9.8416	9.9393
04/10/2022	10.5002	10.5053	10.4963	10.0935	10.0000	9.8390	9.9387	9.9543	9.8318	9.9274
13/10/2022	10.5008	10.5070	10.4966	10.0935	10.0000	9.8390	9.9382	9.9527	9.8291	9.9245
09/12/2022	10.5007	10.5067	10.4977	10.0934	10.0000	9.8381	9.9383	9.9556	9.8334	9.9294
07/03/2023	10.5015	10.5072	10.4974	10.0940	10.0000	9.8392	9.9400	9.9582	9.8363	9.9345
23/05/2023	10.5012	10.5065	10.4970	10.0934	10.0000	9.8393	9.9409	9.9611	9.8363	9.9371
07/08/2023	10.5018	10.5077	10.4981	10.0934	10.0000	9.8394	9.9395	9.9590	9.8340	9.9350

Date	11	12
11/10/2021	8.5728	9.5029
20/12/2021	8.5751	9.5043
21/02/2022	8.5788	9.5078
22/04/2022	8.5848	9.5127
20/06/2022	8.5822	9.5101
04/10/2022	8.5635	9.4953
13/10/2022	8.5596	9.4899
09/12/2022	8.5650	9.4970
07/03/2023	8.5742	9.5032
23/05/2023	8.5769	9.5059
07/08/2023	8.5739	9.5035

Level Monitoring Difference Graphs



The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

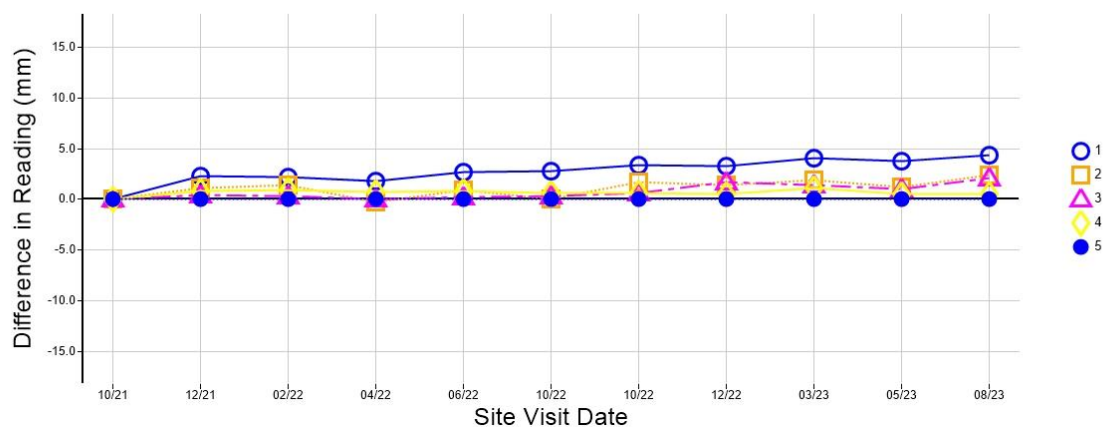

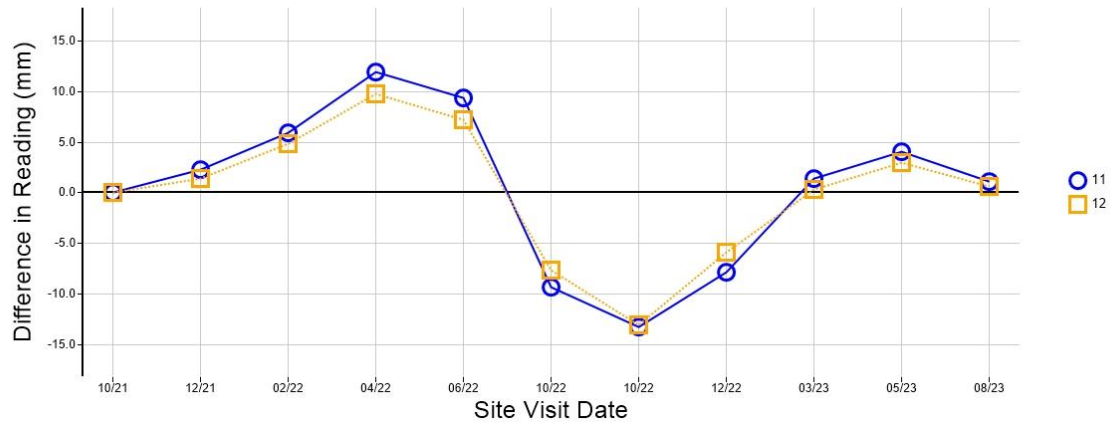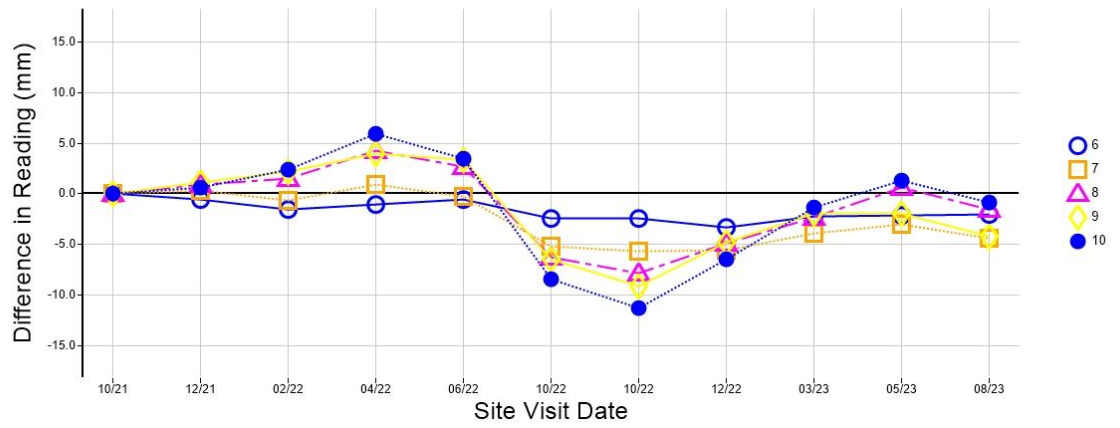

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

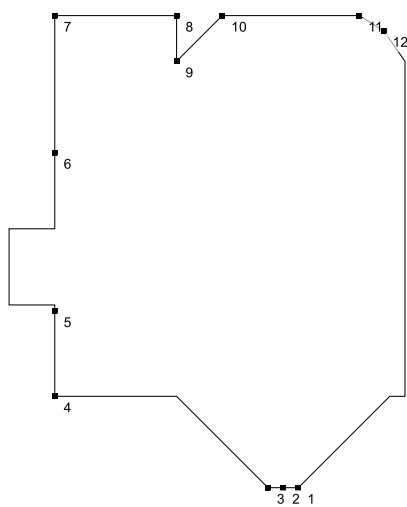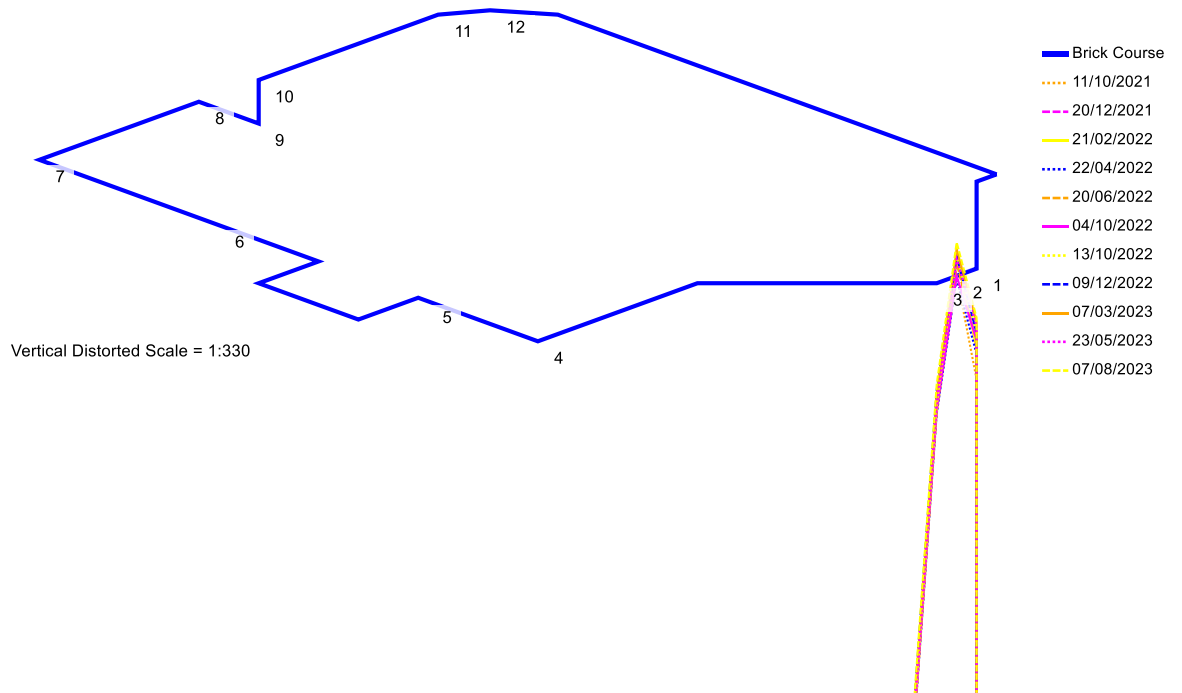

Site Visit Notes

Datum is relative to point 5. It has an assumed value of 10.0000m. There is no suitable remote datum available. If this is not suitable, a deep datum is recommended.

Site Visit: 11 October 2021

Points 1, 2 & 3 on front bay. Points 9 - 12 on bay to rear.