

Monitoring Details:

Provider Name: CET

Monitoring Interval: Every 8 weeks

Instruction Date: 17/11/2022

Number of Visits: 8

Reading Date:

Visits Completed: 4

Date of Issue: 26/09/2023

Visits Outstanding: 4

Client Details:

Client: Sedgwick

Engineer / Handler: Conan Sharp

Job Reference: 9646135

Monitored Address:


Occupier: Alice Victor

Address: Flat 10, 38 Colney Hatch Lane, LONDON, N10 1DU

Telephone: 07757514491

Email: -

Site Plan

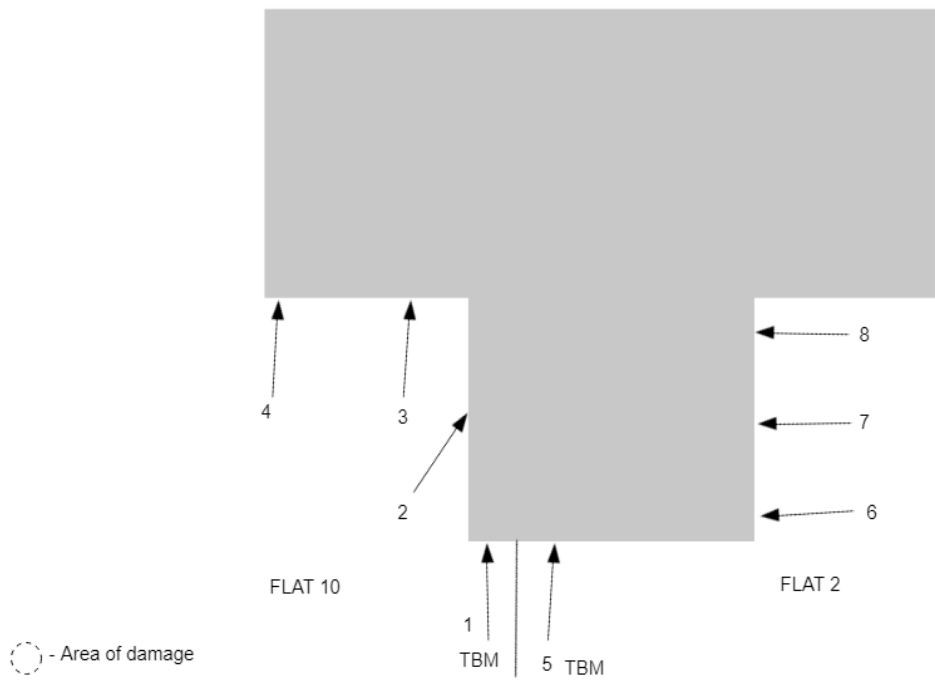

Visit Notes

Visit	Surveyors Note
Visit 2	PH did not open the door for us to take crack readings
Visit 5	Nobody home to take readings at Flat 2


Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	23/02/23	05/05/23	17/07/23	26/09/23					
TBM1	10.0000	10.0000	10.0000	10.0000	10.0000					
2	10.0856	10.0857	10.0858	10.0855	10.0850					
3	10.0925	10.0912	10.0913	10.0921	10.0942					
4	10.1100	10.1093	10.1079	10.1100	10.1138					
Serial number	521856	524015	524015	522887	522887					
Taken by	BA	J.Y	J.Y	BA	BA					

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	23/02/23	05/05/23	17/07/23	26/09/23					
TBM1	0	0	0	0	0					
2	0	+0.1	+0.2	-0.1	-0.6					
3	0	-1.3	-1.2	-0.4	+1.7					
4	0	-0.7	-2.1	0	+3.8					

Level Readings Chart (Points TBM 1 - 4)

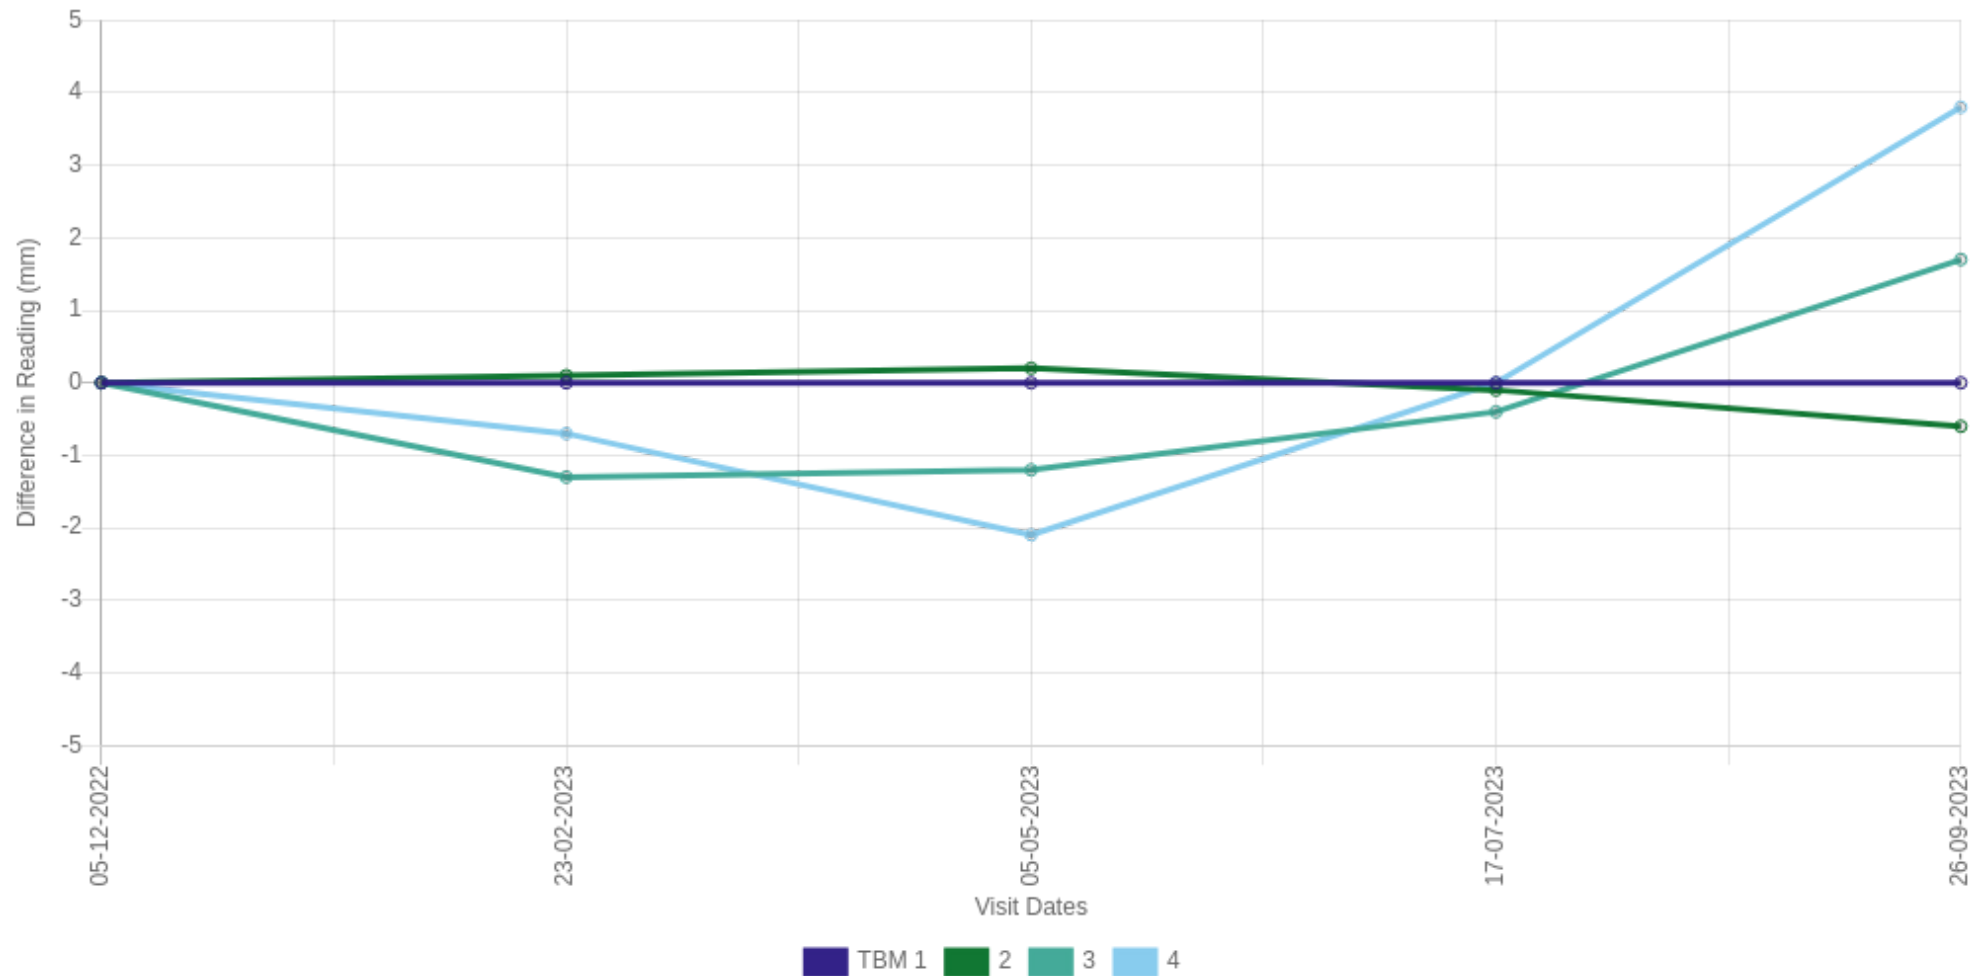

Visit Notes

Visit	Surveyors Note
Visit 2	PH did not open the door for us to take crack readings
Visit 5	Nobody home to take readings at Flat 2


Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	23/02/23	05/05/23	17/07/23	26/09/23					
TBM5		10.0000	10.0000	10.0000						
6		10.2227	10.2211	10.2252						
7		10.3954	10.3939	10.3974						
8		10.4206	10.4195	10.4224						
Serial number	521856	524015	524015	522887	522887					
Taken by	B.A	J.Y	J.Y	B.A	B.A					

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	23/02/23	05/05/23	17/07/23	26/09/23					
TBM5		0	0	0						
6		0	-1.6	+2.5						
7		0	-1.5	+2						
8		0	-1.1	+1.8						

Level Readings Chart (Points TBM 5 - 8)

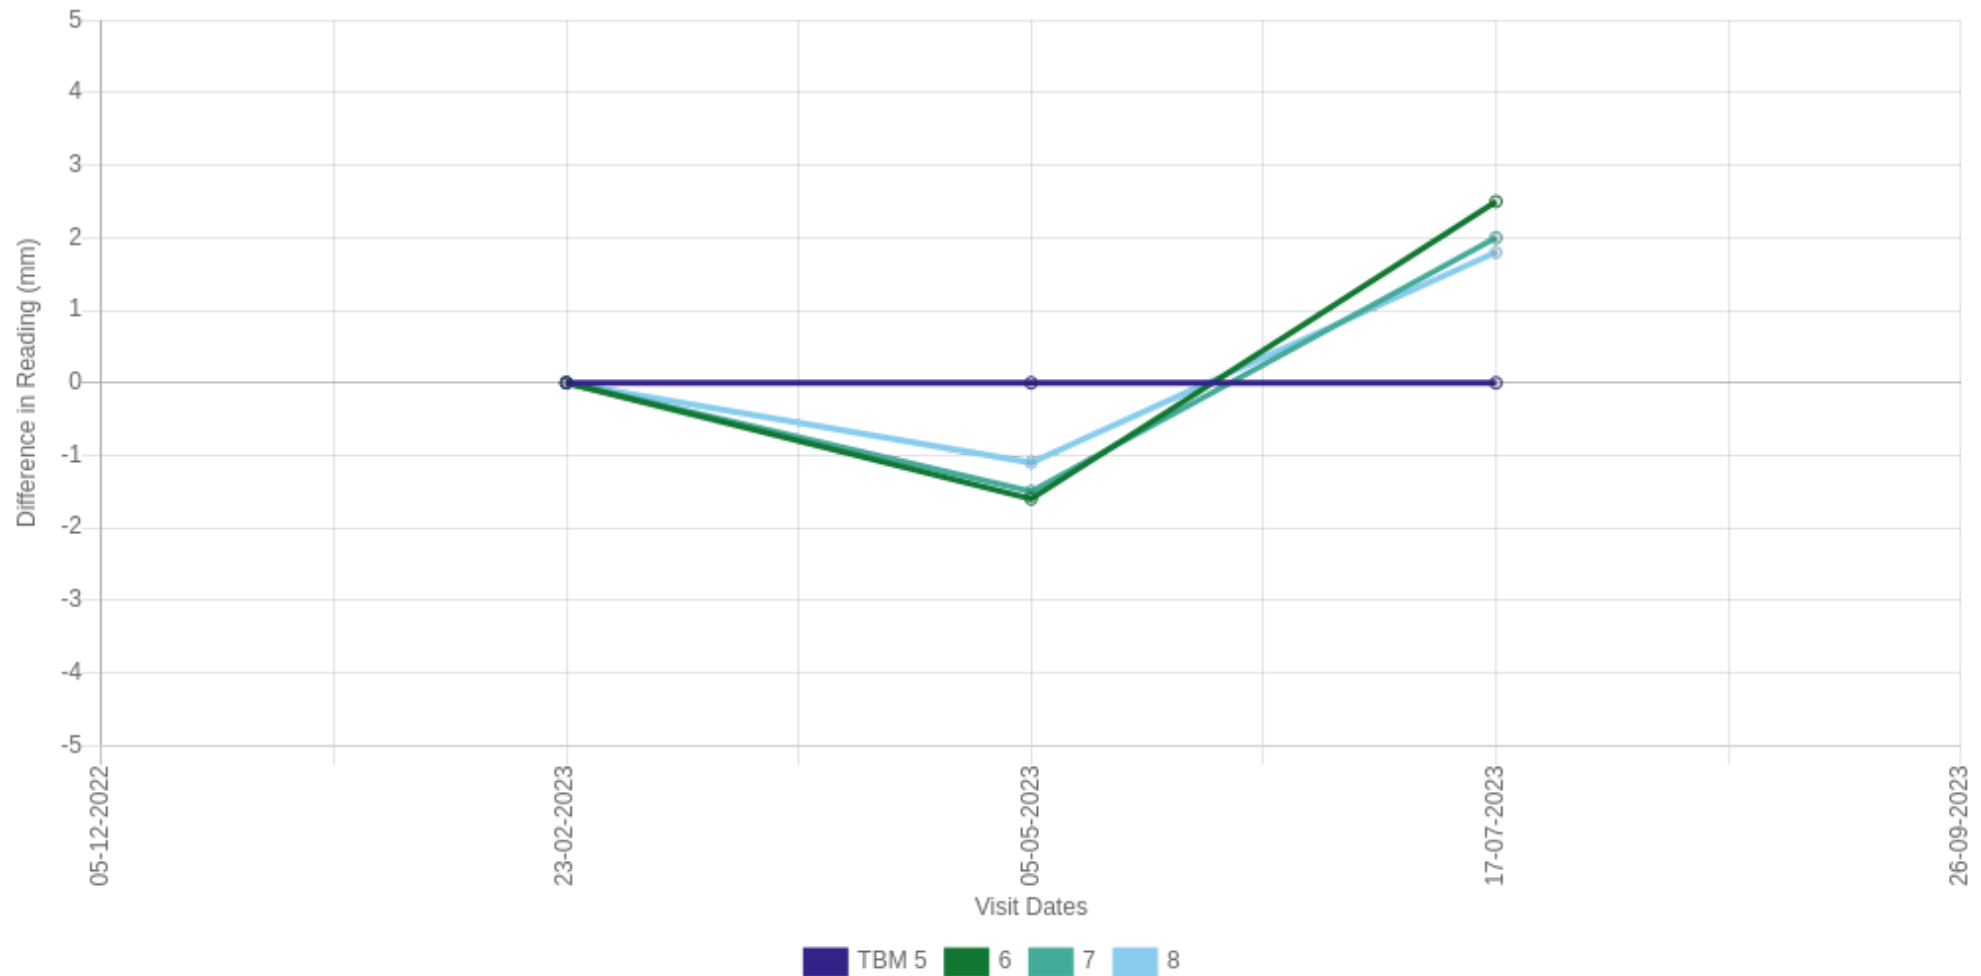


Crack Monitoring

Flat 2 int next to toilet door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	08/02/23	05/05/23	17/07/23						
H	74.37	72.6	71.52	73.52						
D	97.53	96.04	95.13	96.92						
C	66.12	66.59	65.87	65.77						
Callipers	9171	2032	6878	9083						
Taken by	BA	JY	JY	BA						

Flat 2 int next to toilet door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	08/02/23	05/05/23	17/07/23						
H	0	-1.77	-2.85	-0.85						
D	0	-1.49	-2.4	-0.61						
C	0	0.47	-0.25	-0.35						

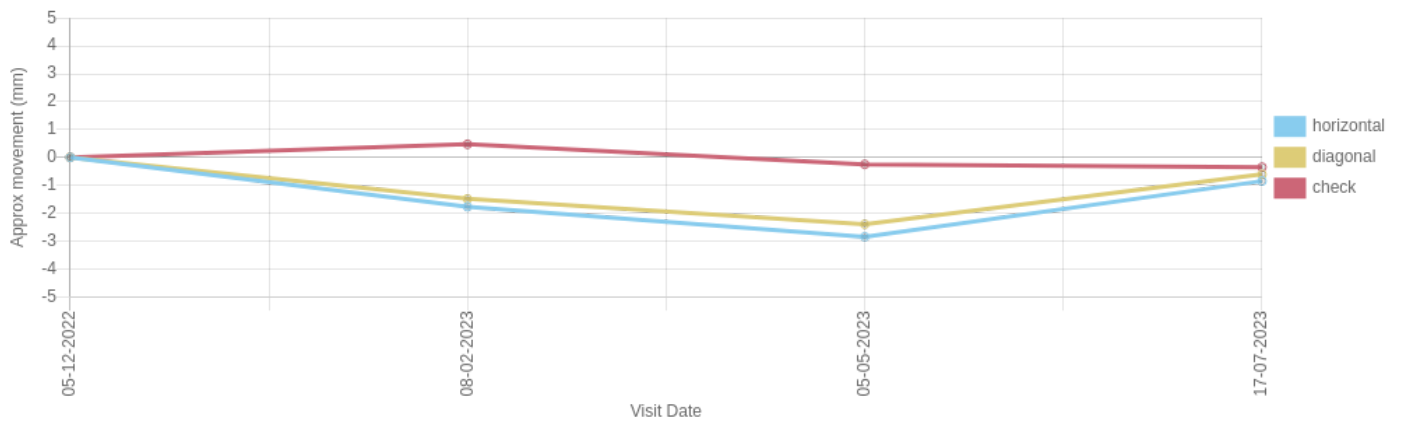

Flat 2 int next to toilet door - Photo




Crack Monitoring

Int flat 2 inside toilet.

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	08/02/23	05/05/23	17/07/23						
H	59.54	57.91	56.76	59.78						
Callipers	9171	2032	6878	9083						
Taken by	BA	JY	JY	BA						

Int flat 2 inside toilet. - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	08/02/23	05/05/23	17/07/23						
H	0	-1.63	-2.78	0.24						

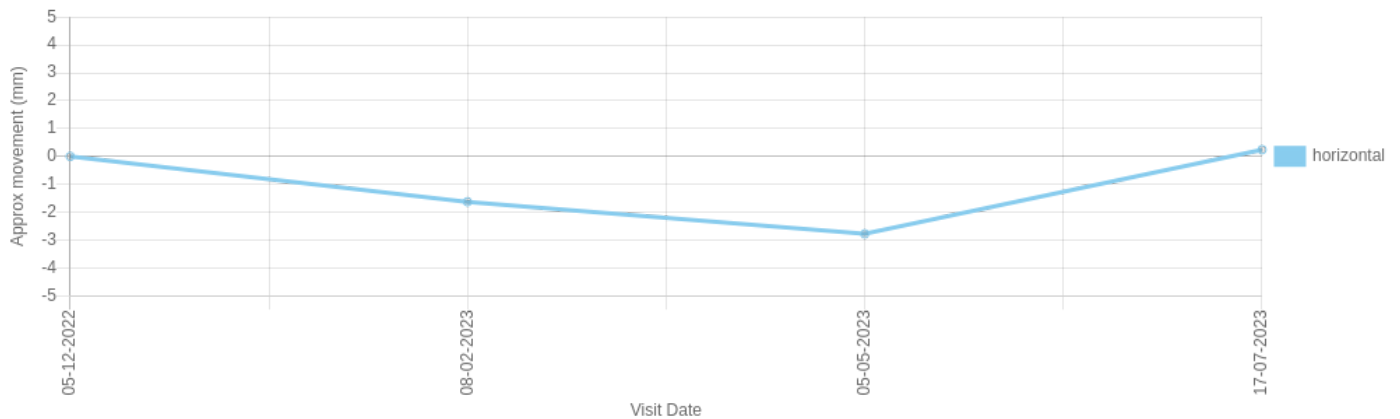

Int flat 2 inside toilet. - Photo




Crack Monitoring

Int flat 2 RHS next to steps..

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	08/02/23	05/05/23	17/07/23						
H	98.33	98.06	98.09	98.49						
Callipers	9171	2032	6878	9083						
Taken by	BA	JY	JY	BA						

Int flat 2 RHS next to steps.. - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	08/02/23	05/05/23	17/07/23						
H	0	-0.27	-0.24	0.16						

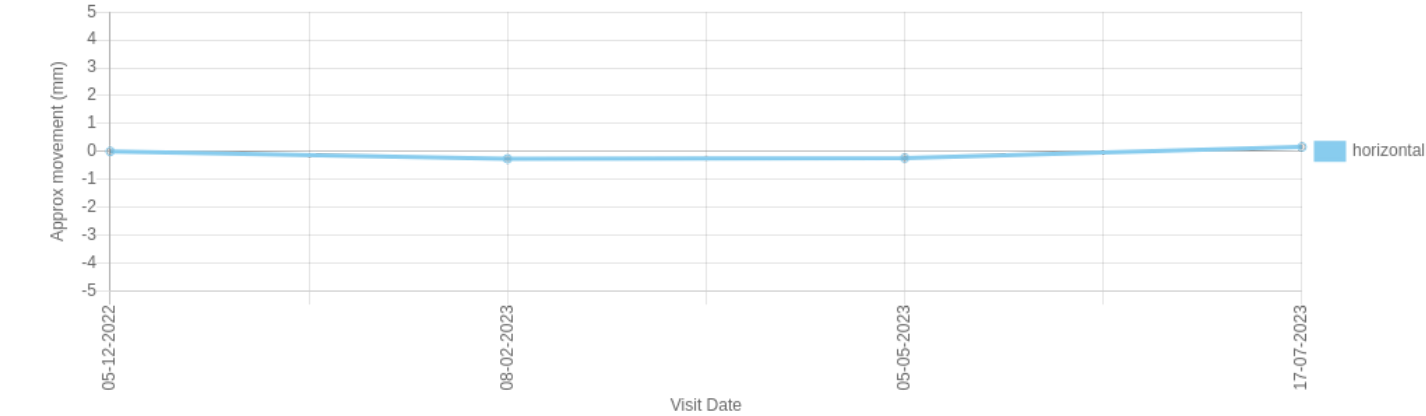

Int flat 2 RHS next to steps.. - Photo

