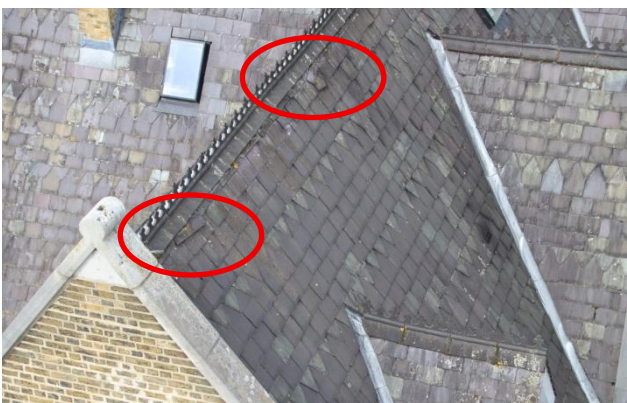


Appendix A – Photo Schedule

Number	Description	Photograph
1.	Old School Court Aerial view of front of property looking south-west, with left-hand transept in the foreground.	
2.	Old School Court Aerial view of front of property looking south-west.	
3.	Old School Court Aerial view of front of property looking west across the right-hand transept.	
4.	Old School Court Aerial view of front of property looking west. Note slipped slates, as indicated.	

Number	Description	Photograph
5.	Old School Court Aerial view of front of property looking south-west.	
6.	Old School Court Aerial view of front of property looking west. Note slipped slates obstructing the valley gutter.	
7.	Old School Court Aerial view of chimney to front of property.	
8.	Old School Court Aerial view of front of property looking west across front roof slope.	

Number	Description	Photograph
9.	Old School Court Aerial view of front roof slope and associated rainwater goods. Note slipped slate obstructing gutter.	
10.	Old School Court Aerial view of flat roof and adjacent dormer to central rear section of main structure.	
11.	Old School Court Aerial view of front of property looking south-west across front elevation to the left-hand transept.	
12.	Old School Court Aerial view of front of property and spire looking west across front elevation	

Number	Description	Photograph
13.	Old School Court Aerial view of front of property looking north-west across front elevation towards the right-hand transept.	
14.	Old School Court Aerial view from front of property looking north-west to south slope of right-hand transept. Note evidence of localised slate replacement surrounding existing rooflight.	
15.	Old School Court Aerial view from front of property looking north-west to south slope of right-hand transept. Note slipped slate at ridge line.	
16.	Old School Court Aerial view from front of property looking north-west to south slope of right-hand transept.	

Number	Description	Photograph
17.	Old School Court Aerial view from front of property looking north-west to south slope of right-hand transept. Note faded and discoloured roof covering.	
18.	Old School Court Aerial view from front of property looking north-west to south slope of right-hand transept. Note slipped slates obstructing valley gutter.	
19.	Old School Court Aerial view of front of property looking north-west across front elevation towards the right-hand transept.	
20.	Old School Court Aerial view from front of property showing valley at junction of right-hand transept with main structure.	

Number	Description	Photograph
21.	Old School Court Aerial view of spire.	
22.	Old School Court Aerial view of chimney associated with central transept. Note open flue.	
23.	Old School Court Aerial view from front of property showing valley at junction of left-hand transept with main structure. Note slipped slate.	
24.	Old School Court Aerial view from front of property showing north facing roof slope of left-hand transept. Note open flue.	

Number	Description	Photograph
25.	Old School Court Aerial view from front of property showing north facing roof slope of left-hand transept and associated flat roofs.	
26.	Old School Court Close up view of flat roof to north elevation of left-hand transept. See also Photo 25.	
27.	Old School Court Aerial view from south elevation of left-hand transept.	
28.	Old School Court Close up view of Photo 27. Note that gutter appears to be holding water.	

Number	Description	Photograph
29.	Old School Court Aerial view from south flank elevation to rear (west facing) roof slope of main structure.	
30.	Old School Court Distant view of Photo 29. Note ponding to flat roof.	
31.	Old School Court Close up view of flat roof referenced in Photo 30. Note sediment build up to back gutter in addition to flooded flat roof.	
32.	Old School Court View of south roof slope to central transept. Note minor deflection to ridge line.	

Number	Description	Photograph
33.	Old School Court View of south face of spire, and south roof slope of right-hand transept. Note evidence of historic localised replacement.	
34.	Old School Court Close up view of Photo 33.	
35.	Old School Court View of single storey rear addition to left-hand transept. Note slipped slates obstructing gutter.	
36.	Old School Court Alternate view of Photo 35.	

Number	Description	Photograph
37.	Old School Court Aerial view from south-west corner of block to rear roof slope (west elevation) of main structure. Note open flue.	
38.	Old School Court Alternate view of Photo 37. Note open chimney flue and obstructed gutter.	
39.	Old School Court Close up view of Photo 37, showing rear roof slope and associated dormers to main structure. Note staining to roof covering and obstructed gutter.	
40.	Old School Court View of mono-pitched roof to rear of main structure. Note water staining to slates at base of downpipe and adjacent brickwork.	

Number	Description	Photograph
41.	Old School Court View of mono-pitched roof to rear of main structure, adjacent Photo 40. Note heavy staining and discolouration to slates.	
42.	Old School Court View of north roof slope to left-hand transept. Note evidence of historic repairs to existing rooflight surrounds.	
43.	Old School Court View of west (rear) roof slope to main structure. Note staining of slates attributed boiler flue, and open chimney flue.	
44.	Old School Court View of rear valley at junction of right-hand transept with main structure. Note slipped slates obstructing valley gutter.	

Number	Description	Photograph
45.	Old School Court View of rear valley at junction of right-hand transept with main structure. See also Photo 44.	
46.	Old School Court View of south roof slope to right-hand transept.	
47.	Old School Court Close up view of Photo 46.	
48.	Old School Court Alternate view of Photo 47. Note evidence of localised repair to existing rooflight surround, and hole within roofing covering attributable to slipped slate.	

Number	Description	Photograph
49.	Old School Court View of junction of addition roof slope to rear of main structure.	 An aerial photograph showing the junction of a new roof slope (darker, more uniform tiles) and an existing roof slope (lighter, more varied tiles) on a brick building. A window with white frames is visible on the upper right side of the building.
50.	Old School Court View of north elevation and roof slope of right-hand transept.	 A wide aerial photograph showing the north elevation and roof slope of a large brick building. The building features multiple chimneys, dormer windows, and a complex roof structure. The surrounding area includes other buildings and greenery.