

LEVEL MONITORING

for SMS (AVI, PRE)

27 Waltheof Avenue, London, N17 7PL

Client:	SMS (AVI, PRE)
Client Contact:	Refer to iSubs
Claim Number:	4504093663
Client Reference:	IFS-AVI-SUB-25-0124519
Policy Holder:	Mr Zhiyin Li 27 Waltheof Avenue, London, N17 7PL
Report Date:	29 April 2026
Our Ref:	M25919


Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5
15/12/2025	10.6410	10.6520	10.6378	10.6741	10.6743
19/02/2026	10.6438	10.6547	10.6387	10.6741	10.6740
20/04/2026	10.6412	10.6518	10.6353	10.6707	10.6698



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

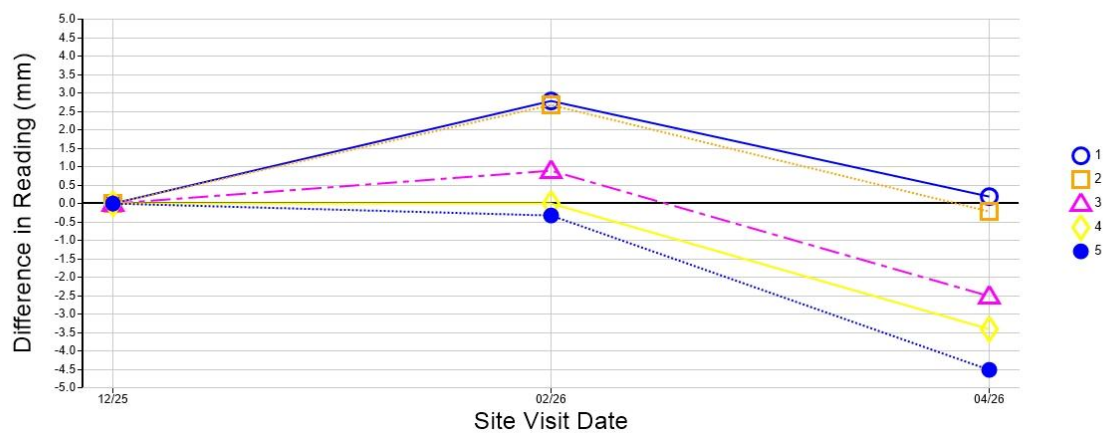

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

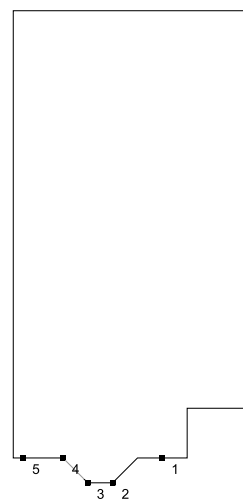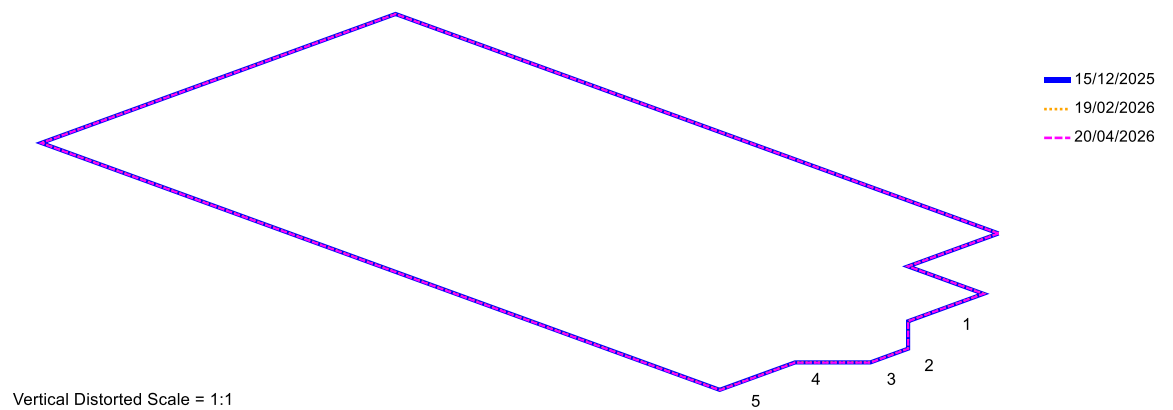

FRONT

Site Visit Notes

Datum is a manhole within the road, it has an assumed value of 10.0000m. No secondary datum point. Please advise if a deep datum is required.

Site Visit: 15 December 2025

Relative survey. Stations fixed to front only as PH advised didn't want fixing to the rear. If this is not okay then please contact the insured and explain and then advise us prior to the next visit.