


LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details			Client Details			Risk Address		
Name:	Knight & Associates Ltd		Insurance Co.:	Axa		Occupier:		
Our Ref:	SU2200639		Client Name:	Crawford		Address:		
			Technical Mgr:	J Joannou		Address:		
			Email:			Town:		
			Client Ref:			County:		
Monitoring Details			Address:	National Subsidence Unit		Post Code:		
Instruction Date:	8/4/22		Address:	4th Floor 30 St Pauls Square		Tel Home:		
First Reading Date:	11/04/2022		Town:	Birmingham		Tel Work:		
Maximum No Visits:	SB		County:			Mobile:		
Anticipated Expiry Date:	Late 23		Post Code:	B3 1QZ		Other:		
Monitoring Int (Wks):	8		Other Email:	subsidence.monitoring@crawco.co.uk		Other:		

Target Date:															
Reading Date:				11/4/22	6/6/22	11/8/22	3/10/22	1/12/22	9/2/23	11/4/23	21/7/23	12/10/23			
Issue Date:				11/4/22	7/6/22	11/8/22	3/10/22	2/12/22	9/2/23	11/4/23	24/7/23	12/10/23			
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11	12
1	1	0.00	0.00	12.7100	12.7090	12.7060	12.7020	12.7070	12.7110	12.7110	12.7070	12.7050			
2	2	6.00	0.00	12.6480	12.6480	12.6460	12.6450	12.6480	12.6520	12.6530	12.6480	12.6450			
3	3	10.00	0.00	12.7570	12.7550	12.7280	12.7250	12.7360	12.7470	12.7530	12.7350	12.7260			
4	4	14.30	0.00	12.7990	12.7910	12.7500	12.7440	12.7540	12.7700	12.7780	12.7610	12.7470			
5	5	14.30	6.20	12.8970	12.8900	12.8600	12.8440	12.8620	12.8730	12.8780	12.8610	12.8500			
6	6	7.00	6.20	12.7400	12.7400	12.7410	12.7370	12.7410	12.7440		12.7400	12.7390			
7	7	0.00	6.20	12.8300	12.8300	12.8300	12.8280	12.8300	12.8330	12.8330	12.8290	12.8280			
8		0.00	0.00												
9															
10															
11															
12															
13															
14															
15															
16															
17															
18															
19															
20															
21															
22															
23															
24															
25															
26															
27															
28															
29															
30															
31															
32															

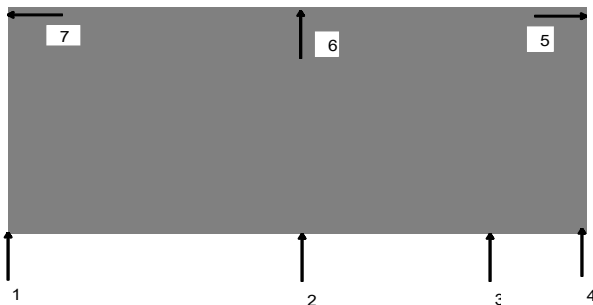

Remote datum


FRONT.

- 12/10/23 Readings taken 11/04/23 Cannot read point 6. 11/04/22 Points fitted where possible.
- A common brickcourse could not be followed, subsequently relative data only.
- A further visit is due in Dec

LEVEL MONITORING - RELATIVE MOVEMENT SKETCH

Client: Crawford

Client Ref: 0

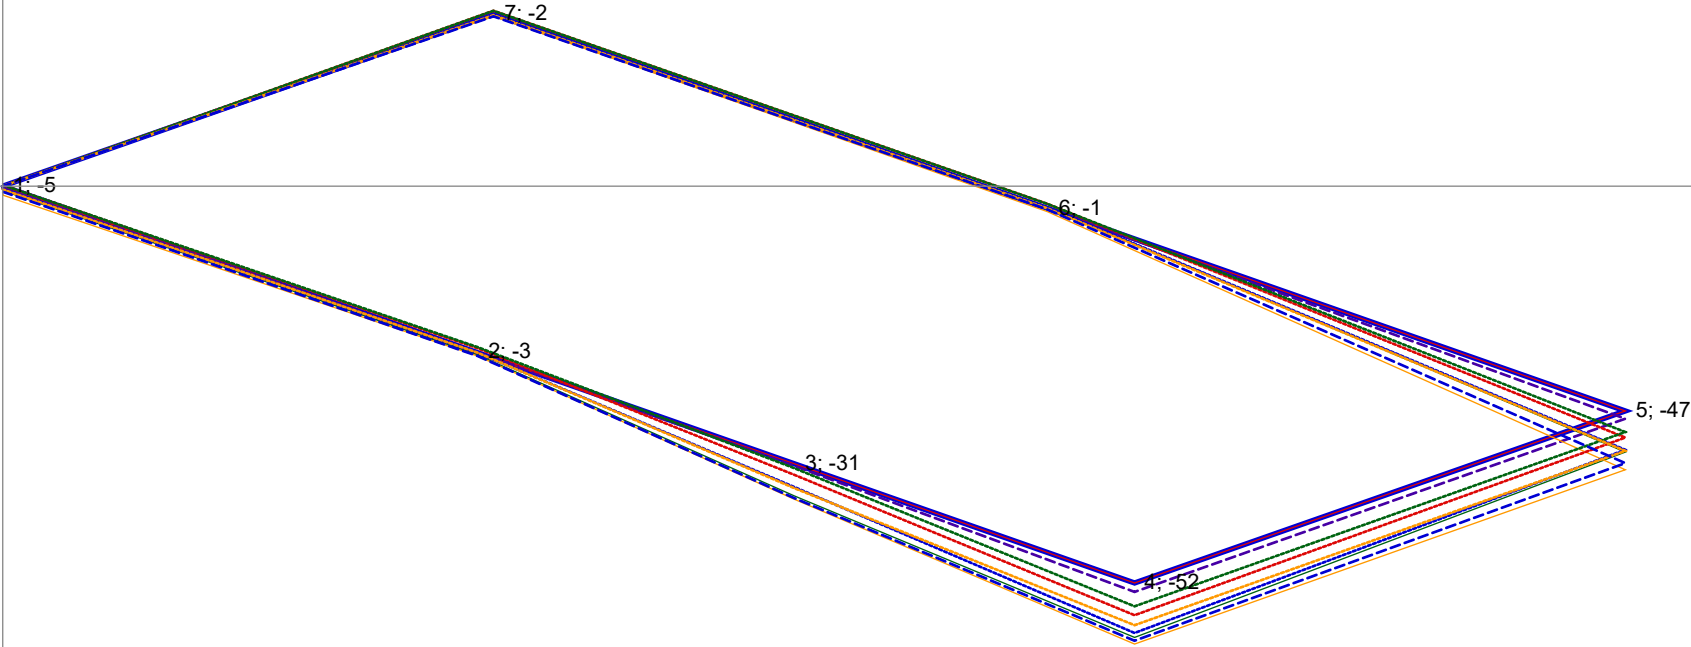

Datum Reading	Reading 1 (11/4/22)	Reading 2 (6/6/22)	Reading 3 (11/8/22)	Reading 4 (3/10/22)	Reading 5 (1/12/22)	Reading 6 (9/2/23)
Reading 7 (11/4/23)	Reading 8 (21/7/23)	Reading 9 (12/10/23)	Reading 10 (0/1/00)	Reading 11 (0/1/00)	Reading 12 (0/1/00)	

Notes:
Vertical distorted scale 1: 20

Point labels give level difference of last reading from original datum in mm.

LEVEL MONITORING - RELATIVE SURVEY READINGS


Client: Crawford

Client Ref:


0

Chart Scale 1:1000


1

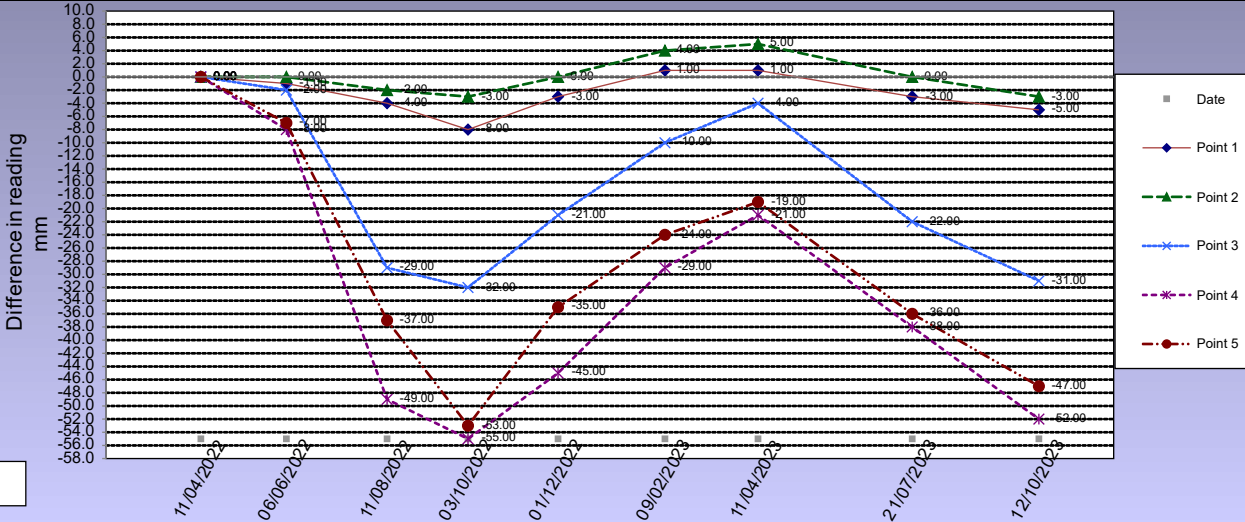

2

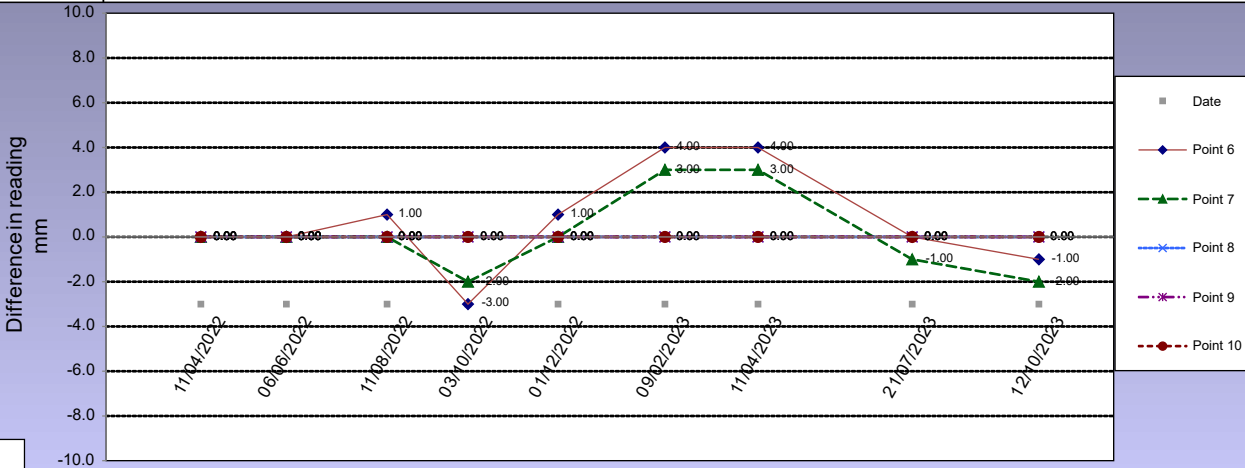

3

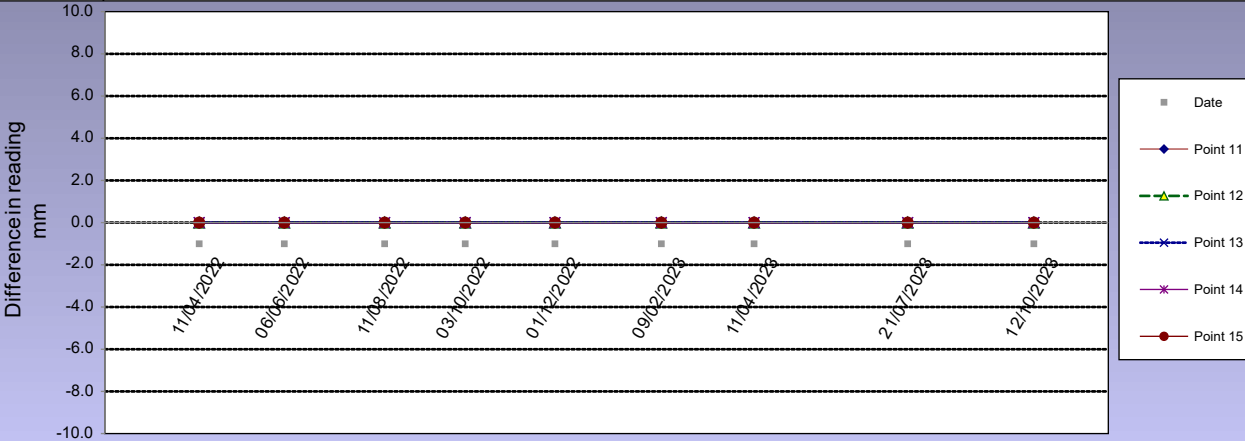

Standard Comments for selection in Readings and Sketch Worksheets
User may edit these as appropriate

Standard Comments	
No Comment	
Standard Comment 1	A further visit is due in
Standard Comment 2	No further readings are planned
Standard Comment 3	The Insured requested an update.
Standard Comment 4	Points fitted and readings taken.
Standard Comment 5	

Standard Bullet
●