

Monitoring Details:

Level Monitoring

Provider Name: My Home Needs

Monitoring Interval: Every 6 weeks

Instruction Date: 27/06/2023

Number of Visits: 50

Reading Date: 09/06/2024

Visits Completed: 6

Date of Issue: 10/06/2024

Visits Outstanding: 44

Client Details:

Client: Questgates

Engineer / Handler: -

Job Reference:


Monitored Address:

Address: 2 Ringwood Avenue, London, N2 9NS

Front Elevation



Site Plan

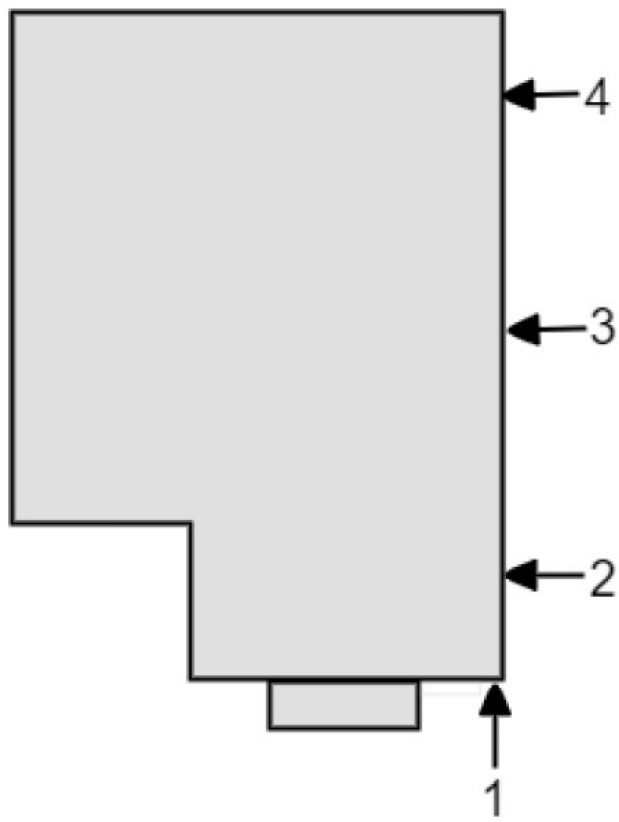


Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	17/07/23	05/10/23	16/01/24	25/02/24	24/04/24	09/06/24		
1	10.7362	10.7352	10.7399	10.7414	10.7433	10.7406		
2	10.7388	10.7368	10.7422	10.7432	10.7432	10.7411		
3	10.8369	10.8356	10.8374	10.8380	10.8390	10.8363		
4	10.8432	10.8437	10.8434	10.8436	10.8454	10.8429		
Taken by	N/A	N/A	TP	BJ	BA	BJ		
Serial number			524791	523158	523149	523158		


Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	17/07/23	05/10/23	16/01/24	25/02/24	24/04/24	09/06/24		
1	0	-1	+3.8	+5.2	+7.1	+4.4		
2	0	-2	+3.5	+4.4	+4.4	+2.3		
3	0	-1.3	+0.6	+1.1	+2.1	-0.6		
4	0	+0.5	+0.3	+0.4	+2.2	-0.3		

Level Readings Chart (Points 1 - 4)

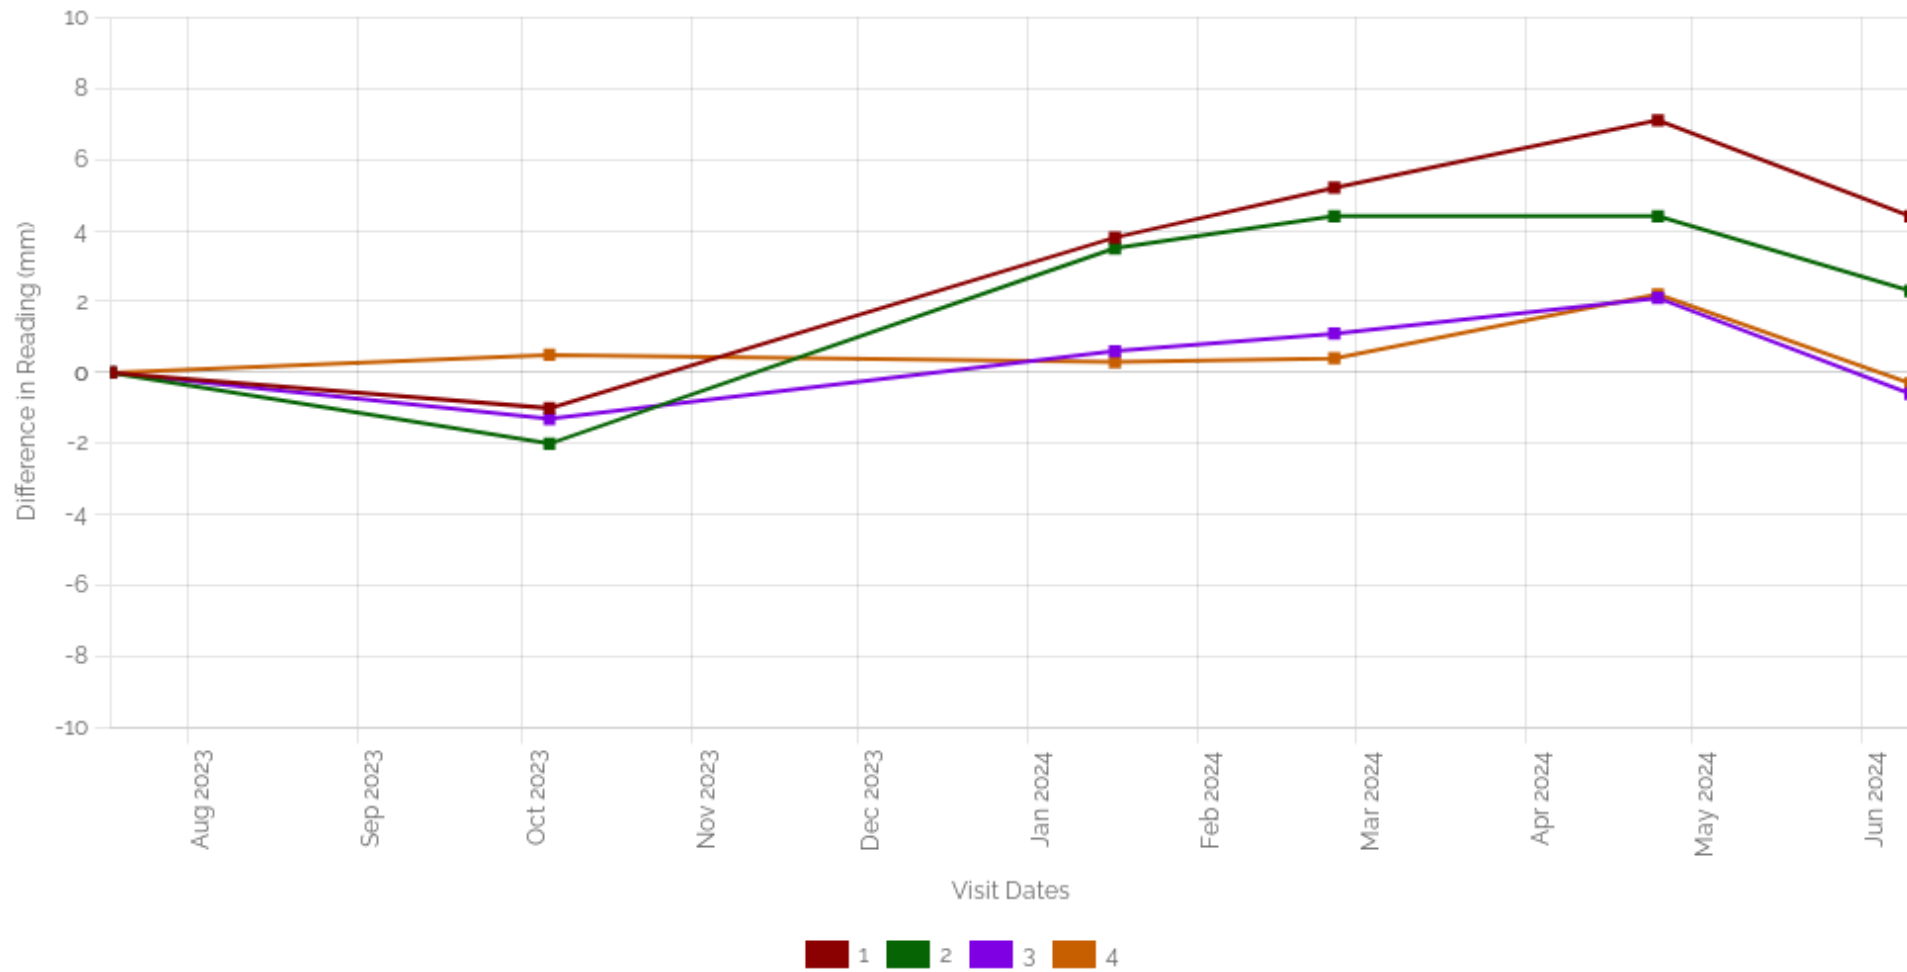

Relative Movement (Relative Survey, for illustration purposes only)

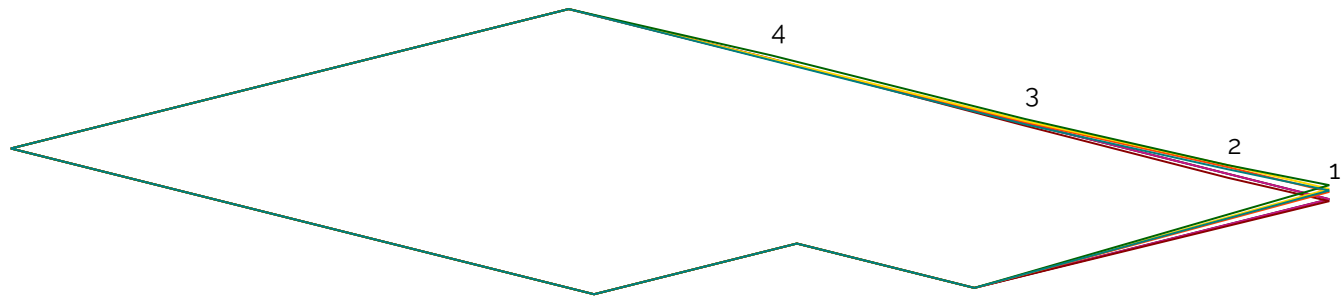

16/07/2023

04/10/2023

16/01/2024

25/02/2024

23/04/2024

08/06/2024